NINETEENTH ANNUAL REPORT
OF THE CONTINUING SURFACE WATER
QUALITY MONITORING PROGRAM FOR
CATFISH, NORTH AND SOUTH CREEKS
ON THE PALMER RANCH
SARASOTA COUNTY, FLORIDA
JANUARY – DECEMBER 2003

January 2004

Submitted to: Pa

Palmer Ranch Holdings, Ltd.

8588 Potter Park Drive

Suite 500

Sarasota, Florida 34238

Prepared by:

VHB/Vanasse Hangen Brustlin, Inc.

5010 U.S. Highway 19 North

Post Office Box 35

Palmetto, Florida 34220

941-722-6667

Gary M. Serviss, MS

Senior Environmental Scientist

### PRINCIPAL PROJECT PARTICIPANTS

# VANASSE HANGEN BRUSTLIN, INC.

Gary M. Serviss, MS

Senior Environmental Scientist

Thomas D. Dostal

**Environmental Scientist** 

James W. McGavic

Field Services

Florentyna N. Baggett

Field Services

# TABLE OF CONTENTS

				Page			
1.0	INTR	ODUCTIO	N	1-1			
2.0	GENI	ERAL ENV	/IRONMENTAL SETTING	2-1			
	2.1		te				
	2.2						
	2.3		Use and Vegetation				
	2.4		age				
		2.4.1	Catfish Creek				
		2.4.2	Trunk Ditch	2-6			
		2.4.3	North Creek	2-7			
		2.4.4	South Creek	2-7			
		2.4.5	Elligraw Bayou	2-7			
		2.4.6	Matheny Creek	2-7			
		2.4.7	Clower Creek				
	2.5	Water	Quality Classification	2-8			
3.0	FIELD	AND LA	BORATORY PROCEDURES	3-1			
	3.1	Station Locations and General Descriptions					
	3.2	Parameters and Sampling Frequency					
4.0	RESULTS AND DISCUSSION						
	4.1	Rainfa	ıll and Hydrology	4-1			
		4.1.1	Rainfall	4-1			
		4.1.2	Stream Stage				
		4.1.3	Stream Flow				
	4.2	Physic	al Water Quality Parameters				
		4.2.1	Water Temperature				
		4.2.2	Specific Conductance				
		4.2.3	Total Suspended Solids				
		4.2.4	Turbidity				
	4.3		n Demand and Related Parameters				
		4.3.1	Biochemical Oxygen Demand				
		4.3.2	Dissolved Oxygen	4-15			
		4.3.3	Water pH				
	4.4		nutrients				
		4.4.1	Total Nitrogen				
		4.4.2	Nitrite				
		4.4.3	Nitrate				
		4.4.4	Ammoniacal Nitrogen				
		4.4.5	Organic Nitrogen				
		4.4.6	Total Phosphorus				
		4.4.7	Orthophosphate				
		4.4.8	Nutrient Ratios				
	4.5	Oils an	d Greases	4-36			

# TABLE OF CONTENTS (CONTINUED)

			<u>Page</u>
	4.6	Bacteriological Parameters	4-37
		4.6.1 Total Coliform	4-37
		4.6.2 Fecal Coliform	4-38
	4.7	Trace Elements	4-39
5.0	Refer	ENCES	5-1
Append	lix A:	Exhibit "E"	
Append	lix B:	Catfish and North Creek Water Quality Data	
Append	lix C:	South Creek Water Quality Data	
Append	lix D:	Quarterly Data Tables	
Append	lix E:	Project Team	

# LIST OF FIGURES

		<u>Page</u>
Figure 1.1	General Site Location	1-2
Figure 2.1	Soil Associations in Region	2-3
Figure 3.1	Locations of Surface Water Monitoring Stations	3-2
Figure 4.1	Historic Rainfall Versus Actual Rainfall Recorded at Oscar Scherer State Park from October 2002 through October 2003	4-4
Figure 4.2	Stream Flows Measured During Monitoring Events Conducted on the West Side of the Palmer Ranch from January through December 2003	4-7
Figure 4.3	Stream Flows Measured During Monitoring Events Conducted on the East Side of the Palmer Ranch from January through December 2003	4-9
Figure 4.4	Average Nitrogen Concentrations Measured on the West Side of the Palmer Ranch from the Second through the Nineteenth Monitoring Years	4-19
Figure 4.5	Average Nitrogen Concentrations Measured on the East Side of the Palmer Ranch from the Second through the Nineteenth Monitoring Years	4-22
Figure 4.6	Average Phosphorus Concentrations Measured on the West Side of the Palmer Ranch from the Second through the Nineteenth Monitoring Years	4-29
Figure 4.7	Average Phosphorus Concentrations Measured on the East Side of the Palmer Ranch from the Second through the Nineteenth Monitoring Years	4-31

# LIST OF TABLES

		Page
Table 2.1	Average Monthly Air Temperatures (National Weather Service, Tampa, Florida)	2-1
Table 2.2	Descriptions of Soil Associations	2-4
Table 2.3	Applicable State and County Water Quality Criteria for Class III, Predominately Fresh Waters	2-9
Table 3.1	General Descriptive Characteristics of Surface Water Quality Sampling Stations	3-3
Table 3.2a	Date and Time of Sampling for the Nineteenth Annual Monitoring Period of January through December, 2003	3-4
Table 3.2b	Weather Conditions Observed During Sampling for the Nineteenth Annual Monitoring Period of January through December, 2003	3-4
Table 3.3	Collection and Analytical Methods Used During the Continuing Surface Water Quality Monitoring Program	3-6
Table 4.1	Rainfall Recorded at Oscar Scherer State Park during the Period of October 2002 through October 2003	4-2

#### NINETEENTH REPORT

# OF THE CONTINUING SURFACE WATER QUALITY MONITORING PROGRAM FOR CATFISH, NORTH AND SOUTH CREEKS ON THE PALMER RANCH SARASOTA COUNTY, FLORIDA

#### 1.0 Introduction

A master development plan for the Palmer Ranch is being implemented pursuant to the terms and conditions of the **Amended and Restated Master Development Order** (Amended MDO, Resolution No. 91-170) for the Palmer Ranch Development of Regional Impact (DRI) which was adopted on July 12, 1991, by the Board of County Commissioners of Sarasota County. The amended and original MDO's call for planning and developing the 5,119-acre Palmer Ranch DRI in incremental developments. Construction of the first incremental development (Prestancia) was initiated in 1986. The Palmer Ranch is located in west-central Sarasota County as shown in **Figure 1.1**.

Pursuant to the conditions of the original MDO, a "Continuing Surface Water Quality Monitoring Program" was required to be performed before and during construction, except during the period in which a "Pollutant Loading Monitoring Program" was to be performed as specified in the Agreement of Understanding between Sarasota County and Palmer Venture established during August 1987.

The original monitoring program, which was initiated in May 1984 by GeoScience, Inc., employed a bimonthly sampling frequency as required for the first year of monitoring. Subsequently, the scope of the monitoring program for the following two-year period was revised during an agency review meeting in June 1985. This meeting involved the developer's representative, Mr. T. W. Goodell, and Mr. Russ Klier of Sarasota County Pollution Control Division (personal communication with Mr. T. W. Goodell). The revised work scope entailed a 13-station network with a quarterly sampling frequency for the parameters monitored during the first year, except trace elements and organochlorine pesticides that would receive annual audits (refer to July 24, 1986 correspondence of Mr. T. W. Goodell to Mr. Russ Klier).

Palmer Ranch Holdings, Ltd. (f.k.a. Palmer Venture and Palmer Ranch Development, Ltd.) contracted Vanasse Hangen Brustlin, Inc. (f.k.a. CCI Environmental Services, Inc. and Conservation Consultants, Inc.) to implement the "Continuing Surface Water Quality Monitoring Program" during the second year of the monitoring program. Vanasse Hangen Brustlin, Inc. (VHB) began monitoring on September 16, 1985, pursuant to the instructions provided by Palmer Ranch Holdings, Ltd. Except for an annual sampling event conducted in September 1988, the "Continuing Surface Water Quality Monitoring Program" was suspended in June 1988, due to the initiation of the "Pollutant Loading Monitoring Program". The Stormwater Pollutant

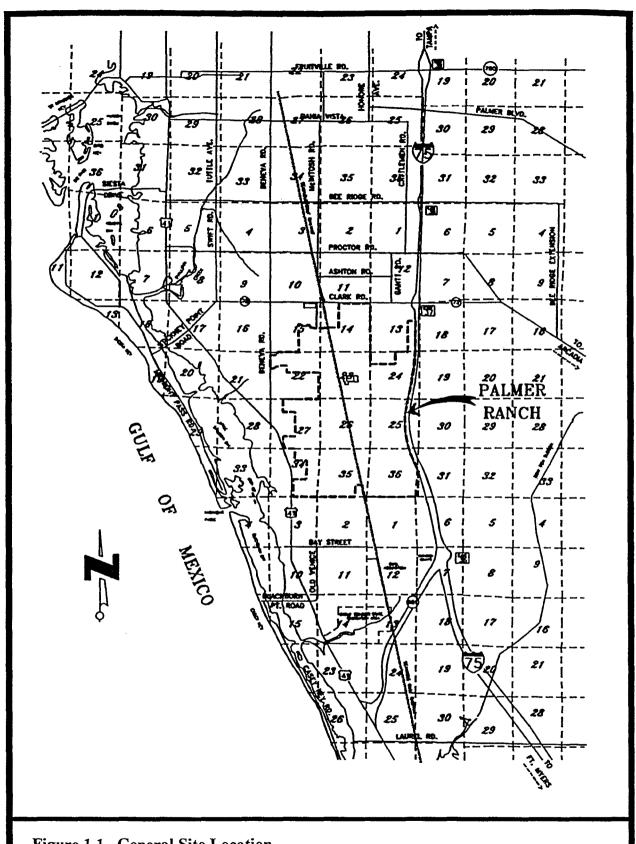


Figure 1.1. General Site Location.

Loading Monitoring Program was performed between June 1988 and December 1989 and a report submitted to Sarasota County on May 29, 1992. Subsequent to an agreement between the Sarasota County Pollution Control Division and Palmer Ranch Holdings, Ltd., the "Continuing Surface Water Quality Monitoring Program" was resumed in December 1989 with a single annual sampling event conducted during the fifth monitoring year. After resumption of monitoring in December 1989, the surface water quality monitoring was performed quarterly at all stations until December 10, 1991.

With adoption of Exhibit "E" to the Amended and Restated Master Development Order for the Palmer Ranch Development of Regional Impact (Appendix A), a revised water quality monitoring program was implemented in 1992. This revised monitoring program consisted of quarterly water quality measurements and grab sample collection in Catfish Creek, North Creek and South Creek at a total of 10 monitoring stations. In accordance with Exhibit "E", monitoring in the South Creek Basin was suspended until one month before any development activity occurring in the basin. Upon intent to reinitiate monitoring of the South Creek Basin, Sarasota County Pollution Control Division was notified of dates of sampling and stations to be sampled. Monitoring of the South Creek Basin was reinitiated with the first quarterly sampling occurring on January 13, 1994. As specified in Exhibit "E", this pre-development monitoring event included water quality grab sampling and in situ measurements at four (4) monitoring stations along South Creek. Following this initial monitoring event, all subsequent monitoring shall be performed quarterly during the development phase. During development, all stations located downstream of an area under development shall be monitored. Additionally, one sampling site located upstream of a development area shall also be monitored to determine baseline water quality conditions. Once an area is substantially developed as agreed to by the Sarasota County Pollution Control Division and Palmer Ranch Development, Ltd., a modification of the monitoring program shall be subject to discussion for change in water quality monitoring frequency from quarterly to semi-annually or to be discontinued.

Under the amended and approved monitoring plan as stated in Exhibit "E", monitoring of Catfish Creek and North Creek is to continue quarterly for a maximum of two years or until substantial development occurs. On April 29, 1994, Mr. Kent Kimes of the Sarasota County Pollution Control Division approved a reduction in sampling frequency for the Catfish Creek and North Creek monitoring stations from quarterly to semi-annually.

The water quality conditions recorded during sampling events conducted during the period from January through December 2003 in the Catfish Creek, North Creek and South Creek basins are reported herein. This report includes a discussion of the results with respect to applicable water quality criteria, observed spatial and temporal trends, and comparisons with results obtained during previous monitoring events.

#### 2.0 GENERAL ENVIRONMENTAL SETTING

#### 2.1 Climate

Prevailing climatic conditions in west central Florida are subtropical, characterized by abundant rainfall and moderate temperatures. Average monthly temperatures derived from two separate 30-year periods of record are provided in **Table 2.1** below:

Table 2.1 Average Monthly Air Temperatures (National Weather Service, Tampa, Florida)

Month		Air Tem	perature	
	1941-	1970A		-1960 <sup>b</sup>
	°C	°F	°C	°F
January	16.4	61.6	16.9	62.4
February	17.2	62.9	17.7	63.8
March	19.4	66.9	19.4	67.0
April	22.3	72.1	22.1	71.8
May	24.8	76.7	24.9	76.8
June	26.8	80.3	26.9	80.4
July	27.6	81.6	27.6	81.6
August	27.7	81.9	27.8	82.0
September	26.9	80.5	27.0	80.6
October	23.9	75.0	23.9	75.1
November	19.8	67.7	19.9	67.9
December	17.1	62.8	17.4	63.4
Annual Average	22.5	72.5	22.6	72.7

<sup>&</sup>lt;sup>a</sup>Thompson, 1976

Based on a 30-year period of record, rainfall in Bradenton, Florida (NOAA, 1977) averages 56 inches per year. The minimum annual rainfall recorded during the 30-year period was 29 inches while the maximum was 93 inches. Historical rainfall trends for this area show that a wet season occurs during the period of June through September followed by a dry season during the period of October through January. On the average 62 percent (35 inches) of the annual rainfall occurs during the summer with only 13 percent (7 inches) during the fall. The dry season is followed by a short wet period during February and March and subsequently a short dry period during April and May.

<sup>&</sup>lt;sup>b</sup>Bradley, 1974

#### 2.2 Soils

Soils in the area of the Palmer Ranch are generally sandy except in areas of low relief and poor drainage where peaty mucks are common (Florida Division of State Planning, 1975). Upland soils found throughout the Palmer Ranch are predominately of the Myakka-Immokalee-Basinger Association. This soil association is defined as nearly level with poorly drained sandy soils (Florida Division of State Planning, 1975).

Along the well-incised banks of several drainage ditches traversing the Palmer Ranch (e.g., lower reach of Catfish Creek), it is evident that a natural marine deposit exists a few feet below the ground surface. This marine deposit contains a thin layer of shells and shell fragments. **Figure 2.1** and **Table 2.2** provide the locations and descriptions of the soil associations that occur in the area of the Palmer Ranch.

#### 2.3 Land Use and Vegetation

Historically, the primary land use within the Palmer Ranch has been cattle ranching. However, changes in land uses on the Palmer Ranch have included the following: construction of surface water management systems; construction of roads, golf courses, homes, wastewater treatment facilities and associated domestic wastewater spray effluent fields, and land disposal of sludge. During the second monitoring year (April 1985 - March 1986), the land application of sludge wastes on the Palmer Ranch was discontinued and construction of the Central County Utilities Regional Treatment Plant and an adjacent golf course was completed. Subsequently, construction of a residential development was initiated during the third monitoring year.

Land uses located upstream of the ranch include golf courses, roads and highways, residential developments, a mobile home park, commercial businesses, a dairy farm that was changed to a sod farm (effective August 1, 1987), light industry, and a metal salvage operation.

The primary vegetation associations found on the undeveloped areas of the ranch include pine flatwoods, improved and semi-improved pastures, wet prairies, marshes and sloughs, swamps, and mesic hammocks.

#### 2.4 Drainage

The Palmer Ranch DRI is divided into six primary drainage basins that ultimately discharge into Little Sarasota Bay and Drymond Bay. Two basins, the Catfish Creek/Trunk Ditch Basin and the South Creek Basin, drain most of the North Tract. Approximately 2,590 acres of the Catfish Creek-Trunk Ditch Basin, that has a total drainage area of 3,700 acres, and approximately 1,770 acres of the South Creek Basin, that has a total drainage area of approximately 12,000 acres, are located on the North Tract. Four minor basins also

Where is the rest of Vanasse Hangen Brustlin, Inc.

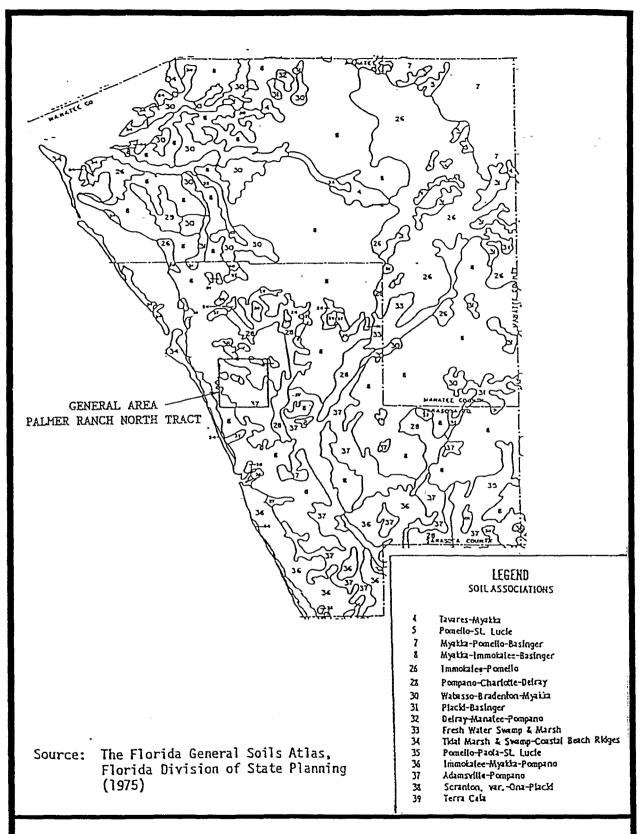


Figure 2.1. Soil Associations in the Region.

 Table 2.2
 Descriptions of Soil Associations

Area Definition	Map Unit No.	Soil Association Description
Areas dominated by moderately well to poorly drained soils not subject to flooding.	4	Tavares-Myakka association: Nearly level to gently sloping, moderately well-drained soils sandy throughout and poorly drained sandy soils with weakly cemented sub-soils.
	5	Pomello-St. Lucie association: Nearly level to sloping, moderately well drained, sandy soils with weakly cemented sandy subsoil and excessively drained soils sandy throughout.
	7	Myakka-Pomello-Bassinger association: Nearly level, poorly and moderately well drained, sandy soils with weakly cemented sandy subsoil and poorly drained sandy soils throughout.
	8	Myakka-Immokalee-Bassinger association: Nearly level, poorly drained, sandy soils with weakly cemented sandy subsoil and poorly drained sandy soils throughout.
	26	Immokalee-Pomello association: Nearly level to gently sloping, poorly and moderately well drained, sandy soils with weakly cemented sandy subsoil.
	30	Wabasso-Bradenton-Myakka association: Nearly level, poorly drained, sandy soils with a weakly cemented sandy subsoil layer underlain by loamy subsoil; poorly drained soils with thin, sandy layers over loamy subsoil and poorly drained soils with weakly cemented sand subsoil.
Areas dominated by moderately well to poorly drained soils not subject to flooding.	35	Pomello-Paola-St. Lucie association: Nearly level to sloping, moderately well drained sandy soils with weakly cemented sandy not subject to flooding (continued) subsoil and excessively drained soils, sandy throughout.
	36	Immokalee-Myakka-Pompano association: Nearly level, poorly drained, sandy soils with weakly cemented sandy subsoil and poorly drained soils, sandy throughout.

Table 2.2 (Continued)

Area Definition	Map Unit No.	Soil Association Description
	37	Adamsville-Pompano association: Nearly level, somewhat poorly and poorly drained, soils, sandy throughout.
	38	Scranton, varOna-Placid association: Nearly level, somewhat poorly drained, dark surface soils, sandy throughout; poorly drained soils with thin, sandy layers over weakly cemented sandy subsoil and very poorly drained soils, sandy throughout.
Areas dominated by poorly and very poorly drained soils subject to flooding.	28	Pompano-Charlotte-Delray association: Nearly level, poorly drained soils, sandy throughout, and very poorly drained soils with thick sandy layers over loamy subsoil.
	31	Placid-Bassinger association: Nearly level, very poorly and poorly drained soils, sandy throughout.
	32	Delray-Manatee-Pompano association: Nearly level, very poorly drained soils with thick, sandy layers over loamy subsoil; very poorly drained sandy soils, with loamy subsoil and poorly drained soils, sandy throughout.
Areas dominated by poorly and very poorly drained soils subject to flooding (continued)	33	Fresh Water Swamp and Marsh association: Nearly level, very poorly drained soils subject to prolonged flooding.
	34	Tidal Marsh and Swamp-Coastal Beach Ridges/Dune association: Nearly level, very poorly drained soils subject to frequent tidal flooding, high-lying coastal dune-like ridges and deep, droughty sands.
	39	Terra Ceia association: Nearly level, very poorly drained, well-decomposed, organic soils 40-91 cm (16-36 inches) thick over loamy material.

#### 2.4.1 Catfish Creek

Catfish Creek within the limits of the Palmer Ranch DRI was a man-made ditch/channel system that flowed southwest to the southern boundary of the property, intersecting Trunk Ditch, a straight man-made canal, at five locations. The upper portion of Catfish Creek receives off-site drainage from commercial and industrial areas near Clark Road. Many of these commercial and industrial areas lack stormwater management systems. The lower portion of the Catfish Creek drainage system receives stormwater runoff from various stormwater management systems located throughout the Palmer Ranch residential development.

Immediately downstream of the Palmer Ranch, the Catfish Creek drainage system receives drainage and at times "overflow" from the wastewater treatment ponds associated with a mobile home park. Farther downstream, drainage from residential areas and runoff from U.S. Highway 41 enter the creek. Beyond U.S. Highway 41, Catfish Creek is affected by tidal changes from Little Sarasota Bay.

#### 2.4.2 Trunk Ditch

Trunk Ditch was originally constructed to improve drainage. Initially, it extended from the northern boundary of the Palmer Ranch property to North Creek and resulted in scouring velocities during major storm events. These high velocities resulted in out-of-bank flooding and sediment transport. During early 1986, a segment of Trunk Ditch was reconstructed in association with the Development of Prestancia. This reconstruction resulted in an improved channel and the placement of two water level control weirs. Because of these two weirs, lentic conditions occur during the dry season. Vegetation in Trunk Ditch is dominated by hydrilla, water-weed, and other aquatic weeds. As mentioned earlier, Catfish Creek intersects Trunk Ditch at five locations.

Runoff entering the upper reaches of Trunk Ditch originates along Clark Road, including the adjacent commercial and industrial areas. Downstream, runoff enters Trunk Ditch from Prestancia's golf course and residential development, the Country Club of Sarasota and associated residential area, as well as pine flatwoods, improved pastures, and wetlands of the Palmer Ranch. Subsequently, three (3) additional weirs were added in the reconstructed portion of the Trunk Ditch during 1988 to 1991. Also, a drainage-basin divide between Catfish Creek and North Creek was created at that time with the construction of Central Sarasota Parkway.

#### 2.4.3 North Creek

North Creek is connected to Trunk Ditch by a dredged tributary located near the southern boundary of the North Tract. The banks of this tributary are vegetated with grasses and trees resulting in a partially overhanging canopy. Most of the drainage into this dredged tributary originates from residential development, roadways, a marsh/slough system, and an off-site metal salvage operation. Downstream of the North Tract, Trunk Ditch enters the main channel of North Creek, which subsequently flows into Little Sarasota Bay. Residential areas, U. S. Highway 41, and pine flatwoods drain into the downstream reach of North Creek.

#### 2.4.4 South Creek

South Creek within the Palmer Ranch is largely a shallow ditch system constructed through historic, broad sloughs or interconnecting previously isolated marshes. The banks of South Creek are vegetated with grasses and occasional pines, while its channel is generally void of aquatic vegetation. Upstream of the Palmer Ranch, South Creek receives drainage in its western tributary from a golf course and a mobile home park. At its eastern boundary, it receives drainage from agricultural and recreational land uses, as well as Interstate I-75. Before mid-1987, much of the area upstream of I-75 was used as a dairy farm.

Within the Palmer Ranch, South Creek receives drainage primarily from improved pastures, pine flatwoods and the newly constructed residential developments. Downstream of the Ranch, South Creek flows through Oscar Scherer State Park and subsequently into the tidal waters of Drymond Bay.

#### 2.4.5 Elligraw Bayou

Elligraw Bayou is a channelized stream that flows southwesterly to Little Sarasota Bay. The banks of Elligraw Bayou are sloped and vegetated with grasses and trees. On the Ranch, Elligraw Bayou receives drainage from Increment II development areas and Prestancia (Increment I). Downstream of the Palmer Ranch, Elligraw Bayou flows through Ballantrae and several other residential areas before entering Little Sarasota Bay.

#### 2.4.6 Matheny Creek

Matheny Creek is a channelized stream that originates in the marshes and sloughs northwest of the Palmer Ranch. It flows southwest and eventually discharges into Little Sarasota Bay. The banks of Matheny Creek are steep and vegetated with grasses and some trees. Drainage enters Matheny Creek from residential developments, commercial and industrial areas, and golf courses.

#### 2.4.7 Clower Creek

Clower Creek forms the south border of the 70-acre Sarasota Square Mall. A 1.6 acre wet prairie located east of the mall on the Palmer Ranch most likely represents the headwaters of Clower Creek during the wet season. Drainage conveyed by Clower Creek flows westerly for 1,350 feet, and subsequently, through an underground pipeline along the north and west borders of a trailer park adjacent to the Sarasota Square Mall. After flowing underground for about 650 feet, drainage enters the mall's stormwater management system. Subsequently, discharge from the mall's stormwater management system drains through swales into culverts and underneath U.S. 41 to Little Sarasota Bay.

#### 2.5 Water Quality Classification

The segments of the streams traversing the North Tract of the Palmer Ranch are non-tidal freshwater systems designated by the State as Class III waters pursuant to Subsection 62-302.400(1) of the Florida Administrative Code (FAC). Downstream, these streams flow into an estuarine system (Little Sarasota and Drymond Bays) which is classified as an Outstanding Florida Waters (OFW). In addition, the segment of South Creek that flows through Oscar Scherer State Park is classified as an OFW. State and Sarasota County water quality standards applicable to the "Continuing Water Quality Monitoring Program" (*i.e.*, those applicable to Class III, predominantly fresh surface waters) are listed in **Table 2.3**.

Table 2.3 Applicable State and County Water Quality Criteria for Class III, Predominately Fresh Waters

Parameter	Water Quality Standard <sup>a</sup>
Arsenic	Not >50 $\mu$ g/L
Biochemical Oxygen Demand	Not to be increased in a manner that would depress Dissolved Oxygen levels below criteria.
Fecal Coliform Bacteria	Not >800/100 mL
Total Coliform Bacteria	Not >2,400/100 mL
Specific Conductance	Shall not be increased more than 50% above background or to 1,275 $\mu$ mhos/cm, whichever is greater, in predominantly fresh waters.
Copper	Not >12.8 $\mu$ g/L at a Total Hardness of 110 mg/L
Dissolved Oxygen	Not <5 mg/L
Lead	Not >3.6 $\mu$ g/L at a Total Hardness of 110 mg/L
Nutrients	Concentrations in a body of water shall not be altered in such a manner as to cause an imbalance in natural populations of aquatic flora or fauna.
Ammonia Nitrogen (ionic plus non-ionic)	See Nutrients
Nitrite Nitrogen	See Nutrients
Nitrate Nitrogen	See Nutrients
Total Nitrogen	See Nutrients
Organic Nitrogen	See Nutrients
Oil and Greases	Not >5 mg/L
Orthophosphate	See Nutrients
Total Phosphorus	See Nutrients

**Table 2.3** (Continued)

Parameter	Water Quality Standard <sup>a</sup>
pH	6.0 - 8.5
Total Suspended Solids	
Turbidity	Not >29 NTU above background
Zinc	Not >115 $\mu$ g/L at a Total Hardness of 110 mg/L

<sup>&</sup>lt;sup>a</sup>State surface water quality criteria as listed in Chapter 62-302, Florida Administrative Code, and Sarasota County Ordinance No. 98-066.

#### 3.0 FIELD AND LABORATORY PROCEDURES

#### 3.1 Station Locations and General Descriptions


The "Continuing Surface Water Quality Monitoring Program" employs a network of 10 sampling stations located at various sites along South Creek, Catfish Creek, North Creek, and Trunk Ditch (**Figure 3.1**). A general description of the characteristics of the 10 sampling stations is provided in **Table 3.1**.

In Catfish Creek, inflow into the Palmer Ranch was monitored at Station CC-1 while outflow was monitored at Station CC-5. Station CC-1 receives drainage from Clark Road, McIntosh Road, and various commercial/industrial developments. Two tributaries of Catfish Creek were also monitored near their confluences with Trunk Ditch (Stations CC-2 and CC-3). These two stations represent stream segments that receive drainage from Prestancia and backwater effects of Trunk Ditch.

Trunk Ditch was monitored within its realigned segment within the Catfish Creek-Trunk Ditch Drainage Basin at Station CC-4. This site lays adjacent to and receives drainage from both the Country Club of Sarasota and Prestancia and sources farther upstream, as well as residential areas, pine flatwoods, improved pastures, and wetlands of the Palmer Ranch. Farther to the South, Trunk Ditch was monitored at a location within the North Creek Basin, *i.e.*, Station NC-6. South Creek was monitored at four (4) locations. These include one point of outflow (SC-2) and one point of inflow (SC-3), as well as in the interior of the North Tract at Stations SC-4 and SC-1. Station SC-3 is upstream of any development underway presently in the South Creek Basin. During some previous monitoring years, only Stations SC-1, SC-2, and SC-4 were monitored because no construction extended beyond Station SC-4. Sampling at Station SC-3 was reinitiated in October 1996 when construction activity moved upstream of Station SC-4.

#### 3.2 Parameters and Sampling Frequency

Semi-annual sampling of Catfish and North Creeks was performed during March and September 2003, and quarterly sampling was performed during January, April, July, and October 2003 in South Creek. The analysis of the annual parameters was performed for samples collected during the wet season events (*i.e.* September and October 2003). The dates and times of all sample collections are provided in **Table 3.2a**. Weather conditions at the time of monitoring are provided in **Table 3.2b**.

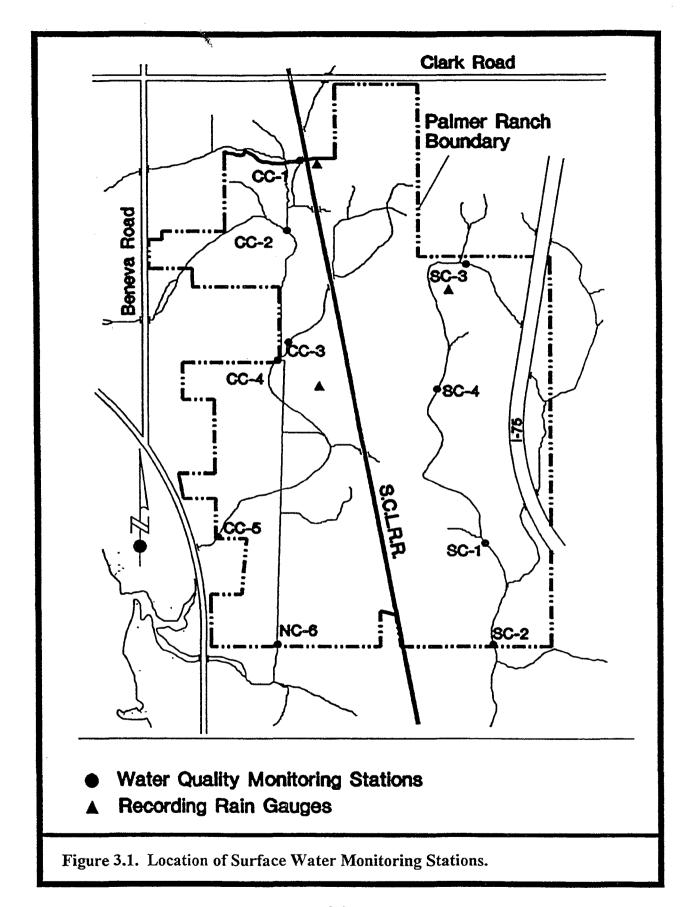

**General Descriptive Characteristics of Surface Water Quality Sampling Stations** Table 3.1

Station	General Location	Water Depth <sup>a</sup>	Channel Width	Habitat
	Section (1) Control (1) Contro	(ft)	(ft)	The second secon
CC-1	Catfish Creek Site Entry	1.0-1.6	10	75-100% Canopy of <i>Salix</i> , Rooted Emergents, Incised Banks.
CC-2	Catfish Creek Upstream of Trunk Ditch	0.0-0.45	12	Aquatic Vegetation, Shallow Sloped Banks.
CC-3	Catfish Creek Upstream of Trunk Ditch	0.3-0.6	6	Aquatic Vegetation, Incised Banks.
CC-4 <sup>b</sup>	Trunk Ditch Downstream of Catfish Creek Confluence	0.6-2.2	50	Sodded Banks, Rooted Emergents.
CC-5	Catfish Creek Outfall from Site	0.3-0.8	50	Shading in by Oaks, Willows, and Wax Myrtle, Sodded Banks.
NC-6	Trunk Ditch Downstream of Catfish Creek	1.7-2.7	12	Aquatic Vegetation.
SC-1	South Creek Mid-property	0.6-0.7	12	Sand covered with Organic Matter.
SC-2	South Creek at Site Exit	0.5-1.2	17	Rooted Emergents, Floating Aquatics, Palm Trees Shade Channel in A.M.
SC-3	South Creek Outfall from Large Wetland	0.0-0.7	10	Shallow banks, Aquatic Vegetation.
SC-4	South Creek near Honore Avenue	0.7-1.2	8	Rooted Emergents Cover 33% of Channel, Canopy of Pine.

<sup>&</sup>lt;sup>a</sup>Range in Depth recorded during monitoring period of April 1987 - March 1988. <sup>b</sup>Depths reported are depths at sampling location - total depth at site averages 8.0 feet.

Table 3.2a Date and Time of Sampling for the Nineteenth Annual Monitoring Period of January through December, 2003

**West Side** 

Event No	o. Date of Sampling			Monitorin	g Stations		
		CC-1	CC-2	CC-3	CC-4	CC-5	NC-6
1	March 6, 2003	1145	1215	1120	1130	1020	1310
2	September 12, 2003	1240	1310	1337	1348	1405	1453

**East Side** 

Event No.	Date of Sampling		Monitorir	Monitoring Stations	
	Colonia de la colonia de la colonia del co	SC-1	SC-2	SC-3	SC-4
1	January 22, 2003	1520	1450	1430	1550
2	April 1, 2003	1048	1025	1130	1118
3	July 28, 2003	1218	1131	1337	1307
4	October 2, 2003	1258	1223	1356	1333

N/A – Station not Sampled (Dry)

Table 3.2b Weather Conditions Observed During Sampling for the Nineteenth Annual Monitoring Period of January through December, 2003

Date	Air Temperature (F)	Cloud Cover (%)	Speed	Wind Direction	Rain
January 22, 2003	70-75	60	0-7	SW	No
March 6, 2003	80-85	10	5-10	SSW	No
April 1, 2003	60-65	5	5-10	NE	No
July 28, 2003	95-100	10-20	5-10	sw	No
September 12, 2003	90-95	10-20	0-5	SW	No
October 2, 2003	75-80	100	5-10	NW	Yes

Surface water quality monitoring from January through December 2003 was performed by (1) the use of field instrumentation and in situ measurements; and (2) the collection of grab samples for subsequent laboratory analyses. A digital readout YSI/Endeco multi-parameter water quality meter was used for in situ measurements of dissolved oxygen, pH, specific conductance, and water temperature. Prior to deployment in the field, all instrumentation was calibrated according to the manufacturer's recommended procedures. All in situ measurements were taken at approximate midstream and mid-depth at each station. Grab samples were collected at each station during the six monitoring events, preserved, and analyzed in the laboratory within the recommended hold times for the following parameters:

- Ammonia Nitrogen
- Nitrate Nitrogen
- Nitrite Nitrogen
- Organic Nitrogen1
- Total Nitrogen
- Orthophosphate
- Total Phosphorus

- Oil and Grease
- Total Suspended Solids
- Turbidity
- Biochemical Oxygen Demand
- Fecal Coliform Bacteria
- Total Coliform Bacteria

Additional surface water grab samples were collected at each of the ten monitoring stations during the September or October 2003 monitoring events for the laboratory analysis of the following parameters:

- Arsenic
- Lead

- Copper
- Zinc

All sampling was performed in accordance with the Florida Department of Environmental Protection standard operating procedures ID #E84017. Laboratory analyses were performed in accordance with the procedures described in the 18th edition of Standard Methods for the Examination of Water and Wastewater (APHA, 1992), Methods for Chemical Analysis of Water and Wastes (USEPA, 1983) or other FDEP/USEPA approved methodology. The methods used in the collection, preservation, handling, storage, and analysis of all surface water samples are provided by parameter in **Table 3.3**.

<sup>&</sup>lt;sup>1</sup>Organic Nitrogen = Total Kjeldahl Nitrogen - Ammoniacal Nitrogen.

 Table 3.3
 Collection and Analytical Methods Used during the Surface Water Quality Monitoring Event

Parameter	Sample Type	Field Handling	Hold Time	Laboratory Handling	Analytical Method	Method Reference
Total Arsenic	Grab	HNO <sub>3</sub> to pH <2, Stored on Ice	6 Months	Stored at Room Temperature	Digestion, Atomic Absorption - Furnace Technique	EPA 206.2
Fecal Coliform Bacteria	Grab	Stored on Ice	30 Hours	Immediate Analysis	Multiple Tube Fermentation	APHA 9222 D
Total Coliform Bacteria	Grab	Stored on Ice	30 Hours	Immediate Analysis	Multiple Tube Fermentation	APHA 9222 B
Biochemical Oxygen Demand (BOD-5 Day)	Grab	Stored on Ice	48 Hours	Immediate Analysis	Membrane Electrode	APHA 5210 B
Conductivity	In situ		·		Hydrolab - Wheatstone Bridge	APHA 2510 B
Total Copper	Grab	HNO <sub>3</sub> to pH <2, Stored on Ice	6 Months	Stored at Room Temperature	Digestion, Atomic Absorption	EPA 220.2
Total Lead	Grab	$HNO_3$ to pH <2, Stored on Ice	6 Months	Stored at Room Temperature	Digestion, Atomic Absorption	EPA 239.1
Ammonia Nitrogen	Grab	H <sub>2</sub> SO <sub>4</sub> to pH <2, Stored on Ice	28 Days	Stored at 4 °C	Automated Phenate	EPA 350.2
Nitrate + Nitrite Nitrogen	Grab	$H_2SO_4$ to pH <2,	28 Days	Stored at 4 °C Stored on Ice	Automated Cadmium Reduction	EPA 353.2
Nitrite Nitrogen	Grab	Stored on Ice	48 Hours	Stored at 4 °C	Automated Autoanalyzer	APHA 4500NO2B
Nitrate Nitrogen	Grab				Calculation	EPA 353.2
Total Kjeldahl Nitrogen	Grab	H <sub>2</sub> SO <sub>4</sub> to pH <2, Stored on Ice	28 Days	Stored at 4 °C	Automated Block Digestion, Autoanalyzer	EPA 351.2

Table 3.3 (Continued)

Parameter	Sample Type	Field Handling	Hold Time	Laboratory Handling	Analytical Method	Method Reference
Total Nitrogen	Grab				Calculation	EPA 351.2
Oil and Grease	Grab	$H_2SO_4$ to pH <2,	28 Days	Stored at 4 °C Stored on Ice	Gravimetric	EPA 1664
Dissolved Oxygen	In situ				Hydrolab - Membrane Electrode	APHA 4500 G
рН	In situ				Hydrolab - Electrometric	APHA 4500-H⁺
Orthophosphate	Grab	Stored on Ice	48 Hours	Immediate Analysis	Automated, Ascorbic Acid	EPA 365.3
Total Phosphorus	Grab	$H_2SO_4$ to pH <2, Stored on Ice	28 Days	Stored at 4 °C	Automated Block Digestion, Autoanalyzer	EPA 365.3
Total Suspended Solids (TSS)	Grab	Stored on Ice	7 Days	Stored at 4 °C	Glass Fiber Filtration, Dried at 105°C	EPA 160.2
Temperature	In situ				Hydrolab - Thermistor	APHA 2550 B
Turbidity	Grab	Stored on Ice	48 Hours	Stored at 4 °C	Nephelometric	EPA 180.1
Total Zinc	Grab	$HNO_3$ to pH <2, Stored on Ice	6 Months	Stored at Room Temperature	Digestion, Atomic Absorption	EPA 289.1
Flow/Direction	In situ	<del></del>		<del></del> -	Marsh-McBirney Flow Meter -Electromagnetic Sensor	Manufacturer's Specifications

APHA - American Public Health Association, American Water Works Association and Water Pollution Control Federation, 1992. Standard Methods for the Examination of Water and Wastewater, 18th Edition. American Public Health Association.

EPA - U.S. Environmental Protection Agency, 1983. *Methods for Chemical Analysis of Water and Wastes*, EPA - 600/4-79-020, National Environmental Research Center, Cincinnati, Ohio.

Laboratory analyses were performed by Benchmark EnviroAnalytical's laboratory which is certified by Florida Department of Health and Rehabilitative Services for the analyses of environmental and drinking water samples.

Two additional parameters, stream flow and stream depth, were monitored at each sampling point concurrently with water quality monitoring as an aid in evaluating the water quality data although not formally part of the "Continuing Surface Water Quality Monitoring Program." Water velocity was determined using a Marsh-McBirney model 201D flow meter. Stream flows were subsequently determined in accordance with the USGS two-point (i.e., area/velocity) method (USGS, 1982). Stream depth was measured with a weighted fiberglass tape at each point of water quality sampling.

#### 4.0 RESULTS AND DISCUSSION

During the nineteenth year of the "Continuing Surface Water Quality Monitoring Program" (*i.e.*, January through December 2003) six surface water quality monitoring events were conducted by VHB. Sampling of Catfish and North Creeks was conducted on March 6 and September 12, 2003 and sampling of South Creek was conducted on January 22, April 1, July 28 and October 2, 2003. All monitoring was conducted in compliance with the conditions of the Amended and Restated Master Development Order for the Palmer Ranch Development of Regional Impact (**Appendix A**).

Individual results for the six events performed during the 2003 monitoring year for the "Continuing Surface Water Quality Monitoring Program" are tabulated by parameter in **Appendix B** and **C** for the Catfish Creek/North Creek and South Creek sites, respectively. For each parameter, statistics (*i.e.*, mean, range, standard deviation, and number of observations) are calculated across sampling events and sampling locations. Also, applicable water quality criteria are footnoted below each table.

Copies of the data tables for the samples collected during the 2003 monitoring year are provided in **Appendix D**. Comparison of the data with previous results and general conclusions are included with the discussion for each parameter or group of related parameters.

#### 4.1 Rainfall and Hydrology

#### 4.1.1 Rainfall

The annual rainfall amount recorded at Oscar Scherer State Park, located to the south of the Palmer Ranch, during the nineteenth year of the "Continuing Surface Water Quality Monitoring Program" is higher than the historic average annual rainfall of approximately 54.8 inches (based on a 30-year period of record, NOAA, 1982). Approximately 67.58 inches of precipitation were recorded during the October 2002 to September 2003 (**Table 4.1**) time period at Oscar Scherer State Park in comparison to a range of 24 to 74 inches recorded during the period of record. Due to insufficient rainfall data for the month of July at Oscar Scherer, the Southwest Florida Water Management District's rain gage identified as ROMP 20 Osprey was used to supplement the annual data set. The ROMP 20 gage is located approximately 1 mile north of Oscar Scherer State Park. On Palmer Ranch, 38 to 65 inches were recorded during previous monitoring years (CCI, 1988a, 1988b, 1991, 1992a, 1993, 1994, 1995, 1996, 1997, 1998 and 1999, and VHB, 1999, 2000, 2001 and 2002).

Table 4.1 Rainfall Recorded at Oscar Scherer State Park during the Period of October 2002 through October 2003

Date	Monthly	Seasonal	Pre-Event Rainfall (Inches)			
	Rainfall (Inches)	Rainfall (Inches)	2 Day	2 Week	2 Month	
October 2002	0.49	No.				
November 2002	1.66					
December 2002	9.79					
Fall (Dry Season)		11.94				
January 2003	0.02		0.00	0.02	9.81	
February 2003	0.58					
March 2003	1.69		0.00	0.21	0.62	
Winter		2.29				
April 2003	4.77		0.00	0.48	2.27	
May 2003	5.06					
June 2003	18.77					
Spring		28.60				
July 2003*	2.74		1.34	1.40	21.50	
August 2003	16.68					
September 2003	5.37		0.00	1.45	34.03	
Summer (Wet Season)	•	24.79				
October 2003	1.46		0.00	3.59	21.15	
<b>Yearly Total (10/02 – 9/03)</b>		67.58				
<sup>a</sup> Seasonal Rainfall (inches):						
Primary Wet Season (June – September):			43.50	5		
Primary Dry Season (October 2002- January 2003:			11.90			
Secondary Wet Season (February -		2.27				
Secondary Dry Season (April - Mag		9.83	3			

<sup>\*</sup>Rainfall from Ramp 20 gage (No data for Oscar Scherer State Park).

**Figure 4.1** provides a comparison of the monthly distribution of rainfall measured at from October 2002 through October 2003 with the average monthly distribution of historic rainfall for the 23-year period of record. Rainfall recorded during the 2003 monitoring year exhibited the typical seasonal trend for this region of Florida. The cumulative amount of precipitation for the primary wet season (*i.e.*, June - September) was 43.56 inches, which is 16.84 inches above the period of record average.

Recorded rainfall amounts during the primary wet season compensated for below average rainfall during the winter and consequently contributed to an annual rainfall above the historic levels (**Figure 4.1**). During the thirteen-month monitoring year, below-normal rainfall was observed during eight months of the year (*i.e.* October and November 2002, January, February, March, July, September and October, 2003), whereas abovenormal rainfall occurred during December 2002 and April, May, June and August 2003 (**Figure 4.1**). The highest monthly rainfall totals during 2003 were observed in June and August when 18.77 and 16.68 inches of precipitation were recorded, respectively. Historically, 6.63 and 6.92 inches of rainfall occur during June and August, respectively.

As provided in **Table 4.1**, the seasonal amounts of rainfall recorded at Oscar Scherer State Park during the fall and winter quarters totaled 11.94 and 2.29 inches, respectively. Rainfall amounts recorded during the spring and summer quarters were 28.60 and 24.79 inches, respectively. In the four-month period from June through September, when the primary wet season normally occurs, 43.56 inches (or 64 percent of the total annual rainfall) was recorded at Oscar Scherer State Park. The total rainfall recorded during the primary wet season for 2003 was greater than the previous year of 34.71 inches.

Antecedent rainfall accumulations during 2-day, 2-week and 2-month periods before each monitoring event are also presented in **Table 4.1**. As evident in this table, only the July monitoring event had rain recorded during the 2-day antecedent period prior to monitoring. The 2003 wet season sampling events (*i.e.*, July and September) exhibited dissimilar rainfall amounts during the two-month antecedent period (21.50 and 34.03 inches, respectively). The March and April sampling events had the lowest two-month antecedent period rainfall amounts.

#### 4.1.2 Stream Stage

Water depths measured at each station during the sampling events performed during 2003 are tabulated in **Appendix Tables B-1** and **C-1** for the west and east side, respectively.

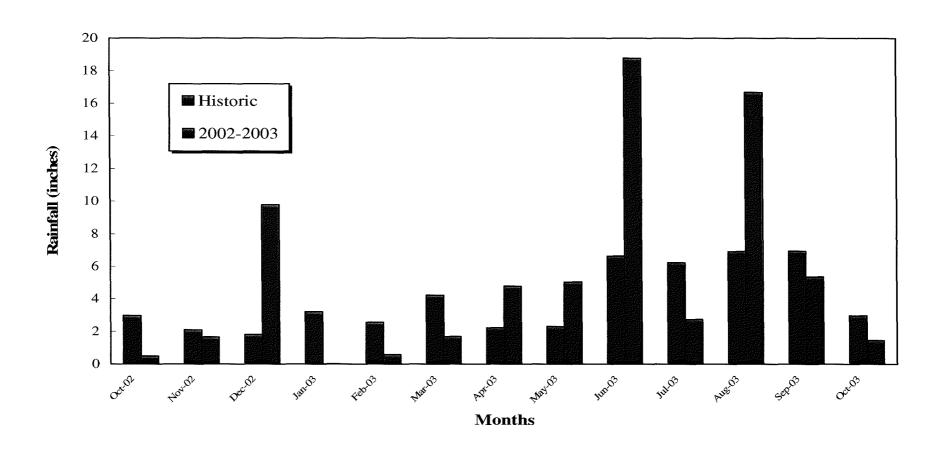


Figure 4.1 Historic Rainfall versus Actual Rainfall Recorded at ROMP 20 Osprey gauge from October 2002 through October 2003.

#### West Side

Stream stages on the west side of the Ranch during 2003 averaged 1.6 feet and ranged from 0.2 to 3.8 feet. Overall, stream stages measured during 2003 are higher than those measured during 1997 and 1998, but are comparable to those measured during the 2001and 2002 monitoring years. During 2002, stream stages for the Catfish Creek and North Creek monitoring stations averaged 1.5 feet with a range of 0.1 to 4.6 feet (VHB, 2002) compared with an average of 1.6 feet recorded during the 2003 monitoring year.

The lowest stream '...

The lowest stream '...

The deepest waters of the streams traversing the west side of the Palmer Ranch are located in Trunk Ditch. Here, depths of approximately 8 feet can be found near the center of its reconstructed segment that runs adjacent to the Country Club of Sarasota and Prestancia. Station CC-4 is located on the reconstructed segment of Trunk Ditch and exhibited an average depth of 2.6 feet.

The lowest stream levels in Catfish Creek were observed during the September 2003 monitoring event. Average stream stages for Stations CC-2 and NC-6 were both below 1.0 foot during the year (Appendix Table B-1). These stations also exhibited the lowest average stream stages recorded in the 2002 monitoring year.

#### **East Side**

During the 2003 monitoring year, stream stages at the four monitoring stations in South Creek averaged 1.1 feet with a range from 0.2 to 1.9 feet (**Appendix Table C-1**) compared to an average stream stage of 0.8 feet determined during 2002. Average stream stages recorded from 1985 through 2002 ranged from 0.4 to 2.5 feet (CCI, 1986, 1988a, 1988b, 1990, 1991, 1992a, 1995, 1996, 1997, 1998, 1999 and VHB, 1999, 2000, 2001, and 2002).

Spatially, Station SC-4 exhibited the greatest water depths during the 2003 monitoring year. The shallowest stream stage was exhibited by Station SC-3, which averaged 0.7 feet deep for the four sampling events. Station SC-3 is located at the upper reach of the South Creek basin. Seasonally, the highest average water levels at the four South Creek monitoring stations were recorded during the April and July 2003 monitoring events. The lowest water level (0.2 feet) was determined for the October sampling event at Station SC-3. This water level trend does not follow seasonal trends reported during previous monitoring years (CCI, 1986, 1988a, 1988b, 1990, 1991, 1992a, 1995, 1996, 1997, 1998, 1999 and VHB, 1999, 2000, 2001 and 2002).

#### 4.13 Stream Flow

#### West Side

As evident in **Appendix Table B-2**, stream flows measured during the 2003 monitoring year for all six monitoring stations in Catfish and North Creeks ranged from 0.0 to 7315.4 gallons per minute (GPM) and averaged 880.8 GPM. During the nineteenth year of monitoring, stream flows in the Catfish Creek/Trunk Ditch Basin ranged from 22.4 to 1867.0 GPM in its upper reaches (CC-1 and CC-2) and there was no flow exhibited in its mid-reach (CC-3 and CC-4). Stream flows recorded for the six monitoring stations during the 2003 monitoring year are illustrated in **Figure 4.2**.

Seasonally, the highest steam flows during 2003 occurred during the September monitoring event with stream flows in Catfish Creek/Trunk Ditch averaging 1681.5 GPM. Higher stream flows measured in September coincide with the high 2-month antecedent rainfall amount (**Table 4.1**). The higher rainfall amounts reported for this period resulted in an elevated groundwater table and a higher percentage of runoff, both of which increased stream flow. Spatially, low flow conditions were observed in the Catfish Creek/Trunk Ditch Basin at Stations CC-2, CC-3 and CC-4. During 2003, there was no discernable flow at Stations CC-3 and CC-4. However, Station CC-2 has typically exhibited the lowest flow conditions during the previous monitoring years. The highest stream flows were determined for Station CC-5 with an average of 3837.2 GPM and a range of 359.0 to 7315.4 GPM.

During the 2003 monitoring year, positive stream flows (*i.e.*, measurable flows) were recorded for 8 of the 12 measurements (*i.e.*, 67 percent) taken. The percentage of positive flows measured during 2003 are comparable to those reported for previous monitoring years (CCI, 1986, 1988a, 1988b, 1990, 1991, 1992a, 1993, 1994, 1997, 1998, 1999 and VHB, 1999, 2000, 2001 and 2002). A higher incident of positive flows (*i.e.*, 100 percent) was observed during the 1995 monitoring year and is directly attributed to the wetter conditions reported with the annual rainfall being 28 inches higher than the 23-year average. The historic high percentage of positive flows in these two basins can be attributed to improved basin geometry and hydraulic residence time in the watershed resulting in a more efficient drainage system.

#### East Side

As evident in **Appendix Table C-2**, positive stream flows (*i.e.*, measurable flows) were recorded for 8 of 16 measurements (*i.e.*, 50 percent) taken during the 2003 monitoring year in the South Creek Basin. The percentage of positive flows measured during 2003 is lower than the 56 to 100 percent positive flow measurements observed during the 1991 through 1999 and 2001 monitoring years (CCI, 1992a, 1995, 1996,

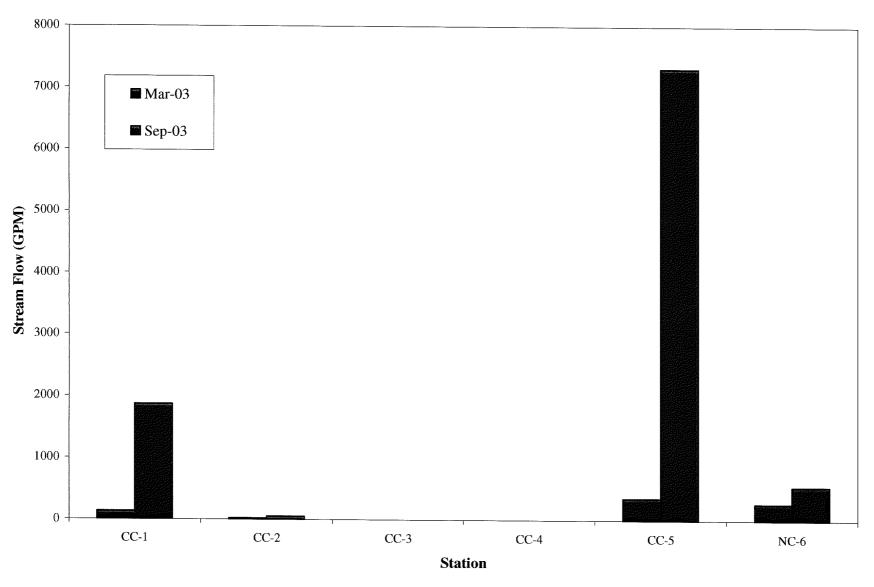


Figure 4.2 Stream Flows Measured During Monitoring Events Conducted on the West Side of the Palmer Ranch from January through December 2003

1997, 1998, 1999 and VHB, 1999 and 2001). During 2003, stream flow in South Creek averaged 1202.5 GPM and ranged from 0.0 to 5834.4 GPM. Stream flows measured during 2003 are presented in **Figure 4-3**.

Seasonally, stream flows followed the same general trends described for stream stage with the highest flows being observed during the October 2003 monitoring event when stream flows averaged 2,726.5 GPM (Appendix Table C-2). The higher stream flows measured in October 2003 probably resulted from saturated soil conditions caused by the only substantial rainfall amounts that occurred during the late summer of 2003. Saturated soil conditions can result in an elevated groundwater table and a higher percentage of surface runoff, and therefore, increased stream flow.

Spatially, stream flows followed expected trends with flows generally increasing in a downstream direction. Stream flows in the upper reaches (*i.e.*, Stations SC-3 and SC-4) exhibited no flow conditions, while the lower reach (SC-1 and SC-2) ranged from 852.7 to 5834.4 GPM.

#### 4.2 Physical Water Quality Parameters

#### 4.2.1 Water Temperature

**Appendix Tables B-3** and **C-3** present the surface water temperature measurements acquired during the 2003 monitoring year for Catfish Creek/Trunk Ditch and South Creek, respectively.

#### West Side

Results indicate that the water temperature of the streams of the west side of the Palmer Ranch averaged 27.3°C and ranged from 24.5 to 30.8°C during the two monitoring events. This range is similar to those recorded during previous years of monitoring (Palmer Venture, 1986; and CCI, 1986, 1988a, 1988b, 1991, 1992a, 1993, 1994, 1995, 1996, 1997, 1998, 1999 and VHB, 1999, 2000, 2001 and 2002).

As expected, the lowest water temperatures were recorded in the streams of the west side during the March 2003 event with the highest water temperatures recorded during the September monitoring event. Water temperatures averaged 28.9 °C during the September 2003 event, while an average temperature of 25.7 °C was observed during the March event. Average temperatures for Catfish Creek and North Creek for each event are very similar with differences among the respective creeks generally being less than 2 °C.

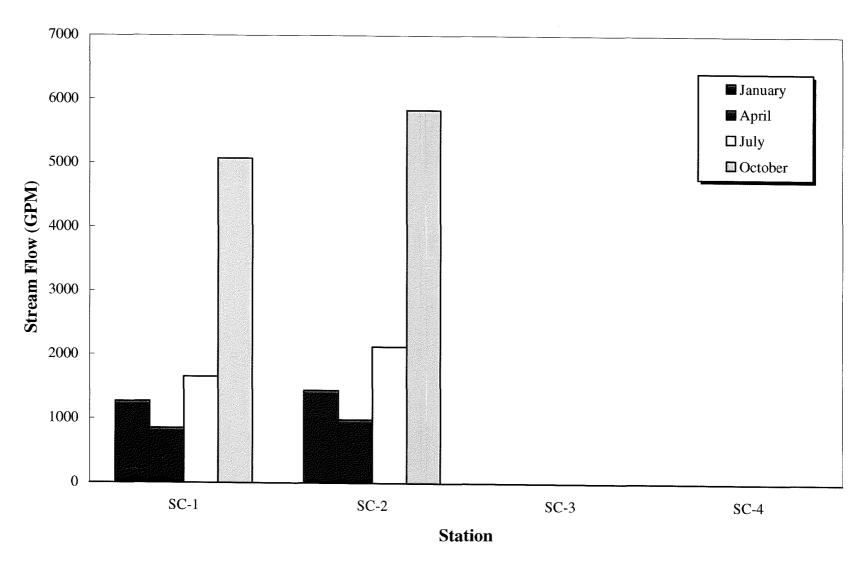


Figure 4.3 Stream Flows Measured During Monitoring Events Conducted on the East Side of the Palmer Ranch from January through December 2003

Results indicate that the water temperature in South Creek on the Palmer Ranch averaged 21.6 °C and ranged from 12.5 to 29.8 °C during the four monitoring events (**Appendix Table C-3**). A broader range is exhibited in 2003 when compared to those recorded during previous years of monitoring (Palmer Venture, 1986; and CCI, 1986, 1988a, 1988b, 1991, 1992a, 1995, 1996, 1997, 1998, and VHB, 1999, 2000, 2001 and 2002).

As expected, the lowest water temperatures averaging 16.0 °C were recorded in the streams of the east side during the winter quarterly event (*i.e.*, January 2003), with higher water temperatures recorded during July and October monitoring events. The highest average water temperatures, averaging 29.0 °C, were recorded during the July 2003 (*i.e.*, summer) monitoring event. Water temperatures recorded for the April event averaged 16.1 °C. Average water temperatures determined for each station in the South Creek basin exhibited temperature differences among stations of approximately 5 °C, or less.

An evaluation of diurnal variations in water temperature in the Catfish Creek and South Creek Basins was performed during the 1985 dry season and the 1986 wet season. Results of the diurnal evaluation showed increases in water temperature to maximum levels by mid-afternoon followed by declines during the evening to minimal levels by early morning. The results of the diurnal study are provided in the report prepared by CCI (CCI, 1987).

# 4.2.2 Specific Conductance

### **West Side**

As evidenced in **Appendix Table B-4**, Catfish Creek and North Creek exhibited an average specific conductance of 813 micromhos per centimeter ( $\mu$ mhos/cm) with a range from 510 to 1,090  $\mu$ mhos/cm during 2003. In previous studies, Catfish Creek and North Creek exhibited specific conductance ranges of 366 to 1,625  $\mu$ mhos/cm (CCI, 1991, 1992a, 1993, 1994, 1995, 1996, 1997, 1998 and VHB, 1999, 2000, 2001 and 2002). A greater range of conductivity levels (567 to 1,625  $\mu$ mhos/cm) was reported for the sixth monitoring year and probably resulted from the relatively low amount of rainfall that occurred during 1990.

In a comparison of both streams monitored during 2003 within the west side of Palmer Ranch, the annual mean conductivities for North Creek and Catfish Creek Basins were 998 and 776  $\mu$ mhos/cm, respectively. Spatially, conductivity levels in the Catfish Creek Basin were determined to be nearly identical. Specific conductivities in the mid reaches of Catfish Creek averaged 764  $\mu$ mhos/cm compared with an average of 760  $\mu$ mhos/cm observed for the upper-reach.

South Creek exhibited a more narrow range in specific conductance of 278 to 872  $\mu$ mhos/cm (**Appendix Table C-4**) during 2003 compared with conductivity levels ranging from 289 to 1,497  $\mu$ mhos/cm during the fourth through the eighteenth monitoring years (CCI, 1988b, 1991, 1992a, 1995, 1996, 1997, 1998, 1999 and VHB, 1999, 2000, 2001 and 2002). Above normal rainfall in 2003 contributed to the lowest specific conductance levels ranging from 278 to 872  $\mu$ mhos/cm. The highest values were observed during the sixth and sixteenth monitoring years and resulted from the relatively low amount of rainfall that occurred during 1990 and 2000. Seasonally, the lowest conductivities recorded during 2003 occurred during the October monitoring event when conductivities averaged 506  $\mu$ mhos/cm. As described above, these lower conductivities can be correlated to high precipitation during the summer wet season and are most likely resulted from cumulative effects of increased surface runoff of low conductivity storm water during a period of high rainfall (refer to **Table 4.1**). Specific conductivity levels at the remaining sampled stations averaged 535, 726 and 581  $\mu$ mhos/cm during the January, April and July sampling events, respectively.

Average conductivities measured in the South Creek Basin for the upper and lower reaches were 512 and 662  $\mu$ mhos/cm, respectively. A slight trend for higher conductivity values in the upper reach of South Creek was indicated in the 1999 annual report (VHB, 1999). However, much like the 2000-2002 results, the 2003 data indicates a slightly higher conductivity in the lower reach and these results are similar to those observed during the previous years of monitoring (CCI 1988a, 1988b, 1991, 1992a, 1995, 1996, 1997, 1998 and VHB, 1999, 2000, 2001 and 2002). During these years, no apparent spatial trends in conductivity were evident within the South Creek Basin of the Palmer Ranch. The higher conductivity in the lower reach could reflect the effects of dewatering for construction.

The State specific conductance criterion applicable to the streams of the Palmer Ranch allows an increase of not more than 50 percent above background levels or to a level of 1,275  $\mu$ mhos/cm whichever is greater. None of the South Creek basin conductivity measurements exceeded this criterion.

#### 4.2.3 Total Suspended Solids

During the nineteenth year of monitoring, Catfish Creek and North Creek in the Palmer Ranch exhibited a range of total suspended solids (TSS) from 1.2 to 19.6 mg/L with an annual average of approximately 6.3 mg/L (**Appendix Table B-5**). Total suspended solid levels observed during 2003 were generally lower than those recorded during other previous monitoring years (Palmer Venture, 1987, 1988a, 1988b, 1991, 1992a, 1993, 1994, 1996, 1997, 1998, 1999 and VHB, 1999, 2000, 2001 and 2002).

The highest TSS levels during 2003 were recorded in the upper-reach of Catfish Creek (*i.e.*, CC-1). The lowest TSS levels were recorded in the mid-reach of Catfish Creek (*i.e.*, CC-3). The highest average TSS level (*i.e.*, 6.5 mg/L) was recorded for the September sampling event in Catfish Creek. The higher TSS values reported for the September sampling event are probably due to higher rainfall recorded at the primary wet season (June-September), after a period of lower rainfall, and the subsequent increase in surface water runoff, which carries particles into the creek. The low concentrations of TSS recorded during 2003 monitoring year may be attributed to above average rainfall observed throughout most of the year. Overall, the observed TSS range of approximately 1.2 to 19.6 is significantly lower than the 2002 monitoring data (1.8 to 75.2).

# **East Side**

During the 2003 monitoring year, stations along South Creek on the Palmer Ranch exhibited a range of total suspended solids (TSS) from 1.4 to 292.0 mg/L, with an annual average of 27.6 mg/L (**Appendix Table C-5**). Overall, the TSS levels observed are higher than those recorded during previous monitoring years (Palmer Venture, 1986; CCI, 1986, 1987, 1988a, 1988b, 1991, 1992a, 1995, 1996, 1997, 1998 and VHB, 1999, 2000, 2001 and 2002).

The highest TSS levels of 31.5, 49.4 and 292.0 mg/L were recorded in the upper reach of the creek at Station SC-3 during the January, July and October 2003 monitoring events. The elevated TSS level probably resulted from higher organic matter content (*i.e.*, aquatic plants) because of low water levels at this site and/or from upstream construction within the basin. The lowest yearly average TSS levels were recorded at Station SC-1 and SC-2 (*i.e.*, lower reach) during 2003. Overall, the lowest average TSS concentration was observed during the April event.

# 4.2.4 Turbidity

#### West Side

During the 2003 monitoring year, turbidity levels measured in Catfish Creek and North Creek ranged from 1.4 to 22.0 NTU and averaged 6.3 NTU (**Appendix Table B-6**). In comparison, a turbidity range of 0.3 to 37 NTU was exhibited during the previous fourteen years of monitoring (CCI, 1988a, 1988b, 1991, 1992a, 1993, 1994, 1995b, 1996, 1997, 1998 and VHB, 1999, 2000, 2001 and 2002).

The highest mean turbidity level (*i.e.*, 7.7 NTU) occurred September 2003 while the lowest mean level (*i.e.*, 5.0 NTU) was determined for the March event (**Appendix Table B-6**). This seasonal variation typically

results from differences in rainfall amounts and the subsequent changes in storm water inputs to the surface waters.

## **East Side**

During the nineteenth year of the monitoring program, turbidity levels measured in South Creek ranged from 1.2 to 820.0 NTU with an overall average of 69.6 NTU (**Appendix Table C-6**). The turbidity levels measured in 2003 were higher than those observed in recent years (*i.e.*, 1998, 1999, 2000, 2001 and 2002). The lowest turbidity levels were measured during the 1995 and 1997 monitoring years. Turbidity levels ranged from 1.7 to 11.8 NTU, and from 1.0 to 5.3 NTU during 1995 and 1997, respectively (CCI, 1996 and 1998).

Seasonally, the highest mean turbidity level (*i.e.*, 216.1 NTU) occurred during the October sampling event while the lowest mean turbidity level (*i.e.*, 3.5 NTU) was determined for the April event (**Appendix Table C-6**).

The General Water Quality Criteria for all surface waters (FAC Chapter 62-302) specifies that turbidity shall not exceed 29 NTU above natural background. Based on turbidity measurements taken during previous years of monitoring, natural background turbidity levels are expected to be less than 25 NTU (mean plus one standard deviation), although higher background turbidities might occur because of natural processes, *e.g.*, organic decay and import of particulate matter via stormwater runoff. Therefore, only turbidity measurements collected during January and October 2003 at Station SC-3 were out of compliance with the applicable water quality criteria. Since Station SC-3 is located at an in flow point, the source of the high turbidity is upstream.

# 4.3 Oxygen Demand and Related Parameters

### 4.3.1 Biochemical Oxygen Demand

Biochemical oxygen demand can be defined as "the amount of oxygen required by bacteria while stabilizing organic matter under aerobic conditions" (Sawyer and McCarthy, 1978).

#### West Side

The decomposable organic matter present in Catfish Creek is mostly attributed to decaying vegetation and hydrocarbon inputs (*i.e.*, automobile emission, oil leakage, *etc.*). As presented in **Appendix Table B-7**, the 5-day biochemical oxygen demand (BOD<sub>5</sub>) recorded in the two streams of the west side averaged 2.3 mg/L and ranged from <2.0 to 4.0 mg/L during the 2003 monitoring year.

Seasonally, the highest BOD<sub>5</sub> levels were recorded for the September event. In accordance with previously documented trends, September corresponds to the end of the summer-wet season when storm water runoff is high which typically results in more organic material being transported to the surface waters.

Biochemical oxygen demand levels in Catfish Creek averaged 2.3 mg/L with a range of <2.0 to 4.0 mg/L. Spatially, equal mean BOD<sub>5</sub> levels of 2.2 mg/L were observed among both upper and lower reach stations in the basin (**Appendix Table B-7**). A similarly low mean BOD<sub>5</sub> level of 2.3 mg/L was observed for the North Creek sampling station.

### East Side

The decomposable organic matter present in South Creek is mostly attributed to decaying vegetation with a minor contribution hydrocarbon input (*i.e.*, automobile emission, oil leakage, *etc.*) resulting from runoff from Interstate-75. As presented in **Appendix Table C-7**, the 5-day biochemical oxygen demand (BOD<sub>5</sub>) recorded in the South Creek Basin during the 2003 monitoring year averaged 2.2 mg/L and ranged from <2.0 to 11.0 mg/L. Seasonally, the highest mean BOD<sub>5</sub> levels were determined during the October 2003 sampling event. Spatially, the highest BOD<sub>5</sub> levels were measured in samples collected in the upper reach of South Creek (*i.e.*, Stations SC-3 and SC-4). Overall, the lowest BOD<sub>5</sub> levels were observed within the lower reach (*i.e.*, Stations SC-1 and SC-2).

According to Hynes (1966), a BOD<sub>5</sub> of 3 mg/L suggests "fairly clean" water while a BOD<sub>5</sub> of 5 mg/L suggests "doubtful" quality water. In addition, a BOD<sub>5</sub> screening level of greater than 3.3 mg/L has been established for Florida waters to indicate potential water quality problems (FDER, 1990). Based on BOD<sub>5</sub> measurements made in North Creek and Catfish Creek during the 2003 monitoring year, the surface water of the west side generally exhibited clean conditions where nine of the twelve measurements were found below the 3.3 mg/L screening level. South Creek also exhibited clean conditions with 88% of the measurements performed in 2003 being under the 3.3 mg/L screening level.

The General Criteria for BOD<sub>5</sub> in all surface waters as designated by FAC Chapter 62-302, "Rules and Regulations of the Department of Environmental Protection," as well as Sarasota County Ordinance No. 98-066, as amended, specifies that BOD<sub>5</sub> shall not be increased to levels that would result in violations of dissolved oxygen. Only five of the twenty-eight BOD<sub>5</sub> concentrations measured in Catfish Creek, North Creek and South Creek during 2003 exceeded the 3.3 mg/L screening level that the FDER (1990) considers to suggest potential water quality problems. Also during the nineteenth year of monitoring, only two (2) of the

28 BOD<sub>5</sub> measurements collected from the east side or west side exceeded the 5 mg/L level which Hynes (1966) considered "doubtful" or between "fairly clean" and "bad" water quality.

## 4.3.2 Dissolved Oxygen

#### **West Side**

**Appendix Table B-8** provides the results of dissolved oxygen measurements acquired during the nineteenth year of monitoring. Overall, dissolved oxygen was found to average 7.3 mg/L, with a range of 3.4 to 14.9 mg/L.

Seasonally, the highest average dissolved oxygen levels were observed for the March monitoring event with concentrations averaging 7.9 mg/L. Typically, higher dissolved oxygen levels are associated with the lower water temperatures observed during the March event. In contrast, dissolved oxygen concentrations for the September monitoring event averaged 6.7 mg/L in conjunction with the higher average water temperatures. The 2003 monitoring year seasonal trends are similar to those observed for dissolved oxygen during previous monitoring years (CCI, 1988a, 1988b, 1991, 1992a, 1993, 1994, 1995b, 1996, 1997, 1998 and VHB 2001 and 2002), which reflect the changes in the solubility of dissolved oxygen throughout the water column with changes in water temperature. Spatially, average dissolved oxygen concentrations were generally higher for stations within the Catfish Creek Basin with lower concentrations recorded for Station NC-6 in the North Creek Basin.

The dissolved oxygen concentrations obtained during the 2003 monitoring year for Catfish and North Creeks are generally comparable to those measured during the previous monitoring years (CCI, 1988a, 1988b, 1991, 1992a, 1993, 1994, 1995b, 1996, 1997, 1998 and VHB, 1999, 2000, 2001 and 2002) During the third through eighteenth monitoring years, dissolved oxygen was found to average from 4.5 to 8.5 mg/L (CCI, 1988a, 1988b, 1991, 1992a, 1993, 1994, 1995b, 1996, 1997, 1998, 1999 and VHB, 1999, 2000, 2001 and 2002).

Dissolved oxygen concentrations in the two streams of the west side have previously documented levels below the 5.0 mg/L criteria specified by FAC Chapter 62-302 for predominantly freshwater. As such, three of the 12 dissolved oxygen measurements made during 2003 were below the 5.0 mg/L state criteria.

#### **East Side**

**Appendix Table C-8** provides the results of dissolved oxygen measurements acquired during the 2003 monitoring year in South Creek. Overall, dissolved oxygen was found to average 5.9 mg/L and range from 1.2

to 11.8 mg/L. The highest dissolved oxygen concentration (11.8 mg/L) was recorded at Station SC-4 during the July event. The lowest average dissolved oxygen level (i.e., 1.2 mg/L) was recorded in the lower reach of South Creek (at Station SC-1).

Seasonally, the highest average dissolved oxygen levels were observed for both the January and April 2003 monitoring event with the lowest levels occurring during the July and October events. This is similar to the previous monitoring years (CCI, 1988a, 1988b, 1991, 1992a, 1993, 1996, 1997 and VHB, 1999, 2000, 2001 and 2003) and reflects the changes in the solubility of dissolved oxygen in the water column with changes in water temperature. During 2003, the average dissolved oxygen levels followed seasonal trends and were lower during the warmer events. During the nineteenth monitoring year, dissolved oxygen concentrations in South Creek occurred at levels below the 5.0 mg/L criteria specified by FAC Chapter 62-302 for predominantly freshwater approximately 44% of the time. Of the sixteen dissolved oxygen measurements made during the 2003 monitoring year, seven measurements were below the 5.0 mg/L state criteria.

An evaluation of diurnal variations in dissolved oxygen in Catfish Creek and South Creek was performed during the dry season of 1985 and the wet season of 1986. The results of the diurnal evaluation showed typical increases in dissolved oxygen during the day to maximum levels by mid-afternoon and declines during the night to minimal levels by midmorning, as well as diurnal trends characteristic of the stream community. A summary of the results of the diurnal study is provided in the report prepared by CCI (1987).

### **4.3.3** *Water pH*

#### **West Side**

Results of pH monitoring in Catfish Creek and North Creek during 2003 are provided in **Appendix Table B-9**. During the 2003 monitoring year, pH levels in these two streams of the Palmer Ranch ranged from 6.3 to 8.3. Similar pH ranges were observed during the first through eighteenth monitoring years (Palmer Venture, 1986; and CCI, 1986, 1988a, 1988b, 1991, 1992a, 1993, 1994, 1995b, 1996, 1997, 1998, 1999 and VHB, 1999, 2000, 2001 and 2002).

During 2003, the lowest pH levels were observed at CC-1 and NC-6 with pH levels averaging 6.8 and 7.1, respectively. The highest pH levels were recorded at Stations CC-2 and CC-3, with average pH levels of 8.2 and 7.7. These minimal differences are attributed primarily to spatial variations in community metabolisms.

Results of pH monitoring in South Creek during 2003 are given in **Appendix Table C-9**. During the 2003 monitoring year, surface water quality stations along South Creek exhibited pH levels ranging from 6.3 to 8.0. The range of pH observed during the 2003 monitoring year was similar to that observed during previous years of monitoring (Palmer Venture, 1986; and CCI, 1986, 1988a, 1988b, 1991, 1992a, 1995, 1996, 1997, 1998, 1999 and VHB, 1999, 2000, 2001 and 2002).

Seasonally, slightly higher pH levels were recorded for the January sampling event. These higher pH levels are probably associated with the less input of low pH stormwater runoff and greater accumulation of algae and plants due to lower stream flows resulting in a greater level of photosynthetic activity. Spatially, similar pH levels were observed at Stations SC-1, SC-2 and SC-3 with levels averaging 7.0 units. The highest pH levels were recorded at Station SC-4 with an average of 7.6. These slight differences in pH distributions in South Creek are primarily attributed to spatial variations in community metabolisms.

Differences or changes in pH are indicative of the effects of net community metabolisms on the level of carbon dioxide and pH. During periods of net community respiration, carbon dioxide (CO<sub>2</sub>) is produced faster than it is assimilated. When CO<sub>2</sub> is dissolved in water, carbonic acid (H<sub>2</sub>CO<sub>3</sub>) is formed in the following reaction:

$$H_2O + CO_{2(g)} = H_2CO_{3(aq)} = H^+ + HCO_3^-$$

As a result of  $CO_2$  production during respiration, water pH is depressed due to the release of hydrogen ions  $(H^+)$  as  $H_2CO_3$  dissociates. In contrast, carbon dioxide is consumed faster than it is produced during periods of net community photosynthesis (primary production). Thus, the reaction will shift toward the left, thereby removing  $CO_2$  and increasing pH.

Therefore, pH typically exhibits a diel trend of increases during the day and decreases during the night. The amplitude of the cycle normally depends on the rate of production and consumption and to a lesser extent on the buffering capacity, *i.e.*, alkalinity, of the water and atmospheric exchange of carbon dioxide.

In a diurnal evaluation of Catfish Creek and South Creek, which was conducted during the dry season of 1985 and the wet season of 1986, CCI (1987) reported changes in pH characteristic of the different biological communities. During the day, Catfish Creek and South Creek exhibited changes in pH ranging up to a 1 to 2

unit increase with maximum diurnal changes observed in the lower reach of Catfish Creek (*i.e.*, CC-5) where the greatest metabolic rates were encountered.

As specified in the General Criteria for all surface waters (FAC Chapter 62-302) and in Sarasota County Ordinance No. 98-066, as amended, the allowable variation in pH is 1.0 units above or below the normal pH if the pH is not lowered or elevated outside the range of 6.0 to 8.5. Additionally, if natural background is less than 6.0, the pH shall not vary below the natural backgrounds or vary more than one unit above natural background. Similarly, if natural background is above 8.5, pH shall not vary above natural background or vary more than one unit below background. During the nineteenth year of monitoring, all pH measurements in Catfish Creek, North Creek and South Creek were within the allowable range of 6.0 to 8.5.

#### 4.4 Macronutrients

## 4.4.1 Total Nitrogen

# West Side

**Appendix Table B-10** provides the results of total nitrogen measurements acquired during the 2003 monitoring year for Catfish Creek and North Creek. Overall, total nitrogen levels in Catfish Creek and North Creek ranged from 0.78 to 1.68 mg/L and averaged 1.25 mg/L during the 2003 monitoring year. Similar average total nitrogen concentrations of 1.19 and 1.26 mg/L were observed during the sixth, seventh, twelfth and fifteenth years of monitoring (CCI, 1990, 1991, 1996 and 1999).

**Figure 4.4** provides the mean total nitrogen concentrations observed for the streams traversing the west side of the Palmer Ranch during the second through nineteenth monitoring years. Also included in **Figure 4.4** is the average total nitrogen concentration measured in Catfish Creek during the "Stormwater Pollutant Loading Monitoring Program" performed at the Palmer Ranch (CCI, 1992b). The mean concentrations for each component of total nitrogen (*i.e.*, ammonia, nitrate + nitrite, and organic nitrogen) are also depicted in **Figure 4.4** in order to compare the relative importance of each nitrogen fraction. The average total nitrogen concentrations for the six monitoring stations in these two streams of the west side of the Palmer Ranch decreased in 2003. Of forms of nitrogen that are readily assimilated by algae and plants (*i.e.*, nitrate + nitrite, ammonia), ammonia stayed the same and nitrate + nitrite nitrogen slightly increased this year.

Seasonally, total nitrogen concentrations in September were similar as those observed during the March semiannual monitoring event at all stations. In Catfish Creek, the highest average total nitrogen concentration of 1.48 mg/L was observed at Station CC-1. The lowest average total nitrogen concentration in Catfish Creek

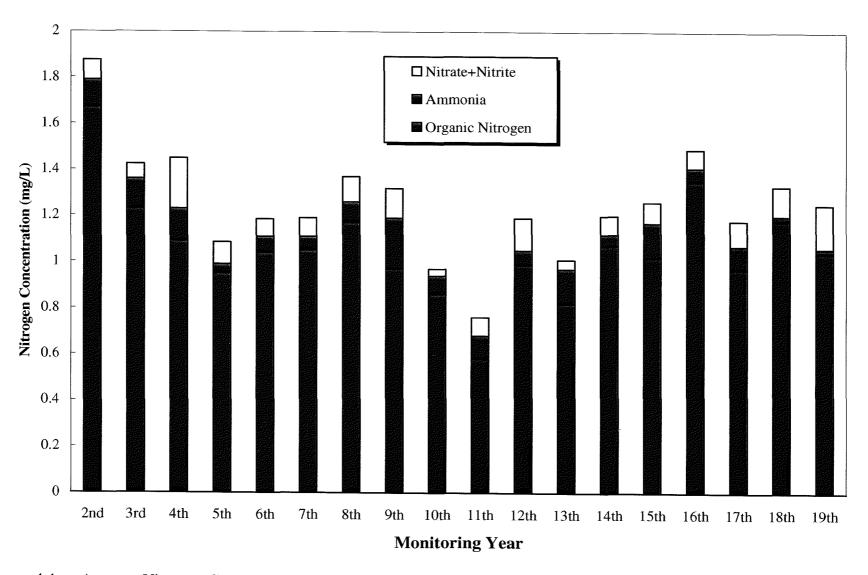


Figure 4.4 Average Nitrogen Concentrations Measured on the West Side of Palmer Ranch from the Second through the Nineteenth Monitoring Year.

was 0.87 mg/L, and was recorded at Station CC-3. The average total nitrogen levels determined in North Creek were above the average level reported for the stations located in Catfish Creek.

As has been reported for all previous monitoring years, the largest fraction of total nitrogen observed during 2003 is organic nitrogen. During the nineteenth monitoring year, organic nitrogen represented approximately 83.2 percent of total nitrogen and averaged 1.04 mg/L. The second most abundant form of nitrogen was nitrate nitrogen, which represented 13.6 percent of the total nitrogen with an average concentration of 0.17 mg/L. Ammoniacal (*i.e.*, ionized plus unionized ammonia) nitrogen represented approximately 1.6 percent of the total nitrogen with an average level of 0.02 mg/L. A similar fraction of total nitrogen was found to be nitrite with an average concentration of 0.02 mg/L that also represented a 1.6 percent of the total nitrogen concentration.

Similarly, CCI (1986, 1988a, 1988b, 1991, 1992a, 1993, 1994, 1995b, 1996, 1997, 1998 and VHB, 1999, 2000, 2001 and 2002) reported generally comparable breakdowns of total nitrogen in Catfish Creek and North Creek during previous years of monitoring. The largest fraction of total nitrogen observed during the previous years of monitoring also occurred as organic nitrogen. Organic nitrogen represented from 76 to 91 percent of the total nitrogen content and averaged from 0.58 to 1.67 mg/L during these periods. The second most abundant form of nitrogen has generally been ammoniacal nitrogen that represented from 4 to 10 percent of the total, with concentrations averaging 0.01 to 0.22 mg/L over the same period. However, in the fourth, twelfth, fourteenth, eighteenth and current year (nineteenth event), nitrate nitrogen represented a higher percent of the total nitrogen. Nitrate represented approximately 4 to 20 percent of the total nitrogen content with average nitrate levels ranging from <0.01 to 0.98 mg/L during the previous years of monitoring. As during the 2003 monitoring year, the smallest fraction of total nitrogen during previous years of monitoring was nitrite, which represented 1.6 percent of the total nitrogen present. During most years of monitoring, the percentage of total nitrogen represented by nitrite was less than 1 percent.

## **East Side**

Total nitrogen measurements acquired during the 2003 monitoring year in South Creek are provided in **Appendix Table C-10**. During the four 2003 sampling events, total nitrogen concentrations in South Creek averaged 1.26 mg/L and ranged from 0.71 to 3.20 mg/L. Spatially, the highest average total nitrogen concentrations of 2.01 mg/L was observed at Station SC-3. Station SC-4 exhibited the lowest average total nitrogen concentrations at 0.92 mg/L during the 2003 monitoring year. Seasonally, the highest mean total nitrogen concentration (1.76 mg/L) was observed for the July monitoring event.

Overall, total nitrogen concentrations measured during 2003 were only higher than those determined during the ninth, eleventh and twelfth years when total nitrogen averaged 1.17, 1.06 and 1.05, respectively.

Figure 4.5 provides the mean total nitrogen concentrations observed for South Creek during the second, third, fourth, fifth, sixth, seventh, tenth, eleventh, twelfth, thirteenth, fourteenth, fifteenth, sixteenth, seventeenth, eighteenth and nineteenth monitoring years. Also included in Figure 4.5 is the average total nitrogen concentration measured in South Creek during the "Stormwater Pollutant Loading Monitoring Program" performed at the Palmer Ranch (CCI, 1992b). In addition, mean concentrations for each component of total nitrogen (i.e., ammonia, nitrate + nitrite, and organic nitrogen) are also depicted in Figure 4.5 in order to compare the relative importance of each nitrogen fraction. Prior to 1998, average total nitrogen concentrations in South Creek had generally decreased. The average total nitrogen concentration measured during the 2003 monitoring year is below the average recorded during the 19 years of monitoring. The most pronounced decrease in nitrogen content occurred after the third monitoring year (i.e., 1987) (Figure 4.5). At that time, an area located upstream of the eastern branch of South Creek on the Palmer Ranch property was used as a dairy farm (August 1987). Before the deactivation of the dairy farm, ammoniacal nitrogen comprised from 11 to 25 percent of the total nitrogen. After the deactivation of the dairy farm, 4 to 6 percent of the total nitrogen content of South Creek was in the form of ammonia. Not only have total nitrogen levels decreased, the forms of nitrogen that are readily assimilated by algae and plants (i.e., nitrate + nitrite and ammonia) have also declined.

The largest fraction of total nitrogen observed during the entire monitoring program is organic nitrogen. During the nineteenth monitoring year, organic nitrogen represented approximately 88.1 percent of total nitrogen and averaged 1.11 mg/L. The second most abundant form of nitrogen during 2003 was ammoniac nitrogen (*i.e.*, ionized and un-ionized ammonia), which represented approximately 5.6 percent of the total nitrogen with an average concentration of 0.07 mg/L. Nitrate nitrogen also represented approximately 5.6 percent of the total nitrogen. As expected, the smallest fraction of total nitrogen was found to be nitrite with the concentration in the majority of samples collected during 2003 being at or below the 0.01-mg/L analytical detection limit. Therefore, nitrite represented approximately 0.8 percent of the total nitrogen concentration.

As stated previously, different breakdowns of total nitrogen were reported for South Creek during previous monitoring years (CCI, 1986, 1988a, 1988b, 1991 and 1992a). The largest fraction of total nitrogen observed during the previous years of monitoring also occurred in the form of organic nitrogen. Prior to 1988, organic nitrogen represented from 71 to 84 percent of the total nitrogen content and averaged from 1.08 to 2.18 mg/L.

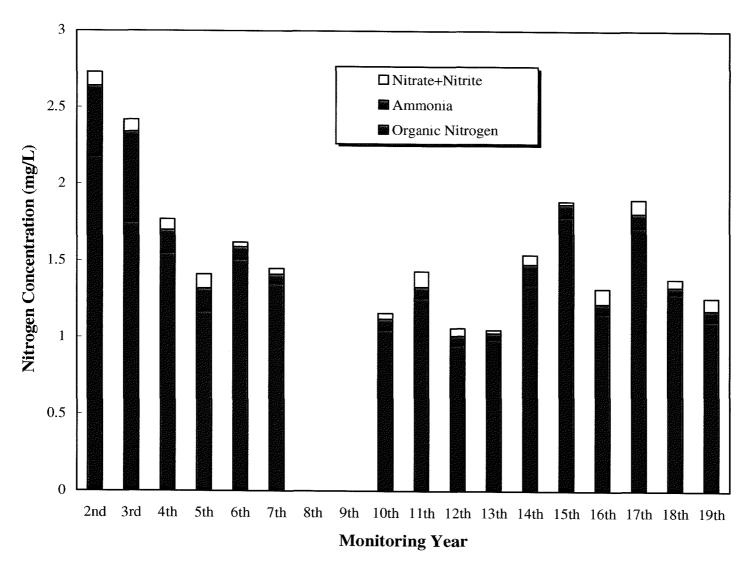


Figure 4.5 Average Nitrogen Concentration Measured on the East Side of the Palmer Ranch from the Second through the Nineteenth Monitoring Years.

After the fourth monitoring year, organic nitrogen comprised ≥88 percent of the total nitrogen measured in South Creek. Similarly, the second most abundant form of nitrogen prior to 1988 was ammoniacal nitrogen that represented from 11 to 24 percent of the total nitrogen content with average levels of 0.15 to 0.59 mg/L. Ammoniacal nitrogen also represented the second most abundant form of nitrogen after 1988. However, generally only 4 to 5 percent of the nitrogen was present in the ammonia fraction. Nitrate and nitrite represented approximately from 2 to 7 percent of the total nitrogen content with an average nitrate concentration ranging from 0.02 to 0.10 mg/L during the previous years of monitoring. As during the 2003 monitoring year, the smallest fraction of total nitrogen during previous years of monitoring was nitrite, which represented less than 1 percent of the total nitrogen present during all years.

As specified in FAC Chapter 62-302, nutrients, including total nitrogen, shall not be elevated to levels causing an imbalance in the natural flora and fauna, a condition characteristic of eutrophic or nutrient-rich streams. In this respect, there were some implications in the data acquired during the second, third, and fourth monitoring years that linked the observed total nitrogen levels to eutrophic conditions even though there appeared to be a general trend of decreasing nitrogen levels as previously discussed (CCI, 1986, 1988a, 1988b, 1991, 1992a, 1993, 1994, 1995b, 1996, 1997 and 1998). Total nitrogen results obtained during the 2003 were below the average measured during the nineteen years of the monitoring program and none of the 12 total nitrogen samples collected on the west side of the Palmer Ranch exhibited concentrations above the 2.0 mg/L screening level (considered by the FDEP (FDER, 1990) to be characteristic of eutrophic conditions). In addition, two (2) of the sixteen total nitrogen samples collected on the east side of the Palmer Ranch exceeded the screening level of 2.0 mg/L considered to be characteristic of eutrophic conditions.

#### 4.4.2 Nitrite

#### West Side

Nitrite levels observed in Catfish Creek and North Creek during the nineteenth year of monitoring are provided in **Appendix Table B-11**. As expected, nitrite concentrations throughout these two streams traversing the west side were much lower than for other forms of nitrogen, and too low to be a significant nutrient source. However, eight of the 12 samples collected during the 2003 monitoring year contained nitrite concentrations above the 0.01 mg/L analytical detection limit. During the previous monitoring years, nitrite concentrations measured in Catfish Creek and North Creek averaged <0.01 to 0.03 mg/L and had a range from <0.01 to 0.20 mg/L (CCI, 1987, 1988a, 1988b, 1991, 1992a, 1993, 1994, 1995b, 1997, 1998 and VHB, 1999, 2000, 2001 and 2002).

Nitrite levels observed in South Creek during the nineteenth year of monitoring are provided in **Appendix Table C-11**. Nitrite concentrations throughout South Creek were much lower than the other forms of nitrogen, and too low to be a significant nutrient source. Six of the sixteen samples collected during the 2003 monitoring year contained nitrite concentrations above the analytical detection limit. During the previous monitoring years, nitrite concentrations measured in South Creek averaged <0.01 to 0.02 mg/L and had a range from <0.01 to 0.13 mg/L (CCI, 1986, 1987, 1988a, 1988b, 1991, 1992a, 1995, 1996, 1997, 1998 and VHB, 1999, 2000, 2001 and 2002).

As a nutrient, nitrite is covered by the general water quality standard (FAC Chapter 62-302). However, due to the observed low concentrations, nitrite was generally of little importance as a nutrient in the streams of the Palmer Ranch. For all practical purposes, nitrite is considered to meet desired standards.

#### 4.4.3 Nitrate

#### West Side

As shown in the results provided in **Appendix Table B-12**, nitrate levels observed for Catfish Creek and North Creek in the Palmer Ranch during 2003 exhibited a yearly average of 0.17 mg/L with a range of <0.01 to 0.42 mg/L.

Nitrate levels were similar during the March and September monitoring event averaging 0.18 mg/L in Catfish and North Creeks in March and averaging 0.17 mg/L in September. Nitrate concentrations of 0.40 and 0.02 mg/L were recorded at Station NC-6 during the March and September monitoring events, respectively, with the concentration at the other monitoring Stations CC-3, CC-4 and CC-5 being at lower levels (**Appendix Table B-12**). Spatially, the highest average nitrate concentration of 0.40 mg/L was observed at Station CC-1.

# East Side

As shown in the results provided in **Appendix Table C-12**, nitrate levels observed for South Creek the Palmer Ranch during 2003 exhibited a yearly average of 0.07 mg/L with a range of <0.01 to 0.40 mg/L. The 2003 nitrate concentrations are comparable to those determined during the third, fourth and fourteenth monitoring years when nitrate exhibited yearly averages ranging from 0.06 to 0.08 (CCI, 1987, 1988 and 1998).

Seasonally, the highest nitrate levels for the four monitoring sites during 2003 were observed during the July sampling event. Slightly higher nitrate levels commonly occur in July when higher rainfall amounts result in an increase of stormwater runoff, which occurs during the summer. Nitrate concentrations observed during the April and October events at two of the four monitoring sites in the South Creek basin were below the detection limits. These low concentrations of nitrate probably are a result of low inputs of nutrients in the form of stormwater runoff as well as higher nutrient uptake by aquatic vegetation.

Spatially, the highest average nitrate concentration of 0.10 mg/L was recorded for Stations SC-1 and SC-3 (Appendix Table C-12).

As a nutrient, nitrate is designated as a parameter covered by the general water quality criteria (FAC Chapter 62-302), and is an important limiting nutrient in the streams of the Palmer Ranch. Therefore, increases in nitrate availability from anthropogenic sources would accelerate production rates of aquatic plants resulting in an imbalance in the flora and fauna that would be considered a violation of the nutrient standard. The nitrate concentrations determined during the 2003 monitoring year were similar to those recorded during the previous years of monitoring and are not thought to represent an important source of nitrogen in the streams of the Palmer Ranch. Therefore, nitrate is considered to meet desired criteria.

#### 4.4.4 Ammoniacal Nitrogen

### West Side

Appendix Table B-13 provides the results of ammoniacal nitrogen measurements (ionized plus un-ionized ammonia) recorded during the nineteenth year of monitoring on the west side of Palmer Ranch. As described previously, ammoniacal nitrogen represented approximately 1.6 percent of the total nitrogen measured during the 2003 monitoring year. Overall, ammoniacal nitrogen exhibited an average of 0.02 mg/L with a range from 0.01 to 0.04 mg/L. Ammonia concentrations measured during 2003 were within the range determined for the previous years of monitoring (Palmer Venture, 1986; and CCI, 1986, 1988a, 1991, 1992a, 1993, 1994, 1995b, 1996, 1997, 1998 and VHB, 1999, 2000, 2001 and 2002).

Seasonally, ammoniacal nitrogen concentrations in Catfish Creek and North Creek averaged 0.01 and 0.02 mg/L during the March and September sampling events, respectively. Spatially, lower average ammoniacal nitrogen concentrations occurred within all stations of Catfish Creek when compared to North Creek with the ammonia concentrations averaging 0.03 mg/L.

Appendix Table C-13 provides the results of ammoniacal nitrogen measurements (ionized plus un-ionized ammonia) recorded during the nineteenth year of monitoring at South Creek. As described previously, ammoniacal nitrogen represented 5.6 percent of the total nitrogen measured during the 2003 monitoring year. Overall, ammoniacal nitrogen exhibited an average of 0.07 mg/L with a range from <0.01 to 0.30 mg/L. Similar ammoniacal nitrogen concentrations were observed during 1987, 1990, 1991, 1994, 1995, 1996, 1999 and 2000. During these years, ammoniacal nitrogen levels averaged from 0.06 to 0.08 mg/L (Palmer Venture, 1987; CCI, 1990, 1991, 1992, 1994, 1995, 1996, 1999 and VHB, 2000). During the previous years of monitoring (and CCI, 1988a, and 1988b), ammonia concentrations were higher than those measured during the 1990 - 2003 monitoring years. These higher levels can be attributed to runoff originating from a dairy farm upstream of the Palmer Ranch property.

The highest ammoniacal nitrogen concentrations in South Creek were recorded during the April 2003 sampling event averaging 0.14 mg/L. These higher ammoniacal nitrogen concentrations are believed to be associated with the decay of vegetation in the creek. Additional ammoniacal nitrogen input is also associated with stormwater runoff entering the creek, which occurs during prolonged and/or heavy amounts of precipitation.

Although ammoniacal nitrogen is a nutrient and therefore has the potential to influence the growth of the primary producers (plants) and their balance with the consumers (bacteria and animals), FAC Chapter 62-302 does not provide a quantitative nutrient standard for ammoniacal nitrogen. Even though ammoniacal nitrogen is a potentially important nutrient to the primary producers in the streams of the Palmer Ranch, results obtained during the monitoring program suggest that nitrate might be the preferred nitrogen source. This indication is based on trends observed during previous monitoring years as related to normal plant production and decay (CCI, 1996). Other freshwater studies (Wetzel, 1975) have also concluded that aquatic vegetation, including algae, prefer nitrate to ammonia. Although it might be less preferred than nitrate, increases in ammonia have the ability to accelerate plant production, and, in turn, influence the balance between the flora and fauna of the streams traversing the Palmer Ranch. Concentrations of ammoniacal nitrogen determined during the 2003 monitoring year were generally similar to those recorded during the previous years of monitoring. These levels are not thought to represent an important source of nitrogen in the streams of the Palmer Ranch. Therefore, ammonia is considered to meet desired criteria. Since the un-ionized fraction of ammoniacal nitrogen was not evaluated independently, comparisons to County and State criteria for unionized ammonia were not made.

## 4.4.5 Organic Nitrogen

#### West Side

Organic nitrogen<sup>2</sup> concentrations determined in Catfish Creek and North Creek within the Palmer Ranch during the 2003 monitoring year are provided in **Appendix Table B-14**. Overall, an average organic nitrogen concentration of 1.04 mg/L was measured in these streams on the west side during the 2003 monitoring year with a range from 0.73 to 1.60 mg/L. Similar average organic nitrogen concentrations were observed during the sixth, seventh and fifteenth monitoring years (CCI, 1990, 1991 and 1999) with concentrations of 1.04, 1.05 and 1.02, respectively. Lower organic nitrogen concentrations were reported for the 1994, 1995 and 1997 monitoring years. Organic nitrogen concentrations for these three years averaged 0.86, 0.58 and 0.82 mg/L, respectfully (CCI, 1994, 1995b and 1997). A stabilizing or gradual improvement in water quality with respect to nitrogen is documented over the past ten years. Also, channel maintenance in Trunk Ditch during the fourth monitoring year, as well as the aquatic community changes resulting from the "reconstruction" of a segment of the Catfish Creek/Trunk Ditch Basin during the second year, may have contributed to the stabilizing/declining trend in organic nitrogen.

Generally, as observed during previous monitoring years, organic nitrogen levels increase from the spring through the summer. During past monitoring years, higher organic nitrogen concentrations were recorded during the September monitoring event as compared to the March sampling event. However, organic nitrogen levels in Catfish and North Creeks averaged 1.10 and 0.99 mg/L during the March and September 2003 monitoring events, respectively.

Typically, peaks in organic nitrogen during September are apparently associated with peaks in the standing crop of aquatic vegetation and storm water loadings, since this month represents the primary wet season. During the fall and winter, the standing crop of vegetation declines in association with low production rates and the decay of plant material. In past monitoring years, organic nitrogen concentrations have exhibited a concomitant decline as the plant material was depleted by the microbial heterotrophs during this period. Additionally, storm water loading rates most likely declined in association with minimal runoff during the relatively drier months of October through May.

<sup>&</sup>lt;sup>2</sup>Organic Nitrogen = Total Kjeldahl Nitrogen - Ammoniacal Nitrogen.

Organic nitrogen concentrations determined in South Creek within the Palmer Ranch during the 2003 monitoring year are provided in **Appendix Table C-14**. An average organic nitrogen concentration of 1.11 mg/L was measured in South Creek during the nineteenth year of monitoring with a range from 0.55 to 2.69 mg/L. The average organic nitrogen level during the 2003 monitoring year was lower than that was observed during the last monitoring year, yet is comparable to the data recorded in 1989 where organic nitrogen level was 1.17.

Seasonally, organic nitrogen concentrations were highest during the July and October events with organic nitrogen concentrations averaging 1.58 and 1.15 mg/L, respectively. Lower organic nitrogen levels were observed in the January and April events with average concentrations 1.02 and 0.68 mg/L, respectively (Appendix Table C-14). The lower organic nitrogen concentration probably resulted from greater flushing of the creek by increases in rainfall and subsequent stormwater runoff causing less accumulation of decaying vegetation.

#### 4.4.6 Total Phosphorus

#### **West Side**

During the 2003 monitoring year, total phosphorus in the Catfish Creek/Trunk Ditch basin of the Palmer Ranch averaged 0.19 mg/L and a range of 0.03 to 0.44 mg/L (**Appendix Table B-15**). The highest total phosphorus level, 0.44 mg/L, was recorded at Stations NC-6 during the September monitoring event. The lowest mean total phosphorus concentrations were observed at Station CC-3 (0.03 mg/L) (**Appendix Table B-15**).

Similar total phosphorus distributions were observed during the 1989, 1990, 1991, 1995, 1996, 1998, 2000, 2001 and 2002 monitoring years, with concentrations averaging 0.12, 0.12, 0.15, 0.18, 0.17, 0.12, 0.15, 0.15 and 0.15 mg/L, respectively (CCI, 1990, 1991, 1992, 1996, 1997 and VHB 2000, 2001 and 2002). During the 1992 monitoring year, higher total phosphorus concentrations were observed with an average concentration of 0.38 mg/L and a range of 0.06 to 2.22 mg/L (CCI, 1993). **Figure 4.6** provides the average phosphorus levels recorded for the second through the nineteenth years of monitoring. For comparison, the fractionation of orthophosphate and organic phosphorus levels is also provided in **Figure 4.6**. Average phosphorus concentrations in the Catfish Creek/Trunk Ditch and North Creek Basins declined during the third, fourth, fifth, sixth, seventh, ninth, eleventh, twelfth, fourteenth and sixteenth years of monitoring, as illustrated in **Figure 4.6**. However, average phosphorus levels recorded for the eighth year of monitoring were higher than

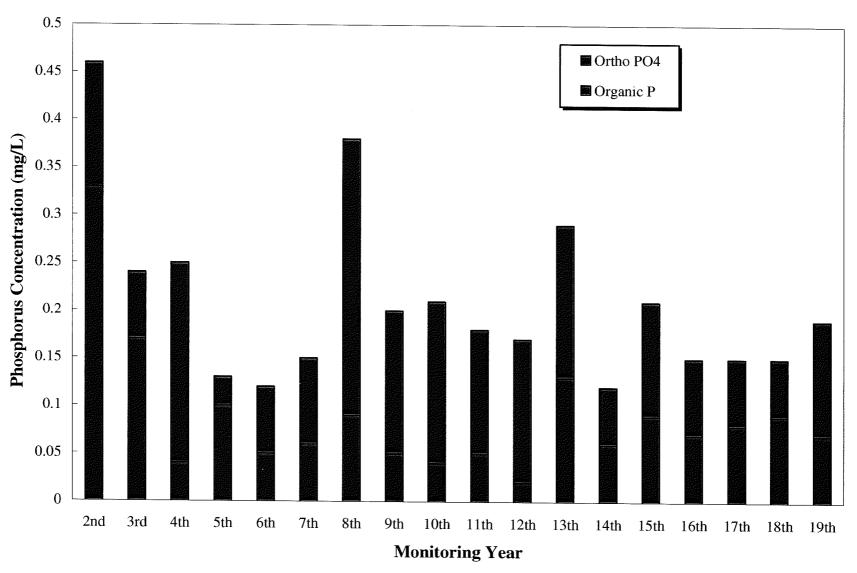


Figure 4.6 Average Phosphorus Concentrations Measured on the West Side of the Palmer Ranch from the Second through the Nineteenth Monitoring Years.

recorded for previous years. This observed increase in phosphorus was attributed to a high rainfall amount of 41.59 inches recorded during the primary wet season. Additionally, the average phosphorus level increased slightly during the thirteenth and fifteenth monitoring years. These increases are primarily due to an increase in organic phosphorus which may have resulted from the drier conditions experienced during much of the year and the subsequent die-off and decay of vegetation. The total phosphorous levels observed during the nineteenth year of monitoring were below the average recorded to date.

### **East Side**

During the 2003 monitoring year, total phosphorus in South Creek averaged 0.35 mg/L with a range of 0.03 to 1.94 mg/L (**Appendix Table C-15**). Total phosphorus concentrations during 1990, 1991, 1994 and 2001 were similar, averaging 0.30, 0.38, 0.32 and 0.37 mg/L, respectively (CCI, 1990, 1991, 1994 and VHB 2001). The highest total phosphorus levels were reported for the second monitoring year with concentrations averaging 1.63 mg/L (CCI, 1986). The source of this phosphorus in the South Creek basin of Palmer Ranch during the second year of monitoring was attributed to runoff originating from the dairy farm draining into the eastern tributary of the creek. A pronounced decrease in total phosphorus concentration was observed after the deactivation of the dairy farm located upstream of the Palmer Ranch property.

Generally, average phosphorus concentrations in the South Creek basin have declined during the third through the nineteen years of monitoring, as illustrated in **Figure 4.7**. However, total phosphorus concentrations increased slightly during the eleventh year of monitoring. This increase was attributed to higher nutrient input to South Creek in the form of runoff resulting from higher than normal rainfall recorded for the 1995 monitoring year. For comparison, the fractionation of orthophosphate and organic phosphorus levels is also provided in **Figure 4.7**. In general, orthophosphate comprised 57 percent of the total phosphorus content in South Creek.

As a nutrient, phosphorus is required by algae and other plants for the primary production of organic matter and, therefore, as specified in FAC Chapter 62-302, shall not be elevated to levels that will cause an imbalance in the natural flora and fauna. The results of the 2003 monitoring year indicate that none of the 12 samples collected on the west side of Palmer Ranch exhibited a total phosphorus concentration that exceeded the FDEP screening level of 0.46 mg/L (FDER, 1990). In addition, only three of the sixteen total phosphorus concentrations measured in South Creek exceeded the FDEP screening level. The majority of the total phosphorus concentrations measured in Catfish Creek, North Creek and South Creek were above the 0.09 mg/L level determined to be the median concentration for Florida streams (FDER, 1990).

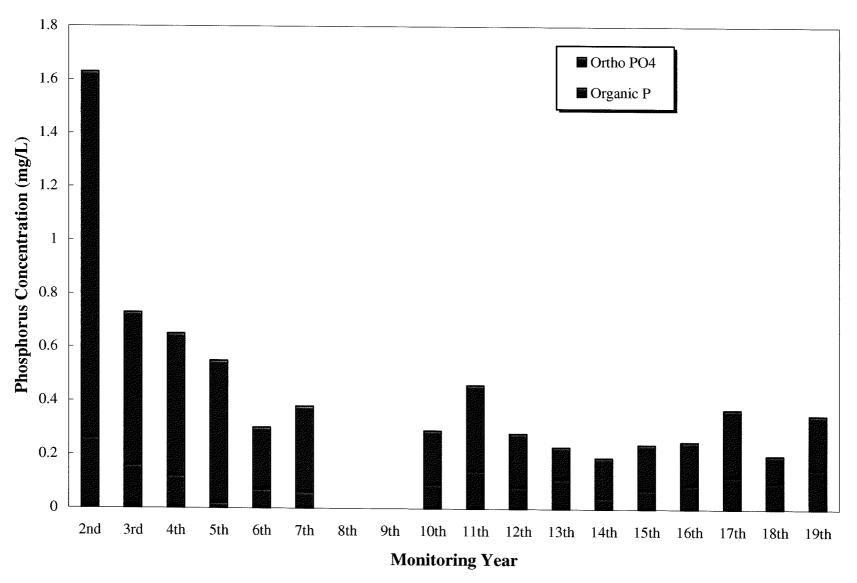


Figure 4.7 Average Phosphorus Concentrations Measured on the East Side of the Palmer Ranch from the Second through the Nineteenth Monitoring Years.

Similar phosphorus concentrations are normally found in west central Florida because of the widespread deposits of naturally occurring phosphate (Sheldon, 1982). Interestingly, well driller's logs show that phosphates exist in shallow deposits on the Palmer Ranch (Patton and Associates, 1984). In the past years, a relatively high correlation was found between the total phosphorus concentrations and turbidity levels which suggests the controlling role of naturally occurring phosphate deposits on the phosphorus concentrations in the streams of the Palmer Ranch. In addition, Palmer Venture (1986) noted that the phosphate levels in the streams of the Palmer Ranch were significantly influenced by groundwater during periods when stream flow was augmented by groundwater exfiltration (*i.e.*, low flow conditions). Consequently, phosphates originating from these naturally occurring deposits within, or upstream of, the Palmer Ranch should not be considered violations even though they exhibit the potential for contributing to high rates of primary production and a concomitant imbalance in the flora and fauna.

#### 4.4.7 Orthophosphate

#### West Side

Orthophosphate concentrations determined in the streams traversing the west side of Palmer Ranch during the 2003 monitoring year are provided in **Appendix Table B-16**. Overall, the Catfish Creek/Trunk Ditch and North Creek basins of the Palmer Ranch exhibited an average orthophosphate concentration of 0.12 mg/L with a range from 0.01 to 0.28 mg/L. As expected, orthophosphate concentrations during 2003 exhibited spatial and seasonal trends similar to those observed for total phosphorus.

Similar orthophosphate concentrations were reported during the 1986, 1993, 1995, 1996, 1997 and 1999 monitoring years (Palmer Venture 1986; and CCI 1986, 1994, 1996, 1997, 1998 and 2000). Orthophosphate concentrations measured during these monitoring years averaged from 0.12 to 0.15 mg/L. The highest orthophosphate averages occurred during the fourth and eighth monitoring years, where orthophosphate concentrations averaged 0.21 and 0.29 mg/L, respectively. In general, orthophosphate represented approximately 50 to 88 percent of the total phosphorus recorded for previous ten years of monitoring.

Seasonally, higher orthophosphate concentrations were observed during the September monitoring event. Generally, the higher orthophosphate concentrations are observed during the September event and reflect the high rainfall experienced prior monitoring. This temporal increase in orthophosphate concentrations recorded at the end of the primary wet season is attributed to increased runoff during the primary wet season.

Orthophosphate concentrations determined in South Creek traversing the Palmer Ranch during the 2003 monitoring year are provided in **Appendix Table C-16**. Overall, the South Creek basin of the Palmer Ranch exhibited an average orthophosphate concentration of 0.20 mg/L during the nineteenth year of monitoring with a range from 0.02 to 1.62 mg/L. The highest orthophosphate concentrations observed during the 2003 monitoring year occurred in January 2003. Significantly higher orthophosphate concentrations were reported for the second through fourth monitoring years. During these monitoring periods, orthophosphate concentrations averaged from 0.53 to 1.37 mg/L (CCI, 1987, 1988a, and 1988b). These higher orthophosphate levels reported for previous monitoring years were attributed to runoff that originated from a deactivated dairy farm that discharged into the eastern tributary of South Creek.


The percentage of total phosphorus consisting of orthophosphate has remained relatively constant in South Creek, ranging from 71 to 95 percent, except for 1997 and 2002 when it represented 55 and 50 percent, respectively. In 2003, orthophosphate represented approximately 57 percent of the total phosphorus. The lower percentage of orthophosphate determined in 1997, 2002 and 2003 may be associated with the overall lower phosphorus levels observed and the relatively dry antecedent conditions for most sampling events. The drier conditions would result in less orthophosphate being transported to the surface waters. Therefore, a greater percentage of the orthophosphate in the creek would be organic phosphorus resulting from decaying vegetation.

As a nutrient, orthophosphate is designated by FAC Chapter 62-302 as a general water quality parameter. This criterion specifies that the discharge of nutrients, such as orthophosphate, shall be limited to prevent an imbalance in the natural populations of aquatic flora and fauna. Although the observed levels are occasionally above the threshold considered to indicate eutrophic conditions as defined by FDEP (FDER, 1983), orthophosphate has been found to occur naturally on the Palmer Ranch. Consequently, other factors, such as nitrogen availability, are probably more growth limiting than orthophosphate. Therefore, the phosphate levels found during the 2003 monitoring year are not likely to have caused an imbalance in the aquatic flora and fauna.

#### 4.4.8 Nutrient Ratios

Nitrate and phosphate are required by aquatic plants in proportions of approximately 6.8:1 on a weight basis (or 16:1 N:P on a molar basis) (Odum, 1959 and GESAMP, 1987). Nitrogen and phosphorus are assimilated in this proportion by the primary producers (rooted aquatic plants and algae) and converted into protoplasm

during the process of photosynthesis. Conversely, the (unresistant or digestible) organic forms of nitrogen and phosphate are oxidized back into their biogenic salts during the process of aerobic respiration, *e.g.*, organic decomposition, heterotrophic activity. This relationship can be illustrated as:

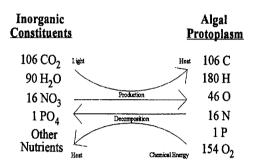

The primary forms of these biogenic salts are nitrate and orthophosphate. However, nitrate may be substituted by some plants for other forms of nitrogen, such as ammonia. Also of importance, orthophosphate may be accumulated and stored as polyphosphates by some algae, thereby alleviating a potential future phosphate limiting condition.

Importantly, other limiting factors such as low light and low dissolved oxygen could play as important, if not more important, roles in limiting the rate of primary production and decomposition in the streams of the Palmer Ranch, respectively. For example, if the availability of inorganic nitrogen is high and the N<sub>i</sub>:P<sub>i</sub> ratio is low, *e.g.*, 2:1, it would indicate that some factor other than inorganic nitrogen is the real limiting factor. Even so, determinations and the use of nutrient ratios in light of other important and potentially limiting factors are helpful in evaluating the results of long-term monitoring programs when nutrient loading and its consequences are major concerns, such as for the "Continuing Surface Water Quality Monitoring Program."

Total nitrogen to total phosphorus ratios ( $N_t$ : $P_t$ ) are provided in **Appendix Tables B-17 and C-17** with ratios of inorganic nitrogen (ammonia, nitrite, and nitrate) to orthophosphate ( $N_i$ : $P_i$ ) being given in **Appendix Tables B-18 and C-18**. The most meaningful ratio in assessing nutrient limiting conditions is based on the inorganic forms (biogenic salts as previously discussed) since these constituents are immediately available to the primary producers whereas even the unresistant organic forms must be chemically transformed into the inorganic forms prior to photosynthesis.

### West Side

The N<sub>i</sub>:P<sub>i</sub> ratios determined from September 2003 nutrient data are found to average approximately 1.64:1. A higher average ratio was observed for the March event (*i.e.*,7.56:1) primarily because of large ratios observed at Stations CC-5 and NC-6. Generally, a low N<sub>i</sub>:P<sub>i</sub> ratio would be indicative of conditions in which fixed inorganic nitrogen would limit plant growth before orthophosphate. Nutrient data collected at Stations CC-5 and NC-6 during the March monitoring event yielded a N<sub>i</sub>:P<sub>i</sub> ratio 12.0:1 and 20.75:1, respectively. This high ratio suggests that surface waters at this station may be limiting with respect to phosphorus. Further, this ratio indicates that additional input of nitrogen to Stations CC-5 and NC-6 may be associated with increased decomposition of organic matter in conjunction with decreased gross primary productivity.

The N<sub>t</sub>:P<sub>t</sub> ratios determined from 2003 nutrient data in the Catfish and North Creeks exhibited an overall average of 10.04:1 (**Appendix Table B-17**). Because this ratio is higher than 6.8:1, it would be indicative of a system out of balance with respect to nitrogen and phosphorus. Since the N<sub>t</sub>:P<sub>t</sub> ratio is higher than 6.8:1 (algal protoplasm, by weight) it indicates a condition in which phosphorus would limit plant growth before nitrogen. However, it is important to note that this average N<sub>t</sub>:P<sub>t</sub> ratio is skewed with respect to the March 2003 monitoring event. During this event, the N<sub>t</sub>:P<sub>t</sub> ratio calculated for Stations CC-3 and NC-6 were, 26.00:1 and 22.00:1, respectively, suggesting that there may be additional nitrogen input in the vicinity of Stations CC-3 and NC-6 (Meybeck, 1982).

Overall, the generally low  $N_i$ : $P_i$  ratios calculated from the 2003 data are attributed to the naturally high levels of orthophosphate, while total nitrogen is comprised of approximately 17 percent inorganic nitrogen. The higher  $N_t$ : $P_t$  ratios determined during the 2003 monitoring events are indicative of the abundance of aquatic vegetation in the creeks and the high percentage of organic nutrients present.

#### East Side

The  $N_i$ : $P_i$  ratios determined during 2003 for South Creek are generally low and found to average approximately 2.89:1. This is indicative of conditions in which fixed inorganic nitrogen would limit plant growth before orthophosphate (**Appendix Table C-18**). Conversely, the  $N_i$ : $P_i$  ratios for South Creek were found to average 8.72:1 indicating a different balance with respect to nitrogen and phosphorus (**Appendix Table C-17**). In a nutrient-balanced system, neither nitrogen nor phosphorus limit plant growth because both are present in the proper proportions for plant growth. The lower  $N_i$ : $P_i$  ratios calculated from the 2003 data are attributed to the naturally high levels of orthophosphate, as well as the high percentage of total phosphorus

represented by orthophosphate (57 percent of total phosphorus) while approximately 18 percent of the total nitrogen is comprised of inorganic nitrogen.

During the nineteenth year of monitoring, the  $N_i$ : $P_i$  ratios in South Creek were generally indicative of excess phosphorus with respect to nitrogen (*i.e.*, nitrogen limited system). Higher  $N_i$ : $P_i$  ratio averages of 4.23:1 and 4.98:1 were observed during the April and July events. The  $N_i$ : $P_i$  ratios averaged approximately 1.37:1 and 0.98:1 during the January and October events, respectively.

#### 4.5 Oils and Greases

### West Side

As provided in **Appendix Table B-19**, the concentration of oil and grease in the streams on the west side of the Palmer Ranch averaged 2.4 mg/L during the 2003 monitoring year. Additionally, all oil and grease measurements made during 2003 were below the State and County standard of 5.0 mg/L specified in FAC Chapter 62-302. The concentrations of oils and greases reported in the streams of the west side during the previous years of the monitoring program (Palmer Venture, 1986; and CCI, 1986, 1988a, 1988b, 1991, 1992a, 1993, 1994, 1995b, 1996, 1997, 1998 and VHB, 1999, 2000, 2001 and 2002), ranged from less than 0.1 mg/L to 17 mg/L. Most of the historic observations (276 of 283) were found to be less than the maximum allowable State criteria of 5.0 mg/L.

# East Side

Six of the sixteen oil and grease concentrations determined for water samples collected in the South Creek during the 2003 monitoring year were below analytical detection limits (**Appendix Table C-19**). Overall, oil and grease content in South Creek averaged 2.3 mg/L and ranged from <1.0 to 4.8 mg/L. All measurements made during 2003 fell below the State standard of 5.0 mg/L specified in FAC Chapter 62-302. The concentrations of oils and greases reported in South Creek during the previous years of the monitoring program ranged from <0.2 mg/L to 11 mg/L. Ninety-nine (99) percent of the observations (*i.e.*, 198 of 199) in the Palmer Ranch portion of South Creek were found to be lower than the maximum allowable State criteria of 5 mg/L.

## 4.6 Bacteriological Parameters

### 4.6.1 Total Coliform

#### West Side

As indicated in **Appendix Table B-20**, the streams traversing the west side were found to exhibit concentrations of total coliform bacteria ranging from 120 to >20,000 colonies/100 mL with an average of 7,075 colonies/100 mL. Of the 12 samples collected during the 2003 monitoring year, five (5) exceeded the State and County water quality standards which allow up to 2,400 colonies/100 mL. The highest bacteria concentrations were observed in the lower reach of the Catfish Creek/Trunk Ditch basin. During the second, third, fourth, sixth, seventh and fourteenth monitoring years (CCI, 1986, 1988a, 1988b, 1991, 1992a and 1999), the total coliform concentrations in the Catfish Creek/Trunk Ditch basin were also found to commonly exceed the State and County standards with 67, 52, 53, 43, 78, 32 and 55 percent of the results being higher than the 2,400 colonies/100 mL criteria, respectively.

During previous years of monitoring, the highest number of total coliform bacteria colonies have generally been observed after periods of rainfall, typically during the primary wet season. This trend continued during the 2003 monitoring year. The mean total coliform level recorded for the September monitoring event in Catfish and North Creeks was 13,783-colonies/100 mL compared to an average of 367-colonies/100 mL for the March event. More common seasonal trends with respect to coliform bacteria levels are typically associated with rainfall.

### **East Side**

As indicated in **Appendix Table C-20**, South Creek was found to exhibit total coliform bacteria concentrations ranging from 100 to 2,700 colonies/100 mL and averaging 751 colonies/100 mL. Only one of the 16 total coliform bacteria levels measured during 2003 exceeded the State water quality criteria, which allows up to 2,400 colonies/100 mL.

The highest total coliform bacteria levels observed during 2003 occurred during stagnant water conditions in October (average of 2,000 colonies/mL) with the second highest levels during July with bacteria levels averaging 495 colonies/100 mL.

Spatially, the highest average bacteria concentration (*i.e.*, 1,183 colonies/100 mL) was observed at Station SC-3 of the South Creek Basin. Along with stagnant water conditions, the cattle and wild animals using the area around Station SC-3 are likely to represent the most significant source of bacteria in the area.

As noted in previous years (CCI, 1988a, 1988b, 1991, 1992a, 1995, 1996, 1997, 1998 and VHB, 1999, 2000, 2002 and 2003), data show that several sources of coliform bacteria exist on and upstream of the Palmer Ranch. A primary source is expected to be the naturally occurring coliform bacteria of the soils and vegetation on and upstream of the ranch. During periods of land clearing coupled with significant runoff, this source is expected to be exacerbated. Such a condition probably occurred during the second and third monitoring years in the Catfish Creek/Trunk Ditch basin as the construction of Prestancia was initiated. Another source of coliform bacteria is represented by the warm-blooded animals inhabiting the watershed, including dogs, cats, cattle, birds, feral hogs, deer, and rodents.

# 4.6.2 Fecal Coliform

## West Side

During the 2003 monitoring year, the streams on the west side of the Palmer Ranch exhibited fecal coliform densities ranged from <10 to >20,000 colonies/100 mL and averaged 5,940 colonies/100 mL (**Appendix Table B-21**). Six of the twelve samples (50 percent) collected during 2003 contained fecal coliform bacteria densities exceeding the 800 colonies/100 mL maximum allowed by State and County water quality criteria for Class III surface waters. The 2003 results reported this year are among the highest to date. Previous monitoring years exhibited 18 to 73 percent of the samples collected exceeding the 800 colonies/100 mL standard.

Spatially, the highest number of fecal coliform colonies during the 2003 monitoring year occurred in the lower reach of the Catfish Creek/Trunk Ditch basin at Stations CC-4 and CC-5. This indicates that the fecal coliform bacteria are primarily associated with runoff draining into the Catfish Creek/Trunk Ditch basin from off-site. As described for total coliform bacteria, higher fecal coliform levels are typically observed in Catfish and North Creeks during the September monitoring event (*i.e.*, end of the summer wet season). The high fecal coliform bacteria levels observed in both Catfish and North Creeks within the Palmer Ranch indicate significant sources of fecal coliform bacteria on and around the Ranch.

#### **East Side**

During the nineteenth year of monitoring, the South Creek basin of the Palmer Ranch exhibited fecal coliform densities that ranged from 20 to 1,100 colonies/100 mL and averaged 253 colonies/100 mL (**Appendix Table C-21**). Of the sixteen samples collected during 2003, only one exceeded the Class III State and County Standard of 800 colonies/100 mL. This is below, but comparable to the low range of 15 to 29 percent, which was recorded during the third, fourth, sixth, seventh and fourteenth monitoring years.

Spatially, Station SC-3 had the highest average concentration of fecal coliform colonies during the 2003 monitoring year. The higher bacteria levels in this portion of the creek probably reflect the greater number of warm-blooded animals in the stream communities associated with the upstream areas of the creek. Primary sources of fecal coliform bacteria are considered to be dogs, cats, birds, cattle, and other warm-blooded wild animals inhabiting the basin.

#### 4.7 Trace Elements

# West Side

During 2003, samples were collected for the analyses of trace elements (*i.e.*, arsenic, copper, lead, and zinc) during the September monitoring event. The results of these analyses are provided in **Appendix Table B-22** along with the applicable State and County Standards for each element.

Arsenic concentrations during the 2003 monitoring year ranged from 1.9 to 4.6  $\mu$ g/L and averaged 3.3  $\mu$ g/L (**Appendix Table B-22**). The concentrations of copper ranged from <1.0 to 129.0  $\mu$ g/L and averaged 28.7  $\mu$ g/L. Total lead concentrations measured in the streams on the west side of the Palmer Ranch during 2003 averaged <1.0  $\mu$ g/L. The concentration of zinc determined for the six monitoring stations during 2003 averaged 5.1  $\mu$ g/L.

#### **East Side**

During the 2003 monitoring event, samples were collected in South Creek for the analyses of trace elements (*i.e.*, arsenic, copper, lead, and zinc) during the October event. The results of these analyses are provided in **Appendix Table C-22** along with the applicable State Standards for each element.

Arsenic concentrations during the 2003 monitoring year ranged from <1.0 to 6.4  $\mu$ g/L and averaged 2.3  $\mu$ g/L (**Appendix Table C-22**). Concentrations of total copper in the South Creek basin during the 2003 monitoring period averaged 1.1  $\mu$ g/L and ranged from <1.0 to 1.9  $\mu$ g/L. All total lead concentrations measured on the east side of the Palmer Ranch during 2003 were less than 1.0  $\mu$ g/L (**Appendix Table C-22**). The concentration determined for zinc samples collected in South Creek during 2003 averaged 241, with a range of <8 to 946  $\mu$ g/L.

All arsenic concentrations measured during the 2003 monitoring year on Palmer Ranch were below the State standard of 50  $\mu$ g/L<sup>3</sup>. Possible sources of arsenic include naturally occurring minerals and the use of arsenic-based pesticides on and upstream of the Palmer Ranch. Two of the copper concentrations on the Ranch exceeded the State and County standard of 12.8  $\mu$ g/L<sup>4</sup>. Possible sources of copper in the surface waters of the Palmer Ranch include the use of copper containing herbicides, fertilizers, algicides, and pesticides. All of the measured lead concentrations in streams on Palmer Ranch were in compliance with the State and County standard of 3.6  $\mu$ g/L<sup>5</sup>. Possible anthropogenic sources of lead in the surface waters of the Palmer Ranch included automobile emissions, roads and parking areas, and runoff from light industrial land uses located upstream of the Palmer Ranch property. Only one of the zinc concentrations determined during the 2003 monitoring events was above the State and County standard of 115  $\mu$ g/L based upon a hardness of 110 mg/L. Possible sources of zinc include the use of zinc containing fertilizers and runoff from roads on and upstream of the Palmer Ranch.

<sup>&</sup>lt;sup>3</sup>Based on a total hardness of 110 mg/L

<sup>4</sup>Ibid.

<sup>5</sup>Ibid.

### 5.0 REFERENCES

- American Public Health Association 1985. Standard Methods for the Examination of Water and Wastewater, 16th Edition. American Public Health Association.
- Bradley, J. T. 1974. The Climate of Florida. In: *Climates of the States*. Vol. I Eastern States. Water Information Center, Port Washington, New York.
- Conservation Consultants, Inc. 1986. Annual Report of the Continuing Surface Water Quality Monitoring Program for the Palmer Ranch, Sarasota County, Florida. Prepared for Palmer Venture.
- Conservation Consultants, Inc. 1987. Evaluation of Diurnal Variations in Dissolved Oxygen, The Palmer Ranch, Sarasota County, Florida. Prepared for Palmer Venture.
- Conservation Consultants, Inc. 1988a. Annual Report of the Continuing Surface Water Quality Monitoring Program for the Palmer Ranch, Sarasota County, Florida. Prepared for Palmer Venture.
- Conservation Consultants, Inc. 1988b. Annual Report IV of the Continuing Surface Water Quality Monitoring Program for the Palmer Ranch, Sarasota County, Florida. Prepared for Palmer Venture.
- Conservation Consultants, Inc. 1990. Annual Report V of the Continuing Surface Water Quality Monitoring Program for the Palmer Ranch, Sarasota County, Florida. Prepared for Palmer Venture.
- Conservation Consultants, Inc. 1991. Annual Report VI of the Continuing Surface Water Quality Monitoring Program for the Palmer Ranch, Sarasota County, Florida. Prepared for Palmer Venture.
- Conservation Consultants, Inc. 1992a. Annual Report VII of the Continuing Surface Water Quality Monitoring Program for the Palmer Ranch, Sarasota County, Florida. Prepared for Palmer Venture.
- Conservation Consultants, Inc. 1992b. Stormwater Pollutant Loading Monitoring Program for the Palmer Ranch, August 1988 April 1990, Sarasota County, Florida. Prepared for the Palmer Ranch.
- Conservation Consultants, Inc. 1993. Annual Report VIII of the Continuing Surface Water Quality Monitoring Program for the Palmer Ranch, Sarasota County, Florida. Prepared for Palmer Venture.
- Conservation Consultants, Inc. 1994. Annual Report IX of the Continuing Surface Water Quality Monitoring Program for the Palmer Ranch, Sarasota County, Florida. Prepared for Palmer Venture.
- CCI Environmental Services, Inc. 1995a. Annual Report of the Continuing Surface Water Quality Monitoring Program in South Creek of the Palmer Ranch, January December 1994. Prepared for Palmer Venture.
- CCI Environmental Services, Inc. 1995b. Tenth Annual Report of the Continuing Surface Water Quality Monitoring Program for the Catfish and North Creeks of the Palmer Ranch, January December 1994. Prepared for Palmer Venture.
- CCI Environmental Services, Inc. 1996a. Annual Report of the Continuing Surface Water Quality Monitoring Program in South Creek of the Palmer Ranch, January December 1995 Prepared for Palmer Venture.

- CCI Environmental Services, Inc. 1996b. Eleventh Annual Report of the Continuing Surface Water Quality Monitoring Program for the Catfish and North Creeks of the Palmer Ranch, January December 1995. Prepared for Palmer Venture.
- CCI Environmental Services, Inc. 1997a. Annual Report of the Continuing Surface Water Quality Monitoring Program in South Creek of the Palmer Ranch, January December 1996. Prepared for Palmer Venture.
- CCI Environmental Services, Inc. 1997b. Twelfth Annual Report for the Continuing Surface Water Quality Monitoring Program for the Catfish and North Creeks of the Palmer Ranch, January December 1996. Prepared for Palmer Venture.
- CCI Environmental Services, Inc. 1998a. Annual Report of the Continuing Surface Water Quality Monitoring Program in South Creek of the Palmer Ranch, January December 1997 Prepared for Palmer Venture.
- CCI Environmental Services, Inc. 1998b. Thirteenth Annual Report for the Continuing Surface Water Quality Monitoring Program for the Catfish and North Creeks of the Palmer Ranch, January December 1997. Prepared for Palmer Venture
- CCI Environmental Services, Inc. 1999a. Annual Report of the Continuing Surface Water Quality Monitoring Program in South Creek of the Palmer Ranch, January December 1998 Prepared for Palmer Venture.
- CCI Environmental Services, Inc. 1999b. Fourteenth Annual Report for the Continuing Surface Water Quality Monitoring Program for the Catfish and North Creeks of the Palmer Ranch, January December 1998. Prepared for Palmer Venture.
- Florida Department of Environmental Regulation. 1990. 1990 Florida Water Quality Assessment 305(b) Technical Appendix.
- Florida Department of Environmental Regulation. 1994. Rule No.: Chapter 62-302, Water Quality Standards.
- Florida Department of Environmental Regulation. 1989. Typical Water Quality Values for Florida's Lakes, Streams, and Estuaries.
- Florida Department of Environmental Regulation. 1983. Discharge of Nutrients to Freshwater Lakes, Workshop, March 1983. Florida Division of State Planning. 1975. The Florida General Soils Atlas.
- GESAMP. 1987. *Land\Sea Boundary Flux of Contaminants: Contribution From Rivers*. Reports and Studies No. 32. UNESCO. 172 pp.
- Goodell, T.W. 1985. Quarterly Report. First Quarter of the Continuing Surface Water Quality Monitoring Program. April 1985 March 1986.
- Goodell, T.W. 1986. Correspondence to Mr. Russell Klier on July 24, 1986, regarding Stormwater Monitoring Event.

- Goodell, T.W. 1985. Personal Communication with Conservation Consultants, Inc. regarding sampling sites, frequency, and parameters to be monitored for the Continuing Surface Water Quality Monitoring Program.
- Hynes, H. B. N. 1966. The Biology of Polluted Waters. Liverpool University Press, Liverpool.
- Meybeck, M. 1982. Carbon, nitrogen and phosphorus transport by world rivers. *Am. J. Sci.*, Vol. 282, pp. 401-450.
- NOAA. 1977. Local Climatological Data. Annual Summary.
- NOAA. 1982. Monthly Normals of Temperature, Precipitation and Heating/Cooling Degree-Days for the period of 1951 1980 for the State of Florida. Extract of Climatology of the United States. No. 81. National Climatic Center, Ashville, NC.
- Odum, E. P. 1959. Fundamentals of Ecology. W. B. Saunders Company, Philadelphia and London.
- Palmer Venture. 1986. Surface Water Quality Monitoring and Assessment of the Palmer Ranch, Sarasota County Florida.
- Patton and Associates. 1984. Surface Water Management Plan. Appendix B. Groundwater Management Plan.
- Sawyer, C.N., and McCarthy, P.L. 1978. *Chemistry for Environmental Engineering*. McGraw-Hill, New York.
- Sarasota County. 2000. Ordinance No. 98-066.
- Sheldon, R.P. 1982. Phosphate Rock. Scientific American. Vol. 246:6, pp 45-51.
- Thompson, R. B. 1976. Florida Statistical Abstract. University Presses, University of Florida, Gainesville, Florida.
- Thompson, Stephen. 1987. Personal Communication with Conservation Consultants, Inc. regarding his directive to discontinue the "Continuing Surface Water Quality Monitoring Program" until further notice, effective August 1987.
- United States Environmental Protection Agency 1983. *Methods for the Chemical Analysis of Water and Wastes*, EPA 600/4-79-0210, National Environmental Research Center, Cincinnati, Ohio.
- United States Environmental Protection Agency. 1982. *Methods for Organic Chemical Analysis of Municipal and Industrial Wastewater*, EPA-600/4-82-057. Environmental Monitoring and Support Laboratory, Cincinnati, Ohio.
- United States Geological Survey. 1982. Measurement and Computation of Stream Flow. Vol. I Measurement of Stage and Discharge. *Water Supply Paper* 2175.
- Vanasse Hangen Brustlin, Inc. 1999. Fifteenth Annual Report for the Continuing Surface Water Quality Monitoring Program for the Catfish, North and South Creeks of the Palmer Ranch, January December 1999. Prepared for Palmer Ranch Holdings, Ltd.

- Vanasse Hangen Brustlin, Inc. 2000. Sixteenth Annual Report for the Continuing Surface Water Quality Monitoring Program for the Catfish, North and South Creeks of the Palmer Ranch, January December 2000. Prepared for Palmer Ranch Holdings, Ltd.
- Vanasse Hangen Brustlin, Inc. 2001. Seventeenth Annual Report for the Continuing Surface Water Quality Monitoring Program for the Catfish, North and South Creeks of the Palmer Ranch, January December 2001. Prepared for Palmer Ranch Holdings, Ltd.
- Vanasse Hangen Brustlin, Inc. 2002. Eighteenth Annual Report for the Continuing Surface Water Quality Monitoring Program for the Catfish, North and South Creeks of the Palmer Ranch, January December 2002. Prepared for Palmer Ranch Holdings, Ltd.
- Wetzel, R. G. 1975. The Nitrogen Cycle. In: Limnology. W. B. Saunders Company, Philadelphia.

# Appendix A Exhibit "E"

Exhibit "E" to the Amended and Restated Master Development Order for the Palmer Ranch Development of Regional Impact

> (An Exhibit Containing Surface Water Monitoring Program and Consisting of Pages E-1 through E-5)

#### SURFACE WATER MONITORING PROGRAM

#### Locations

Water quality measurements and grab samples shall be performed in Catfish Creek, North Creek and South Creek. Sampling and measurements shall be made at a total of 10 monitoring stations (refer to FIGURE 5). Five stations are located in Catfish Creek (CC-1, CC-2, CC-3, CC-4 and CC-5); one station is located in North Creek (NC-6); and four stations are located in South Creek (SC-1, SC-2, SC-3 and SC-4)

#### Procedures

Monitoring shall be accomplished within a two-day period. At the time of grab sampling, simultaneous in situ measurements of dissolved oxygen, pH, temperature and specific conductance shall be made and flow rates shall be determined using velocity-area measurements. Additionally, water depths and pre- and post-event weather conditions shall be recorded. All sample collections and in situ measurements shall be made at approximate mid-depth and mid-stream at each of the ten stations.

#### Frequency

Due to the wealth of baseline monitoring data which currently exists, baseline monitoring of all South Creek sites shall be suspended until one month before development begins. One month prior to the commencement of sampling the Palmer Ranch will notify the Sarasota County Pollution Control Division the dates of sampling and stations to be sampled. At the time of sampling,

UNITY OF SANCOTA)

EREBY CENTRY THAT THE FORESCOING IS A
UE AND CORRECT COPY OF THE INSTRUMENT FRED
THES OFFICE WITNESS MY NUE AND OFFICIAL

AL THIS DATE . 101 1 2 . 1007

ABY E RUSHING, CLERK OF THE CIRCUIT COURT

measurements made at all monitoring stations along South Creek. Following this initial monitoring event, all subsequent monitoring shall be performed on a quarterly basis during the development phase. During development, all stations located downstream of an area under development shall be monitored. In addition, one sampling site upstream of a development area shall be maintained for baseline determination. Once an area is substantially developed as agreed to by the Sarasota County Pollution Control Division and Palmer Ranch, a modification of the monitoring program shall be subject to discussion at any time to change the frequency of water quality monitoring from quarterly to semi-annual or to discontinue the monitoring.

Monitoring of Catfish and North Creeks shall continue on a quarterly basis for a maximum of two years or until substantial development takes place. Once substantial development or a two-year period occurs as agreed to by the Sarasota County Pollution Control Division and Palmer Ranch, monitoring frequency for sites located in Catfish and North Creeks shall be subject to change from quarterly to a semi-annual depending on the monitoring results obtained up to that time. Semi-annual sampling, for both basins, shall be performed during a dry and wet season allowing for monitoring of low and high flow conditions.

#### Parameters

All water quality grab samples shall be analyzed for the following parameters:

0	Biochemical Oxygen	0	Total Kjeldahl Nitrogen
	Demand, 5-day	0	Nitrate
0	Nitrite	0	Total Nitrogen
0	Ortho-phosphate	0	Total Phosphorus
0	Total Suspended Solids	0	Turbidity
0	Ammonia Nitrogen	0	Oils and Greases
0	Fecal Coliform	0	Total Coliform
0	рH	0	Dissolved Oxygen
0	Conductivity		_ ·

Additionally, analysis shall be done for the following parameters on an annual basis (the first analysis done for South Creek sites will be in conjunction with the initial monitoring event):

o Copper

o Lead

o Arsenic

o Zinc

No pesticide or mercury, chromium, cadmium and nickel analysis shall be performed because results obtained from the Palmer Ranch Continuous Water Quality Monitoring Program during April 1985 through June 1990 on sites along Catfish Creek indicate that these parameters have consistently been below detection limits and/or state and county standards. Therefore, it may be more important to monitor those parameters which have exhibited higher concentrations than those set by the state.

#### Methods

All laboratory analyses and in situ measurements shall be performed in accordance with procedures described in the 17th edition of Standard Methods (APHA, 1989) or the Methods for Chemical Analysis of water and Wastes (USEPA, 1993). Methods used for in situ measurements, sample collection, sample preservation and storage and, sample analysis are provided in Table A. As changes in technology advance, the methods used in laboratory analysis may be modified to reflect these state-of-the-art procedures. The surface water monitoring program for Catfish Creek, North Creek and South Creek shall be performed on a continuous basis.

#### Additional Studies

In considering the water quality of lakes on the Palmer Ranch, the Aquatic Center of the University of Florida has expressed interest in conducting limnological research on the Palmer Ranch. One of the objectives of the research would be to develop state-of-theart strategies in the control of hydrilla and water hyacinth that

TATE OF ROOMS and be applied on a nation-wide basis.

HEREBY CERTIFY THAT THE POREGOING IS A RUE AND CORRECT COPY OF THE INSTRUMENT FILED IN THIS OFFICE WITHESS MY HAND AND OFFICIAL HALL THIS DATE 1111 1 2. 1111

E-3

Since the borrow pit lake in Parcel C has an overabundance of hydrilla, this area has been selected for research. The borrow pit lake was conditioned in the MDO to undergo limnological study as a result of a previous commitment by the Palmer Ranch. characters are similar to other borrow pit lakes located on the Palmer Ranch, as well as other borrow pit lakes in Sarasota County. Management of the lake will comply with the newly adopted earthmoving ordinance (Ordinance No. 89-112) which became effective March 13, 1990. This ordinance has provisions to deal with borrow pit lakes uniformly throughout the County. This lake will be used for stormwater management purposes which will be enhanced by the creation of a littoral shelf. The creation of a littoral shelf would promote improved water quality as desirable vegetation would utilize nutrients and lower BOD and TSS levels. Additionally, the Palmer Ranch has made application for a permit from the Florida Game and Fresh Water Fish Commission for the introduction of Triploid Grass Carp. These measures, along with other biological or chemical controls that may be implemented as part of the University of Florida research project for control of hydrilla and lake rehabilitation, would indicate that a further limnological study is unwarranted. Consequently, it is recommended that the future limnological study of the borrow pit as conditioned in the MDO be deleted.

Further, the MDO required the monitoring of an off-site dairy farm to determine the source and significance of water quality problems contributed to surface water. As a result of the water quality data collected from Station SC-7, which is the site used to monitor this off-site contribution, pollutants have significantly decreased. This is no doubt a result of the elimination of the dairy farm which has been converted to residential development (Serenoa). Therefore, it is recommended that monitoring of the site be terminated.

#### Reporting

A data report shall be submitted to the Sarasota County Pollution Control Division following each sampling event. The report will (1) a map of the monitoring stations; (2) narrative include: and/or tabulation of methods used in collecting, handling, storing and analyzing all samples; (3) a tabulation of all measurement and results of analyses; and (4) the signature(s) of the individual(s) responsible for the authenticity, precision and accuracy of the Brief summaries of the responsibility data presented. credentials of the project team members shall be included. addition, an annual report of the interpretation of the data shall be prepared following each year of monitoring. The annual report include hydrological information derived from measurements as well as interpretation of the chemical parameters measured over the year. Also included in the annual report shall be tabular representations of all the data collected over the previous year for all of the sites and graphical representation of some of the chemical trends discovered over the year of monitoring.

#### Appendix B

Catfish and North Creek Water Quality Data

#### Appendix Table B-1 Continuing Surface Water Quality Monitoring Program

#### Stream Stage (ft)<sup>a</sup> January - December 2003

	Catfish Creek/Trunk Ditch									AllS	Stations	
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	Name of the second
March 6, 2003	2.9	0.2	1.3	2.4	3.8	2.1	0.3	1.8	1.5	0.2	3.8	6
September 25, 2003	1.1	0.5	2.2	2.8	1.7	1.7	0.4	1.5	1.0	0.4	2.8	6
Mean	2.0	0.4	1.8	2.6	2.8		0.4					
Minimum	1.1	0.2	1.3	2.4	1.7		0.3					
Maximum	2.9	0.5	2.2	2.8	3.8		0.4					
Std. Deviation	1.3	0.2	0.6	0.3	1.5		0.1					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	1.2	1.2	0.2	2.9	4.0							
CC-3, CC-4 (mid reach)	2.2	0.6	1.3	2.8	4.0							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	1.9	1.1	0.2	3.8	10.0							
All six stations	1.6	1.2	0.2	3.8	12.0							

a Stream Stage measured at sampling site for each station.

STD - Standard deviation

N - Number of observations

### Appendix Table B-2 Continuing Surface Water Quality Monitoring Program Stream Flow (gpm) January - December 2003

	Catfish Creek/Trunk Ditch										Stations	Page 1
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	anna <b>N</b> effecti
March 6, 2003	134.6	22.4	0.0	0.0	359.0	103.2	269.3	130.9	153.1	0.0	1714.4	6
September 12, 2003	1867.0	53.9	0.0	0.0	7315.4	1847.3	547.5	1630.6	2875.8	0.0	1660.6	6
Mean	1000.8	38.1	0.0	0.0	3837.2		408.4					
Minimum	134.6	22.4	0.0	0.0	359.0		269.3					
Maximum	1867.0	53.9	0.0	0.0	7315.4		547.5					
Std. Deviation	1225.0	22.2	0.0	0.0	4918.9		196.8					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	519.5	899.6	22.4	1867.0	4.0							
CC-3, CC-4 (mid reach)	0.0	0.0	0.0	0.0	4.0							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	975.2	2300.7	0.0	7315.4	10.0							
All six stations	880.8	2093.6	0.0	7315.4	12.0							

a Stream Stage measured at sampling site for each station. 0.0 = Station dry.

STD - Standard deviation

N - Number of observations

#### Appendix Table B-3 Continuing Surface Water Quality Monitoring Program

#### Water Temperature (°C) January - December 2003

	Catfish Creek/Trunk Ditch									All	Stations	
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	$N_{\rm simula}$
March 6, 2003	24.5	26.2	26.9	25.8	25.6	25.8	25.1	25.7	0.8	24.5	26.9	6
September 12, 2003	26.5	30.8	29.8	27.7	28.8	28.7	30.0	28.9	1.6	26.5	30.8	6
Mean	25.5	28.5	28.4	26.8	27.2		27.6					
Minimum	24.5	26.2	26.9	25.8	25.6		25.1					
Maximum	26.5	30.8	29.8	27.7	28.8		30.0					
Std. Deviation	1.4	3.3	2.1	1.3	2.3		3.5					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	27.0	2.7	24.5	30.8	4							
CC-3, CC-4 (mid reach)	27.6	1.7	25.8	29.8	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	27.3	2.0	24.5	30.8	10							
All six stations	27.3	2.1	24.5	30.8	12							

STD - Standard deviation

#### Appendix Table B-3 Continuing Surface Water Quality Monitoring Program

#### Water Temperature (°C) January - December 2003

			Catfish (	Creek/Trun	k Ditch					All	Stations	
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
March 6, 2003	24.5	26.2	26.9	25.8	25.6	25.8	25.1	25.7	0.8	24.5	26.9	6
September 12, 2003	26.5	30.8	29.8	27.7	28.8	28.7	30.0	28.9	1.6	26.5	30.8	6
Mean	25.5	28.5	28.4	26.8	27.2		27.6					
Minimum	24.5	26.2	26.9	25.8	25.6		25.1					
Maximum	26.5	30.8	29.8	27.7	28.8		30.0					
Std. Deviation	1.4	3.3	2.1	1.3	2.3		3.5					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	27.0	2.7	24.5	30.8	4							
CC-3, CC-4 (mid reach)	27.6	1.7	25.8	29.8	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	27.3	2.0	24.5	30.8	10							
All six stations	27.3	2.1	24.5	30.8	12							

STD - Standard deviation

### Appendix Table B-4 Continuing Surface Water Quality Monitoring Program Specific Conductance (µmhos/cm) January - December 2003

	anthum e ann a		Catfish (	Creek/Trun	k Ditch		11200			All	Stations	
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	$N_{\rm cons}$
March 6, 2003	639	1,090	885	983	1,020	923	1,058	946	166	639	1,090	6
September 12, 2003	510	802	528	661	644	629	937	680	164	510	937	6
Mean	575	946	707	822	832		998					
Minimum	510	802	528	661	644		937					
Maximum	639	1,090	885	983	1,020		1,058					
Std. Deviation	91	204	252	228	266		86					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	760	250	510	1,090	4							
CC-3, CC-4 (mid reach)	764	207	528	983	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	776	210	510	1,090	10							
All six stations	813	210	510	1,090	12							

STD - Standard deviation

## Appendix Table B-5 Continuing Surface Water Quality Monitoring Program Total Suspended Solids (mg/L) January - December 2003

			Catfish (	Creek/Trun	k Ditch	Albume II. Handara — Album	oraseniaa Selatuar			Alls	Stations	
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
March 6, 2003	1.2	15.6	1.6	5.8	4.2	5.7	1.4	5.0	5.5	1.2	15.6	6
September 12, 2003	19.6	2.4	5.0	2.4	3.0	6.5	13.6	7.7	7.2	2.4	19.6	6
Mean	10.4	9.0	3.3	4.1	3.6		7.5					
Minimum	1.2	2.4	1.6	2.4	3.0		1.4					
Maximum	19.6	15.6	5.0	5.8	4.2		13.6					
Std. Deviation	13.0	9.3	2.4	2.4	0.8		8.6					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	9.7	9.3	1.2	19.6	4							
CC-3, CC-4 (mid reach)	3.7	2.0	1.6	5.8	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	6.1	6.3	1.2	19.6	10							
All six stations	6.3	6.3	1.2	19.6	12							

STD - Standard deviation

### Appendix Table B-6 Continuing Surface Water Quality Monitoring Program Turbidity (NTU) January - December 2003

			Catfish (	Creek/Trun	k Ditch				ASSESSMENT OF THE PARTY OF THE	All	Stations	
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
March 6, 2003	3.4	8.3	2.4	6.2	4.5	5.0	5.1	5.0	2.1	2.4	8.3	6
September 12, 2003	12.7	1.4	3.1	3.4	3.4	4.8	22.0	7.7	8.1	1.4	22.0	6
Mean	8.1	4.9	2.8	4.8	4.0		13.6					
Minimum	3.4	1.4	2.4	3.4	3.4		5.1					
Maximum	12.7	8.3	3.1	6.2	4.5		22.0					
Std. Deviation	6.6	4.9	0.5	2.0	0.8		12.0					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	6.5	5.1	1.4	12.7	4							
CC-3, CC-4 (mid reach)	3.8	1.7	2.4	6.2	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	4.9	3.4	1.4	12.7	10							
All six stations	6.3	5.8	1.4	22.0	12							

STD - Standard deviation

### Appendix Table B-7 Continuing Surface Water Quality Monitoring Program 5-Day Biochemical Oxygen Demand (mg/L) January - December 2003

	alam <sup>kitani</sup> ya		Catfish (	Creek/Trun	k Ditch				ine San <sup>Tala</sup> Militar	AllS	Stations	in Mary Const
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
March 6, 2003	<2.0	4.0	<2.0	2.9	2.7	2.3	<2.0	2.1	1.3	<2.0	4.0	6
September 12, 2003	2.6	<2.0	3.8	<2.0	2.8	2.2	3.5	2.5	1.2	<2.0	3.8	6
Mean	1.8	2.5	2.4	2.0	2.8		2.3					
Minimum	< 2.0	< 2.0	< 2.0	< 2.0	2.7		< 2.0					
Maximum	2.6	4.0	3.8	2.9	2.8		3.5					
Std. Deviation	1.1	2.1	2.0	1.3	0.1		1.8					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	2.2	1.4	< 2.0	4.0	4							
CC-3, CC-4 (mid reach)	2.2	1.4	< 2.0	3.8	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	2.3	1.2	<2.0	4.0	10							
All six stations	2.3	1.2	<2.0	4.0	12							

STD - Standard deviation

## Appendix Table B-8 Continuing Surface Water Quality Monitoring Program Dissolved Oxygen (mg/L) January - December 2003

No. of the Control of	Catfish Creek/Trunk Ditch										Stations	
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	$\mathbf{N}$
March 6, 2003	6.1	11.1	9.8	8.9	5.8	8.3	5.9	7.9	2.3	5.8	11.1	6
September 12, 2003	5.6	14.9	8.5	3.4	3.8	7.2	3.7	6.7	4.5	3.4	14.9	6
Mean	5.9	13.0	9.2	6.2	4.8		4.8					
Minimum	5.6	11.1	8.5	3.4	3.8		3.7					
Maximum	6.1	14.9	9.8	8.9	5.8		5.9					
Std. Deviation	0.4	2.7	0.9	3.9	1.4		1.6					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	9.4	4.4	5.6	14.9	4							
CC-3, CC-4 (mid reach)	7.7	2.9	3.4	9.8	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	7.8	3.6	3.4	14.9	10							
All six stations	7.3	3.5	3.4	14.9	12							

STD - Standard deviation

## Appendix Table B-9 Continuing Surface Water Quality Monitoring Program Water pH (-Log[H+]) January - December 2003

			Catfish (	Creek/Trun	k Ditch					All	Stations	AND STATES
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
March 6, 2003	7.3	8.3	7.8	7.4	7.4	7.6	7.1	7.6	0.4	7.1	8.3	6
September 12, 2003	6.3	8.0	7.6	7.0	7.0	7.2	7.0	7.2	0.6	6.3	8.0	6
Mean	6.8	8.2	7.7	7.2	7.2		7.1					
Minimum	6.3	8.0	7.6	7.0	7.0		7.0					
Maximum	7.3	8.3	7.8	7.4	7.4		7.1					
Std. Deviation	0.7	0.2	0.1	0.3	0.3		0.1					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	7.5	0.9	6.3	8.3	4							
CC-3, CC-4 (mid reach)	7.5	0.3	7.0	7.8	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	7.4	0.6	6.3	8.3	10							
All six stations	7.4	0.5	6.3	8.3	12							

STD - Standard deviation

## Appendix Table B-10 Continuing Surface Water Quality Monitoring Program Total Nitrogen (mg/L) January - December 2003

	Catfish Creek/Trunk Ditch										Stations	
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
March 6, 2003	1.57	1.59	0.78	1.38	1.24	1.31	1.32	1.31	0.30	0.78	1.59	6
September 12, 2003	1.38	0.99	0.95	1.08	1.06	1.09	1.68	1.19	0.28	0.95	1.68	6
Mean	1.48	1.29	0.87	1.23	1.15		1.50					
Minimum	1.38	0.99	0.78	1.08	1.06		1.32					
Maximum	1.57	1.59	0.95	1.38	1.24		1.68					
Std. Deviation	0.13	0.42	0.12	0.21	0.13		0.25					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	1.38	0.28	0.99	1.59	4							
CC-3, CC-4 (mid reach)	1.05	0.25	0.78	1.38	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	1.20	0.27	0.78	1.59	10							
All six stations	1.25	0.28	0.78	1.68	12							

STD - Standard deviation

### Appendix Table B-11 Continuing Surface Water Quality Monitoring Program Nitrite Nitrogen (mg/L) January - December 2003

			Catfish (		110	Alls	Stations					
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
March 6, 2003	0.08	0.02	< 0.01	0.01	0.02	0.03	< 0.01	0.02	0.02	< 0.01	0.08	6
September 12, 2003	0.04	< 0.01	< 0.01	0.02	0.01	0.02	0.02	0.02	0.01	< 0.01	0.04	6
Mean	0.06	0.01	< 0.01	0.02	0.02		0.01					
Minimum	0.04	< 0.01	< 0.01	0.01	0.01		< 0.01					
Maximum	0.08	0.02	< 0.01	0.02	0.02		0.02					
Std. Deviation	0.03	0.01	0.00	0.01	0.01		0.00					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	0.04	0.03	< 0.01	0.08	4							
CC-3, CC-4 (mid reach)	0.01	0.01	< 0.01	0.02	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	0.02	0.02	<0.01	0.08	10							
All six stations	0.02	0.02	< 0.01	0.08	12							

STD - Standard deviation

#### Appendix Table B-12 Continuing Surface Water Quality Monitoring Program Nitrate Nitrogen (mg/L) January - December 2003

	and Profession	anii Anii Anii Anii Anii Anii Anii Anii A	Catfish (		Alls	Stations						
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	in N
March 6, 2003	0.42	0.03	0.04	0.08	0.08	0.13	0.40	0.18	0.16	0.03	0.42	6
September 12, 2003	0.38	0.09	0.02	0.30	0.23	0.20	0.02	0.17	0.15	0.02	0.38	6
Mean	0.40	0.06	0.03	0.19	0.16		0.21					
Minimum	0.38	0.03	0.02	0.08	0.08		0.02					
Maximum	0.42	0.09	0.04	0.30	0.23		0.40					
Std. Deviation	0.03	0.04	0.01	0.16	0.11		0.27					
N	2	2	2	0	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	0.23	0.20	0.03	0.42	4							
CC-3, CC-4 (mid reach)	0.11	0.13	0.02	0.30	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	0.17	0.15	0.02	0.42	10							
All six stations	0.17	0.16	0.02	0.42	12							

STD - Standard deviation

### Appendix Table B-13 Continuing Surface Water Quality Monitoring Program Ammoniacal Nitrogen (mg/L) January - December 2003

· 建二甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基甲基			Catfish (		Alls	Stations						
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
March 6, 2003	0.02	0.01	0.01	0.01	0.02	0.01	0.01	0.01	0.01	0.01	0.02	6
September 12, 2003	0.02	0.01	0.01	0.01	0.01	0.01	0.04	0.02	0.01	0.01	0.04	6
Mean	0.02	0.01	0.01	0.01	0.02		0.03					
Minimum	0.02	0.01	0.01	0.01	0.01		0.01					
Maximum	0.02	0.01	0.01	0.01	0.02		0.04					
Std. Deviation	0.00	0.01	0.00	0.00	0.01		0.02					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	0.02	0.20	0.03	0.02	4							
CC-3, CC-4 (mid reach)	0.01	0.13	0.02	0.01	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	0.01	0.15	0.02	0.02	10							
All six stations	0.02	0.01	0.01	0.04	12							

STD - Standard deviation

### Appendix Table B-14 Continuing Surface Water Quality Monitoring Program Organic Nitrogen (mg/L) January - December 2003

			Albert.	All	Stations							
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
March 6, 2003	1.05	1.54	0.73	1.28	1.12	1.14	0.90	1.10	0.28	0.73	1.54	6
September 12, 2003	0.94	0.89	0.92	0.75	0.81	0.86	1.60	0.99	0.31	0.75	1.60	6
Mean	1.00	1.22	0.83	1.02	0.97		1.25					
Minimum	0.94	0.89	0.73	0.75	0.81		0.90					
Maximum	1.05	1.54	0.92	1.28	1.12		1.60					
Std. Deviation	0.08	0.46	0.13	0.37	0.22		0.49					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	1.11	0.30	0.89	1.54	4							
CC-3, CC-4 (mid reach)	0.92	0.25	0.73	1.28	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	1.00	0.25	0.73	1.54	10							
All six stations	1.04	0.29	0.73	1.60	12							

STD - Standard deviation

### Appendix Table B-15 Continuing Surface Water Quality Monitoring Program Total Phosphorus (mg/L) January - December 2003

			Sales (Sales Sales S Figure 1985 (Sales Sales S	AllS	Stations							
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	$\mathbf{N}^{-1}$
March 6, 2003	0.33	0.34	0.03	0.10	0.08	0.18	0.06	0.16	0.14	0.03	0.34	6
September 12, 2003	0.27	0.22	0.13	0.17	0.16	0.19	0.44	0.23	0.11	0.13	0.44	6
Mean	0.30	0.28	0.08	0.14	0.12		0.25					
Minimum	0.27	0.22	0.03	0.10	0.08		0.06					
Maximum	0.33	0.34	0.13	0.17	0.16		0.44					
Std. Deviation	0.04	0.08	0.07	0.05	0.06		0.27					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	0.29	0.06	0.22	0.34	4							
CC-3, CC-4 (mid reach)	0.11	0.06	0.03	0.17	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	0.18	0.11	0.03	0.34	10							
All six stations	0.19	0.13	0.03	0.44	12							

STD - Standard deviation

### Appendix Table B-16 Continuing Surface Water Quality Monitoring Program Orthophosphate (mg/L) January - December 2003

			Catfish (	ACTION OF THE PARTY OF THE PART	San Martinger	All	Stations	TANKA TANKA				
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
March 6, 2003	0.28	0.26	0.01	0.02	0.01	0.12	0.02	0.10	0.13	0.01	0.28	6
September 12, 2003	0.14	0.21	0.06	0.11	0.11	0.13	0.22	0.14	0.06	0.06	0.22	6
Mean	0.21	0.24	0.04	0.02	0.06		0.12					
Minimum	0.14	0.21	0.01	0.02	0.01		0.02					
Maximum	0.28	0.26	0.06	0.11	0.11		0.22					
Std. Deviation	0.10	0.04	0.04	0.06	0.07		0.14					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	0.22	0.06	0.14	0.28	4							
CC-3, CC-4 (mid reach)	0.05	0.05	0.01	0.11	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	0.12	0.10	0.01	0.28	10							
All six stations	0.12	0.10	0.01	0.28	12							

STD - Standard deviation

Appendix Table B-17
Continuing Surface Water Quality Monitoring Program
Total Nitrogen to Total Phosphorus Ratios
January - December 2003

			All	Stations								
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
March 6, 2003	4.76	4.68	26.00	13.80	15.50	12.95	22.00	14.46	8.73	4.68	26.00	6
September 12, 2003	5.11	4.50	7.31	6.35	6.63	5.98	3.82	5.62	1.35	3.82	7.31	6
Mean	4.93	4.59	16.65	10.08	11.06		12.91					
Minimum	4.76	4.50	7.31	6.35	6.63		3.82					
Maximum	5.11	4.68	26.00	13.80	15.50		22.00					
Std. Deviation	0.25	0.12	13.22	5.27	6.28		12.86					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	4.76	0.26	4.50	5.11	4							
CC-3, CC-4 (mid reach)	13.37	9.05	6.35	26.00	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	9.46	6.99	4.50	26.00	10							
All six stations	10.04	7.54	3.82	26.00	12							

STD - Standard deviation

Appendix Table B-18
Continuing Surface Water Quality Monitoring Program
Inorganic Nitrogen to Inorganic Phosphorus Ratios
January - December 2003

			All	Stations	Principal de la companya de la comp De la companya de la							
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
March 6, 2003	1.86	0.23	5.50	5.00	12.00	4.92	20.75	7.56	7.63	0.23	20.75	6
September 12, 2003	3.14	0.50	0.58	3.00	2.27	1.90	0.36	1.64	1.31	0.36	3.14	6
Mean	2.50	0.37	3.04	4.00	7.14		10.56					
Minimum	1.86	0.23	0.58	3.00	2.27		0.36					
Maximum	3.14	0.50	5.50	5.00	12.00		20.75					
Std. Deviation	0.91	0.19	3.48	1.41	6.88		14.42					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	1.43	1.34	0.23	3.14	4							
CC-3, CC-4 (mid reach)	3.52	2.24	0.58	5.50	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	3.41	3.51	0.23	12.00	10							
All six stations	4.60	6.06	0.23	20.75	12							

STD - Standard deviation

### Appendix Table B-19 Continuing Surface Water Quality Monitoring Program Oil and Grease (mg/L) January - December 2003

			Catfish (	Creek/Trun	k Ditch					All	Stations	
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
March 6, 2003	2.2	2.0	1.8	2.3	3.4	2.3	3.5	2.5	0.7	1.8	3.5	6
September 12, 2003	2.1	3.3	<1.4	1.7	3.1	2.2	2.6	2.3	1.0	<1.4	3.3	6
Mean	2.2	2.7	1.3	2.0	3.3		3.1					
Minimum	2.1	2.0	0.7	1.7	3.1		2.6					
Maximum	2.2	3.3	1.8	2.3	3.4		3.5					
Std. Deviation	0.0	0.9	0.8	0.4	0.2		0.6					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	2.4	0.6	2.0	3.3	4							
CC-3, CC-4 (mid reach)	1.6	0.7	<1.4	2.3	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	2.3	0.8	<1.4	3.4	10							
All six stations	2.4	0.8	<1.4	3.5	12.0							

STD - Standard deviation

### Appendix Table B-20 Continuing Surface Water Quality Monitoring Program Total Coliform Bacteria (colonies/100 mL) January - December 2003

		All	Stations								
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean NC-6	Mean	STD	Min	Max	$N_{\rm eff}$
March 6, 2003	630	810	170	150	120	376 320	367	288	120	810	6
September 12, 2003	15,800	5,300	1,600	>20,000	>20,000	12,540 >20,00	0 13,783	8,251	1,600	>20,000	6
Mean	8,215	3,055	885	10,075	10,060	10,160	)				
Minimum	630	810	170	150	120	320					
Maximum	15,800	5,300	1,600	>20,000	>20,000	>20,00	0				
Std. Deviation	10,727	3,175	1,011	14,036	14,057	13,910	)				
N	2	2	2	2	2	2					
Stations	Mean	STD	Min	Max	N						
CC-1, CC-2 (upper reach)	5,635	7,113	630	15,800	4						
CC-3, CC-4 (mid reach)	5,480	9,704	150	>20,000	4						
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	6,458	8,592	120	>20,000	10						
All six stations	7,075	8,949	120	>20,000	12						

STD - Standard deviation

### Appendix Table B-21 Continuing Surface Water Quality Monitoring Program Fecal Coliform Bacteria (colonies/100 mL) January - December 2003

			Catfish	Creek/Trun	k Ditch					All	Stations	
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
March 6, 2003	510	690	80	30	<10	263	280	266	282	<10	690	6
September 12, 2003	8,300	900	1,380	>20,000	>20,000	10,116	19,100	11,613	9,243	900	>20,000	6
Mean	4,405	795	730	10,015	10,003		9,690					
Minimum	510	690	80	30	<10		280					
Maximum	8,300	900	1,380	>20,000	>20,000		19,100					
Std. Deviation	5,508	148	919	14,121	14,139		13,308					
N	2	2	2	2	2		2					
Stations	Mean	STD	Min	Max	N							
CC-1, CC-2 (upper reach)	2,600	3,803	510	8,300	4							
CC-3, CC-4 (mid reach)	5,373	9,772	30	>20,000	4							
CC-1, CC-2, CC-3, CC-4, CC-5 (entire basin)	5,190	8,186	<10	>20,000	10							
All six stations	5,940	8,602	<10	>20,000	12							

STD - Standard deviation

### Appendix Table B-22 Continuing Surface Water Quality Monitoring Program Trace Metals ( $\mu g/L$ ) January - December 2003

						All	Stations	EEP I				
Sampling Date	CC-1	CC-2	CC-3	CC-4	CC-5	Mean	NC-6	Mean	STD	Min	Max	N
Arsenic	1.9	3.7	2.6	3.6	4.6	3.3	3.6	3.3	0.9	1.9	4.6	6
Copper	1.5	<1.0	129.0	2.6	37.1	34.1	1.6	28.7	51.1	<1.0	129.0	6
Lead	1.7	<1.0	<1.0	<1.0	1.4	0.9	1.0	0.9	0.5	<1.0	1.7	6
Zinc	10.6	<8.0	<8.0	<8.0	<8.0	5.3	<8.0	5.1	2.7	<8.0	10.6	6

Applicable surface water criteria: Maximum allowable concentrations of 50  $\mu$ g/L for arsenic, 12.8  $\mu$ g/L for copper, 3.6  $\mu$ g/L for lead and 115  $\mu$ g/L for zinc.

STD - Standard deviation

#### Appendix C

South Creek Water Quality Data

#### Appendix Table C-1 Continuing Surface Water Quality Monitoring Program

#### Stream Stage (ft)<sup>a</sup>

#### January - December 2003

	Allen Child	South	Creek			All Stations						
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N		
January 22, 2003	0.8	0.8	0.9	1.0		0.9	0.1	0.8	1.0	4		
April 1, 2003	1.0	1.0	1.1	1.5		1.2	0.2	1.0	1.5	4		
July 28, 2003	1.2	1.5	0.4	1.9		1.3	0.6	0.4	1.9	4		
October 2, 2003	1.3	1.0	0.2	1.4		1.0	0.5	0.2	1.4	4		
Mean	1.1	1.1	0.7	1.5								
Minimum	0.8	0.8	0.2	1.0								
Maximum	1.3	1.5	1.1	1.9								
Std. Deviation	0.2	0.3	0.4	0.4								
N	4	4	4	4								
Stations	Mean	Min	Max	STD	N							
SC-4, SC-3	1.1	0.2	1.9	0.6	8							
SC-1, SC-2	1.1	0.8	1.5	0.2	8							
SC-4, SC-1, SC-2, SC-3 (entire basin)	1.1	0.2	1.9	0.4	16							

a Stream Stage measured at sampling site for each station. 0.0 = Station dry.

STD - Standard deviation

N - Number of observations

## Appendix Table C-2 Continuing Surface Water Quality Monitoring Program Stream Flow (gpm) January - December 2003

The Thirty Control of the Control of	FREEZE TOTAL	South	Creek		187	All Stations						
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N		
January 22, 2003	1,270.1	1,445.1	0.0	0.0		678.8	787.1	0.0	1,445.1	4		
April 1, 2003	852.7	987.4	0.0	0.0		460.0	534.0	0.0	987.4	4		
July 28, 2003	1,651.6	2,127.3	0.0	0.0		944.7	1,108.0	0.0	2,127.3	4		
October 2, 2003	5,071.4	5,834.4	0.0	0.0		2,726.5	3,163.6	0.0	5,834.4	4		
Mean	2,211.5	2,598.6	0.0	0.0								
Minimum	852.7	987.4	0.0	0.0								
Maximum	5,071.4	5,834.4	0.0	0.0								
Std. Deviation	1,934.4	2,207.5	0.0	0.0								
N	4	4	4	4								
Stations	Mean	Min	Max	STD	N							
SC-4, SC-3	0.0	0.0	0.0	0.0	8							
SC-1, SC-2	2405.0	852.7	5834.4	1932.6	8							
SC-4, SC-1, SC-2, SC-3 (entire basin)	1202.5	0.0	5834.4	1812.6	16							

STD - Standard deviation

N - Number of observations

No Data (Dry)

## Appendix Table C-3 Continuing Surface Water Quality Monitoring Program Water Temperature (°C) January - December 2003

The second of th		South	Creek	Distriction of the second seco		All Stations					
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N	
January 22, 2003	17.5	17.6	12.5	16.3		16.0	2.4	12.5	17.6	4	
April 1, 2003	15.9	16.3	14.7	17.4		16.1	1.1	14.7	17.4	4	
July 28, 2003	28.7	28.5	28.9	29.8		29.0	0.6	28.5	29.8	4	
October 2, 2003	25.3	25.3	24.3	25.8		25.2	0.6	24.3	25.8	4	
Mean	21.9	21.9	20.1	22.3							
Minimum	15.9	16.3	12.5	16.3							
Maximum	28.7	28.5	28.9	29.8							
Std. Deviation	6.1	5.9	7.8	6.5							
N	4	4	4	4							
Stations	Mean	Min	Max	STD	N						
SC-4, SC-3	21.2	12.5	29.8	6.8	8						
SC-1, SC-2	21.9	15.9	28.7	5.6	8						
SC-4, SC-1, SC-2, SC-3 (entire basin)	21.6	12.5	29.8	6.0	16						

STD - Standard deviation

N - Number of observations

No Data (Dry)

### Appendix Table C-4 Continuing Surface Water Quality Monitoring Program Specific Conductance (µmhos/cm) January - December 2003

77 (24) 77 (25) (10) (15) (15) (15) (15) (15) (15) (15) (15		South	Creek		All Stations						
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N	
January 22, 2003	647	783	278	432		535	224	278	783	4	
April 1, 2003	804	872	435	794		726	197	435	872	4	
July 28, 2003	668	491	535	628		581	82	491	668	4	
October 2, 2003	519	509	511	483		506	16	483	519	4	
Mean	660	664	440	584							
Minimum	519	491	278	432							
Maximum	804	872	535	794							
Std. Deviation	117	193	116	163							
N	4	4	4	4							
Stations	Mean	Min	Max	STD	N						
SC-4, SC-3	512	278	794	152	8						
SC-1, SC-2	662	491	872	147	8						
SC-4, SC-1, SC-2, SC-3 (entire basin)	587	278	872	164	16						

STD - Standard deviation

N - Number of observations

No Data (Dry)

# Appendix Table C-5 Continuing Surface Water Quality Monitoring Program Total Suspended Solids (mg/L) January - December 2003

		South	Creek	DIA SANGGAR				All Stations	Maria Calendaria	Wang.
Sampling Date	SC-1	SC-2	SC-3	SC-4	Military Mari	Mean	STD	Min	Max	N
January 22, 2003	1.4	2.6	31.5	6.4		10.5	14.2	1.4	31.5	4
April 1, 2003	1.8	1.8	6.4	4.4		3.6	2.2	1.8	6.4	4
July 28, 2003	6.4	3.6	49.4	10.6		17.5	21.5	3.6	49.4	4
October 2, 2003	4.8	3.8	292.0	14.8		78.9	142.2	3.8	292.0	4
Mean	3.6	3.0	94.8	9.1						
Minimum	1.4	1.8	6.4	4.4						
Maximum	6.4	3.8	292.0	14.8						
Std. Deviation	2.4	0.9	132.6	4.6						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	51.9	4.4	292.0	98.2	8					
SC-1, SC-2	3.3	1.4	6.4	1.7	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	27.6	1.4	292.0	71.7	16					

STD - Standard deviation

N - Number of observations

# Appendix Table C-6 Continuing Surface Water Quality Monitoring Program Turbidity (NTU) January - December 2003

		South	Creek		117	Ang Maria		All Stations		The state of
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N
January 22, 2003	2.3	2.6	170.0	15.1		47.5	81.9	2.3	170.0	4
April 1, 2003	1.2	1.4	7.1	4.3		3.5	2.8	1.2	7.1	4
July 28, 2003	2.8	2.3	28.0	12.1		11.3	12.0	2.3	28.0	4
October 2, 2003	3.5	4.8	820.0	36.0		216.1	402.9	3.5	820.0	4
Mean	2.5	2.8	256.3	16.9						
Minimum	1.2	1.4	7.1	4.3						
Maximum	3.5	4.8	820.0	36.0						
Std. Deviation	1.0	1.4	382.7	13.5						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	136.6	4.3	820.0	281.5	8					
SC-1, SC-2	2.6	1.2	4.8	1.2	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	69.6	1.2	820.0	204.4	16					

STD - Standard deviation N - Number of observations

# Appendix Table C-7 Continuing Surface Water Quality Monitoring Program 5-Day Biochemical Oxygen Demand (mg/L) January - December 2003

		South	Creek		HSPSSELL SECTION			All Stations		ing Kan
Sampling Date	SC-1	SC-2	SC-3	SC-4	Pedia	Mean	STD	Min	Max	N
January 22, 2003	<2.0	<2.0	2.3	<2.0		1.3	0.7	<2.0	2.3	4
April 1, 2003	<2.0	< 2.0	<2.0	< 2.0		1.0	0.0	< 2.0	< 2.0	4
July 28, 2003	<2.0	< 2.0	<2.0	2.7		1.4	0.9	< 2.0	2.7	4
October 2, 2003	<3.3	<3.3	11.0	5.2		4.9	4.4	<3.3	11.0	4
7										
Mean	1.2	1.2	3.8	2.5						
Minimum	< 2.0	< 2.0	< 2.0	< 2.0						
Maximum	<3.3	<3.3	11.0	5.2						
Std. Deviation	0.3	0.3	4.8	2.0						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	3.2	<2.0	11.0	3.5	8					
SC-1, SC-2	1.2	< 2.0	<3.3	0.3	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	2.2	<2.0	11.0	2.6	16					

# Appendix Table C-8 Continuing Surface Water Quality Monitoring Program Dissolved Oxygen (mg/L) January - December 2003

		South	Creek				reresisente	All Stations	CAR #25 Carpapanana	#0000 #100
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N
January 22, 2003	9.7	9.8	6.4	8.8		8.7	1.6	6.4	9.8	4
April 1, 2003	7.3	7.5	2.1	10.5		6.9	3.5	2.1	10.5	4
July 28, 2003	1.2	2.8	2.7	11.8		4.6	4.8	1.2	11.8	4
October 2, 2003	1.5	2.6	1.7	7.3		3.3	2.7	1.5	7.3	4
Mean	4.9	5.7	3.2	9.6						
Minimum	1.2	2.6	1.7	7.3						
Maximum	9.7	9.8	6.4	11.8						
Std. Deviation	4.2	3.6	2.2	2.0						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	6.4	1.7	11.8	3.9	8					
SC-1, SC-2	5.3	1.2	9.8	3.6	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	5.9	1.2	11.8	3.7	16					

STD - Standard deviation

N - Number of observations

# Appendix Table C-9 Continuing Surface Water Quality Monitoring Program Water pH (-Log[H+]) January - December 2003

		South	Creek				Sayarda Sayarda	All Stations	Stalling and	
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N
January 22, 2003	7.5	7.5	7.0	8.0		7.5	0.4	7.0	8.0	4
April 1, 2003	7.1	6.7	7.2	7.4		7.1	0.3	6.7	7.4	4
July 28, 2003	7.2	7.3	7.2	7.7		7.4	0.2	7.2	7.7	4
October 2, 2003	6.3	6.4	6.9	7.1		6.7	0.4	6.3	7.1	4
Mean	7.0	7.0	7.1	7.6						
Minimum	6.3	6.4	6.9	7.1						
Maximum	7.5	7.5	7.2	8.0						
Std. Deviation	0.5	0.5	0.2	0.4						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	7.3	6.9	8.0	0.4	8					
SC-1, SC-2	7.0	6.3	7.5	0.5	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	7.2	6.3	8.0	0.4	16					

# Appendix Table C-10 Continuing Surface Water Quality Monitoring Program Total Nitrogen (mg/L) January - December 2003

		South	Creek					All Stations		" man
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N
January 22, 2003	1.03	1.04	1.38	1.07		1.13	0.17	1.03	1.38	4
April 1, 2003	0.89	0.89	1.06	0.76		0.90	0.12	0.76	1.06	4
July 28, 2003	1.31	1.37	3.20	1.14		1.76	0.97	1.14	3.20	4
October 2, 2003	0.99	1.09	2.41	0.71		1.30	0.76	0.71	2.41	4
Mean	1.06	1.10	2.01	0.92						
Minimum	0.89	0.89	1.06	0.71						
Maximum	1.31	1.37	3.20	1.14						
Std. Deviation	0.18	0.20	0.98	0.22						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	1.47	0.71	3.20	0.88	8					
SC-1, SC-2	1.08	0.89	1.37	0.18	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	1.27	0.71	3.20	0.64	16					

# Appendix Table C-10 Continuing Surface Water Quality Monitoring Program Total Nitrogen (mg/L) January - December 2003

		South	Creek		100			All Stations		
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N
January 22, 2003	1.03	1.04	1.38	1.07		1.13	0.17	1.03	1.38	4
April 1, 2003	0.89	0.89	1.06	0.76		0.90	0.12	0.76	1.06	4
July 28, 2003	1.31	1.37	3.20	1.14		1.76	0.97	1.14	3.20	4
October 2, 2003	0.99	1.09	2.41	0.71		1.30	0.76	0.71	2.41	4
Mean	1.06	1.10	2.01	0.92						
Minimum	0.89	0.89	1.06	0.71						
Maximum	1.31	1.37	3.20	1.14						
Std. Deviation	0.18	0.20	0.98	0.22						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	1.47	0.71	3.20	0.88	8					
SC-1, SC-2	1.08	0.89	1.37	0.18	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	1.27	0.71	3.20	0.64	16					

# Appendix Table C-11 Continuing Surface Water Quality Monitoring Program Nitrite Nitrogen (mg/L) January - December 2003

THE STATE OF THE S		South	Creek			was Williams		All Station	S	
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N
January 22, 2003	0.01	0.01	< 0.01	< 0.01		0.01	0.00	< 0.01	0.01	4
April 1, 2003	< 0.01	< 0.01	< 0.01	< 0.01		0.01	0.00	< 0.01	< 0.01	4
July 28, 2003	0.01	0.01	0.02	< 0.01		0.01	0.01	< 0.01	0.02	4
October 2, 2003	0.01	< 0.01	< 0.01	< 0.01	0036		0.00	< 0.01	0.01	4
		. 0015	0015	0 015	0145	Dicon	·5\.			
Mean	0.01	0.01	0.01	0.01	1 24					
Minimum	< 0.01	< 0.01	< 0.01	< 0.01						
Maximum	0.01	0.01	0.02	< 0.01						
Std. Deviation	0.00	0.00	0.01	0.00						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	0.01	< 0.01	0.02	0.01	8					
SC-1, SC-2	0.01	< 0.01	0.01	0.00	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	0.01	< 0.01	0.02	0.00	16					

STD - Standard deviation N - Number of observations

### Appendix Table C-12 Continuing Surface Water Quality Monitoring Program Nitrate Nitrogen (mg/L) January - December 2003

1.5 Poly 1.5		South	Creek				There is a	All Stations	of the Charles of the Charles	
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N
January 22, 2003	0.16	0.15	< 0.01	0.01		0.08	0.09	< 0.01	0.16	4
April 1, 2003	0.01	0.01	< 0.01	< 0.01		0.01	0.00	< 0.01	0.01	4
July 28, 2003	0.05	0.04	0.40	< 0.01		0.12	0.19	< 0.01	0.40	4
October 2, 2003	0.16	0.14	< 0.01	< 0.01		0.08	0.08	< 0.01	0.16	4
Mean	0.10	0.09	0.10	0.01						
Minimum	0.01	0.01	< 0.01	< 0.01						
Maximum	0.16	0.15	0.40	0.01						
Std. Deviation	0.08	0.07	0.20	0.00						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	0.06	< 0.01	0.40	0.14	8					
SC-1, SC-2	0.09	0.01	0.16	0.07	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	0.07	<0.01	0.40	0.11	16					

# Appendix Table C-13 Continuing Surface Water Quality Monitoring Program Ammoniacal Nitrogen (mg/L) January - December 2003

	Notes and the second se	South	Creek					All Stations	Hard Comments of the Comments	
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N
January 22, 2003	0.04	0.06	< 0.01	< 0.01		0.03	0.03	<0.01	0.06	4
April 1, 2003	0.03	0.03	0.30	0.21		0.14	0.14	0.03	0.30	4
July 28, 2003	< 0.01	< 0.01	0.10	0.06		0.04	0.05	< 0.01	0.10	4
October 2, 2003	0.01	0.01	0.24	0.02		0.07	0.11	0.01	0.24	4
Mean	0.02	0.03	0.16	0.07						
Minimum	< 0.01	< 0.01	< 0.01	< 0.01						
Maximum	0.04	0.06	0.30	0.21						
Std. Deviation	0.02	0.02	0.13	0.09						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	0.12	< 0.01	0.30	0.12	8					
SC-1, SC-2	0.02	< 0.01	0.06	0.02	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	0.07	<0.01	0.30	0.09	16					

STD - Standard deviation
N - Number of observations

# Appendix Table C-14 Continuing Surface Water Quality Monitoring Program Organic Nitrogen (mg/L) January - December 2003

		South	Creek	To the second se		and the say		All Stations	Salara Suga	Petra Salah Salah
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N
January 22, 2003	0.83	0.82	1.38	1.05		1.02	0.26	0.82	1.38	4
April 1, 2003	0.68	0.71	0.76	0.55		0.68	0.09	0.55	0.76	4
July 28, 2003	1.25	1.32	2.69	1.07		1.58	0.75	1.07	2.69	4
October 2, 2003	0.81	0.94	2.17	0.69		1.15	0.69	0.69	2.17	4
Mean	0.89	0.95	1.75	0.84						
Minimum	0.68	0.71	0.76	0.55						
Maximum	1.25	1.32	2.69	1.07						
Std. Deviation	0.25	0.27	0.85	0.26						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	1.30	0.55	2.69	0.76	8					
SC-1, SC-2	0.92	0.68	1.32	0.24	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	1.11	0.55	2.69	0.58	16					

STD - Standard deviation

N - Number of observations

# Appendix Table C-14 Continuing Surface Water Quality Monitoring Program Organic Nitrogen (mg/L) January - December 2003

		South	Creek		Huj ji	ur Makeu		All Stations	S kan jilla kan i	
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	Ν
January 22, 2003	0.83	0.82	1.38	1.05		1.02	0.26	0.82	1.38	4
April 1, 2003	0.68	0.71	0.76	0.55		0.68	0.09	0.55	0.76	4
July 28, 2003	1.25	1.32	2.69	1.07		1.58	0.75	1.07	2.69	4
October 2, 2003	0.81	0.94	2.17	0.69		1.15	0.69	0.69	2.17	4
Mean	0.89	0.95	1.75	0.84						
Minimum	0.68	0.71	0.76	0.55						
Maximum	1.25	1.32	2.69	1.07						
Std. Deviation	0.25	0.27	0.85	0.26						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	1.30	0.55	2.69	0.76	8					
SC-1, SC-2	0.92	0.68	1.32	0.24	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	1.11	0.55	2.69	0.58	16					

# Appendix Table C-14 Continuing Surface Water Quality Monitoring Program Organic Nitrogen (mg/L) January - December 2003

		South	Creek					All Station	Such Branch	
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N
January 22, 2003	0.83	0.82	1.38	1.05		1.02	0.26	0.82	1.38	4
April 1, 2003	0.68	0.71	0.76	0.55		0.68	0.09	0.55	0.76	4
July 28, 2003	1.25	1.32	2.69	1.07		1.58	0.75	1.07	2.69	4
October 2, 2003	0.81	0.94	2.17	0.69		1.15	0.69	0.69	2.17	4
Mean	0.89	0.95	1.75	0.84						
Minimum	0.68	0.71	0.76	0.55						
Maximum	1.25	1.32	2.69	1.07						
Std. Deviation	0.25	0.27	0.85	0.26						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	1.30	0.55	2.69	0.76	8					
SC-1, SC-2	0.92	0.68	1.32	0.24	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	1.11	0.55	2.69	0.58	16					

# Appendix Table C-15 Continuing Surface Water Quality Monitoring Program Total Phosphorus (mg/L) January - December 2003

		South	Creek				27000	All Station	S	Andreas
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N
January 22, 2003	0.08	0.08	1.94	0.23		0.58	0.91	0.08	1.94	4
April 1, 2003	0.06	0.06	0.12	0.03		0.07	0.04	0.03	0.12	4
July 28, 2003	0.18	0.17	0.87	0.10		0.33	0.36	0.10	0.87	4
October 2, 2003	0.21	0.18	1.00	0.21		0.40	0.40	0.18	1.00	4
Mean	0.13	0.12	0.98	0.14						
Minimum	0.06	0.06	0.12	0.03						
Maximum	0.21	0.18	1.94	0.23						
Std. Deviation	0.07	0.06	0.75	0.09						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	0.56	0.03	1.94	0.67	8					
SC-1, SC-2	0.13	0.06	0.21	0.06	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	0.35	0.03	1.94	0.51	16					

STD - Standard deviation

N - Number of observations

# Appendix Table C-16 Continuing Surface Water Quality Monitoring Program Orthophosphate (mg/L) January - December 2003

		South	Creek	POLICE CONTROL OF THE PROPERTY	NAME OF STREET	ng Pang		All Station	S	Geller Topic 200
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N
January 22, 2003	0.08	0.08	1.62	0.18		0.49	0.75	0.08	1.62	4
April 1, 2003	0.06	0.06	0.07	0.02		0.05	0.02	0.02	0.07	4
July 28, 2003	0.15	0.14	0.03	0.04		0.09	0.06	0.03	0.15	4
October 2, 2003	0.15	0.14	0.42	0.03		0.19	0.17	0.03	0.42	4
Mean	0.11	0.11	0.54	0.07						
Minimum	0.06	0.06	0.03	0.02						
Maximum	0.15	0.14	1.62	0.18						
Std. Deviation	0.05	0.04	0.74	0.08						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N			detection	limit	0,01
SC-4, SC-3	0.30	0.02	1.62	0.55	8					
SC-1, SC-2	0.11	0.06	0.15	0.04	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	0.20	0.02	1.62	0.39	16					

Appendix Table C-17
Continuing Surface Water Quality Monitoring Program
Total Nitrogen to Total Phosphorus Ratios (Nt:Pt)
January - December 2003

		South	Creek	11 Jan -	Name of the last o			All Station	S	Haria.
Sampling Date	SC-1	SC-2	SC-3	SC-4	and P	Mean	STD	Min	Max	Ν
January 22, 2003	12.88	13.00	0.71	4.65		7.81	6.14	0.71	13.00	4
April 1, 2003	14.83	12.33	8.83	25.33		15.33	7.11	8.83	25.33	4
July 28, 2003	7.28	8.06	3.68	11.40		7.60	3.17	3.68	11.40	4
October 2, 2003	4.71	6.06	2.41	3.38		4.14	1.59	2.41	6.06	4
Mean	9.93	9.86	3.91	11.19						
Minimum	4.71	6.06	0.71	3.38						
Maximum	14.83	13.00	8.83	25.33						
Std. Deviation	4.72	3.35	3.50	10.06						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	7.55	0.71	25.33	7.99	8					
SC-1, SC-2	9.89	4.71	14.83	3.79	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	8.72	0.71	25.33	6.16	16					

STD - Standard deviation N - Number of observations

Appendix Table C-18
Continuing Surface Water Quality Monitoring Program
Inorganic Nitrogen to Inorganic Phosphorus Ratios (Ni:Pi)
January - December 2003

		South	Creek		501000 50100	All Stations					
Sampling Date	SC-1	SC-2	SC-3	SC-4	1000	Mean	STD	Min	Max	N	
January 22, 2003	2.63	2.75	0.01	0.11	3.0.50	1.37	1.52	0.01	2.75	4	
April 1, 2003	0.75	0.75	4.43	11.00		4.23	4.83	0.75	11.00	4	
July 28, 2003	0.43	0.39	17.33	1.75		4.98	8.26	0.39	17.33	4	
October 2, 2003	1.20	1.11	0.60	1.00		0.98	0.27	0.60	1.20	4	
Mean	1.25	1.25	5.59	3.47							
Minimum	0.43	0.39	0.01	0.11							
Maximum	2.63	2.75	17.33	11.00							
Std. Deviation	0.97	1.04	8.07	5.07							
N	4	4	4	4							
Stations	Mean	Min	Max	STD	N						
SC-4, SC-3	4.53	0.01	17.33	6.34	8						
SC-1, SC-2	1.25	0.39	2.75	0.93	8						
SC-4, SC-1, SC-2, SC-3 (entire basin)	2.89	0.01	17.33	4.69	16						

STD - Standard deviation N - Number of observations

### Appendix Table C-19 Continuing Surface Water Quality Monitoring Program Oils and Grease (mg/L) January - December 2003

		South	Creek					All Station		9.55 19.55
Sampling Date	SC-1	SC-2	SC-3	SC-4	Armeni Armeni	Mean	STD	Min	Max	N
January 22, 2003	3.88	3.64	3.92	3.12		3.64	0.37	3.12	3.92	4
April 1, 2003	<1.4	4.80	2.10	2.30	_	2.48	1.71	<1.4	4.80	4
July 28, 2003	<1.4	<1.4	<1.4	<1.4		0.70	0.00	<1.4	<1.4	4
October 2, 2003	3.90	1.60	2.80	<1.0	$\lambda$	2.20	1.47	<1.0	3.90	4
Mean	2.3	2.7	2.4	1.7		a fras	7			
Minimum	<1.4	<1.4	<1.4	<1.0	7	9 4				
Maximum	3.9	4.8	3.9	3.1						
Std. Deviation	1.8	1.9	1.3	1.3						
N	4	4	3	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	2.0	<1.0	3.9	1.3	8					
SC-1, SC-2	2.5	<1.4	4.8	1.7	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	2.3	<1.0	4.8	1.5	16					

STD - Standard deviation

Applicable surface water criteria: Maximum allowable concentration of 5mg/L

N - Number of observations

No Data (Dry)

### Appendix Table C-20 Continuing Surface Water Quality Monitoring Program Total Coliform Bacteria (counts/100 mL) January - December 2003

1000 Table 1000 1000 MB 100 Table 1000 1000 MB 1000 Table 1000 Tab		South	Creek	Service (See )	F 10			All Station	S	11/16
Sampling Date	SC-1	SC-2	SC-3	SC-4		Mean	STD	Min	Max	N
January 22, 2003	220	180	730	110		310	284	110	730	4
April 1, 2003	110	170	420	100		200	150	100	420	4
July 28, 2003	610	380	880	110	*	495	328	110	880	4
October 2, 2003	2,100	1,900	2,700	1,300		2,000	577	1,300	2,700	4
Mean	760	658	1,183	405						
Minimum	110	170	420	100						
Maximum	2,100	1,900	2,700	1,300						
Std. Deviation	919	834	1,030	597						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	794	100	2,700	883	8					
SC-1, SC-2	709	110	2,100	814	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	751	100	2,700	822	16					

Applicable surface water criteria: Maximum allowable count of 2,400/100ml

STD - Standard deviation

N - Number of observations

### Appendix Table C-21 Continuing Surface Water Quality Monitoring Program Fecal Coliform Bacteria (count/100 mL) January - December 2003

	Francisco III	South	Creek		100			All Stations		
Sampling Date	SC-1	SC-2	SC-3	SC-4	in inte	Mean	STD	Min	Max	N
January 22, 2003	100	90	540	40		193	233	40	540	4
April 1, 2003	20	60	70	30		45	24	20	70	4
July 28, 2003	430	200	520	50		300	214	50	520	4
October 2, 2003	300	100	1,100	400		475	435	100	1,100	4
Mean	213	113	558	130						
Minimum	20	60	70	30						
Maximum	430	200	1,100	400						
Std. Deviation	187	61	422	180						
N	4	4	4	4						
Stations	Mean	Min	Max	STD	N					
SC-4, SC-3	344	30	1,100	377	8					
SC-1, SC-2	163	20	430	139	8					
SC-4, SC-1, SC-2, SC-3 (entire basin)	253	20	1,100	290	16					

Applicable surface water criteria: Maximum allowable count of 800/100ml

STD - Standard deviation

N - Number of observations

### $Appendix\ Table\ C-22$ Continuing Surface Water Quality Monitoring Program $Trace\ Metals\ (\mu g/L)$ $January\ -\ December\ 2003$

	South Creek					All Stations						
Sampling Date	SC-1	SC-2	SC-3	SC-4	Mean	STD	Min	Max	N			
Arsenic	1.7	<1.0	6.4	<1.0	2.3	2.8	<1.0	6.4	4			
Copper	1.6	1.9	<1.0	<1.0	1.1	0.7	<1.0	1.9	4			
Lead	<1.0	<1.0	<1.0	<1.0	0.5	0.0	<1.0	<1.0	4			
Zinc	946	<8	<8	8	241	470	<8	946	4			

Applicable surface water criteria: Maximum allowable concentrations of 50  $\mu$ g/L for arsenic, 12.8  $\mu$ g/L for copper, '3.6  $\mu$ g/L for lead, and 115.

STD - Standard deviation N - Number of observations

Why other dates lumped? unlike others prior

### Appendix D

Quarterly Data Tables

Table D-1. Summary of Water Quality Data Collected in the South Creek Basin of Palmer Ranch on January 22, 2003, Sarasota County, Florida

Parameters		Stat	ions		Water Quality	
	SC-1	SC-2	SC-3	SC-4	Standards	
Time	15:20	14:50	14:30	15:50		
Stream flow (cfs)	2.83	3.22	0	0		
Water depth (feet)	0.8	0.8	0.9	1.0		
Temperature (°C)	17.5	17.6	12.5	16.3		
pH (-log[H <sup>+</sup> ])	7.5	7.5	7.0	8.0	6.0 - 8.5	
Dissolved oxygen (mg/L)	9.7	9.8	6.4	8.8	≥5.0	
Specific conductivity (µmhos/cm)	647	783	278	432	≤1275	
Total coliform bacteria (No./100 mL)	220	180	730	110	≤2,400	
Fecal coliform bacteria (No./100 mL)	100	90	540	40	≤800	
Nitrite nitrogen (mg/L)	0.01	0.01	< 0.01	< 0.01		
Nitrate nitrogen (mg/L)	0.16	0.15	< 0.01	0.01		
Ammonia nitrogen (mg/L)	0.04	0.06	< 0.01	< 0.01		
Total Kjeldahl nitrogen (mg/L)	0.87	0.88	1.38	1.05		
Organic nitrogen (mg/L)	0.83	0.82	1.38	1.05		
Total nitrogen (mg/L)	1.03	1.04	1.38	1.07		
Orthophosphate (mg/L)	0.08	0.08	1.62	0.18		
Total phosphorus (mg/L)	0.08	0.08	1.94	0.23		
Total suspended solids (mg/L)	1.4	2.6	31.5	6.4		
Turbidity (NTU)	2.3	2.6	170*	15.1	≤29 NTU Increas	
Oil and grease (mg/L)	3.88	3.64	3.92	3.12	≤5	
Biochemical oxygen demand (mg/L)	<2.0	< 2.0	2.3	< 2.0		

<sup>\*</sup>Non-compliance with water quality standards specified by FAC 62-302 and Sarasota County Ordinance 72-37, as amended for Class III fresh waters.

Table D-2. Summary of Water Quality Data Collected in the Catfish and North Creek Basin of Palmer Ranch on March 6, 2003, Sarasota County, Florida

Parameters	resident de la companya de la compa	Stat	ions		Water Quality	
	CC-1	CC-2	CC-3	CC-4	Standards	
Time	1145	1215	1120	1130		
Stream flow (cfs)	0.3	< 0.1	0.0	0.0		
Water depth (feet)	2.9	0.2	1.3	2.4		
Temperature (°C)	24.5	36.2	26.9	25.8	an at at an	
pH (-log[H <sup>+</sup> ]	7.3	8.3	7.8	7.4	6.0 - 8.5	
Dissolved oxygen (mg/L)	6.1	11.1	9.8	8.9	≥5.0	
Specific conductivity (µmhos/cm)	639	1090	885	983	≤1275	
Total coliform bacteria (No./100 mL)	630	810	170	150	≤2,400	
Fecal coliform bacteria (No./100 mL)	510	690	80	30	≤800	
Nitrite nitrogen (mg/L)	0.08	0.02	< 0.01	0.01		
Nitrate nitrogen (mg/L)	0.42	0.03	0.04	0.08		
Ammonia nitrogen (mg/L)	0.02	0.01	0.01	0.01		
Total Kjeldahl nitrogen (mg/L)	1.07	1.55	0.74	1.29	====	
Organic nitrogen (mg/L)	1.05	1.54	0.73	1.28		
Total nitrogen (mg/L)	1.57	1.59	0.78	1.38		
Orthophosphate (mg/L)	0.28	0.26	0.01	0.02		
Total phosphorus (mg/L)	0.33	0.34	0.03	0.10		
Total suspended solids (mg/LJ)	1.2	15.6	1.6	5.8		
Turbidity (NTU)	3.4	8.3	2.4	6.2	≤29 NTU Increase	
Oil and grease (mg/L)	2.2	2.0	1.8	2.3	≤5	
Biochemical oxygen demand (mg/L)	< 2.0	4.0	<2.0	2.9		

<sup>\\</sup>Fl-pal\projects\65437\docs\reports\Palmer Annual 03\Appendix D (2003)FB.doc

Table D-2. Summary of Water Quality Data Collected in the Catfish and North Creek Basin of Palmer Ranch on March 6, 2003, Sarasota County, Florida (Continued)

Parameters	Stat	ions	Water Quality
	CC-5	NC-6	Standards
Time	1020	1310	
Stream flow (cfs)	0.8	0.6	
Water depth (feet)	3.8	0.3	
Temperature (°C)	25.6	25.1	*****
$PH(-log[H^+])$	7.4	7.1	6.0 - 8.5
Dissolved oxygen (mg/L)	5.8	5.9	≥5.0
Specific conductivity (µmhos/cm)	1020	1058	≤1275
Total coliform bacteria (No./100 mL)	120	320	≤2,400
Fecal coliform bacteria (No./100 mL)	<10	280	≤800
Nitrite nitrogen (mg/L)	0.02	< 0.01	
Nitrate nitrogen (mg/L)	0.08	0.40	
Ammonia nitrogen (mg/L)	0.02	0.01	
Total Kjeldahl nitrogen (mg/L)	1.14	0.91	
Organic nitrogen (mg/L)	1.12	0.90	
Total nitrogen (mg/L)	1.24	1.32	
Orthophosphate (mg/L)	0.01	0.02	
Total phosphorus (mg/L)	0.08	0.06	
Total suspended solids (mg/L)	4.2	1.4	
Turbidity (NTU)	4.5	5.1	≤29 NTU Increase
Oil and grease (mg/L)	3.4	3.5	≤5
Biochemical oxygen demand (mg/L)	2.7	<2.0	

<sup>\*</sup>Non-compliance with water quality standards specified by FAC 62-302 and Sarasota County Ordinance 98-066 as amended, for Class III fresh waters.

Table D-3. Summary of Water Quality Data Collected in the South Creek Basin of Palmer Ranch on April 1, 2003, Sarasota County, Florida

Parameters	Stations				Water Quality
	SC-1	SC-2	SC-3	SC-4	Standards
Time	1048	1025	1130	1118	
Stream flow (cfs)	1.9	2.2	0	0	
Water depth (feet)	1.0	1.0	1.1	1.5	
Temperature (°C)	15.9	16.3	14.7	17.4	W 40 40 40 40
pH (-log[H <sup>+</sup> ])	7.1	6.7	7.2	7.4	6.0 - 8.5
Dissolved oxygen (mg/L)	7.3	7.5	2.1*	10.5	≥5.0
Specific conductivity (µmhos/cm)	804	872	435	794	≤1275
Total coliform bacteria (No./100 mL)	110	170	420	100	≤2,400
Fecal coliform bacteria (No./100 mL)	20	60	70	30	≤800
Nitrite nitrogen (mg/L)	< 0.01	< 0.01	< 0.01	< 0.01	
Nitrate nitrogen (mg/L)	0.01	0.01	< 0.01	< 0.01	
Ammonia nitrogen (mg/L)	0.03	0.03	0.30	0.21	
Total Kjeldahl nitrogen (mg/L)	0.71	0.72	1.06	0.76	
Organic nitrogen (mg/L)	0.68	0.71	0.76	0.55	
Total nitrogen (mg/L)	0.89	0.74	1.06	0.76	
Orthophosphate (mg/L)	0.06	0.06	0.07	0.02	
Total phosphorus (mg/L)	0.06	0.06	0.12	0.03	
Total suspended solids (mg/L)	1.8	1.8	6.4	4.4	
Turbidity (NTU)	1.2	1.4	7.1	4.3	≤29 NTU Increase
Oil and grease (mg/L)	<1.4	4.8	2.1	2.3	≤5
Biochemical oxygen demand (mg/L)	<2.0	<2.0	<2.0	<2.0	

<sup>\*</sup>Non-compliance with water quality standards specified by FAC 62-302 and Sarasota County Ordinance 98-066, as amended, for Class III fresh waters.

Table D-4 Summary of Water Quality Data Collected in the South Creek Basin of Palmer Ranch on July 28, 2003, Sarasota County, Florida

Parameters		Water Quality			
	SC-1	SC-2	SC-3	SC-4	Standards
Time	1218	1131	1337	1307	
Stream flow (cfs)	3.68	4.74	0.00	0.00	
Water depth (feet)	1.2	1.5	0.4	1.9	
Temperature (°C)	28.7	28.5	28.9	29.8	
pH (-log[H <sup>+</sup> ])	7.2	7.3	7.2	7.7	6.0 - 8.5
Dissolved oxygen (mg/L)	1.2*	2.8*	2.7*	11.8	≥5.0
Specific conductivity (umhos/cm)	668	491	535	628	≤1275
Total coliform bacteria (No./100 mL)	610	380	880	110	≤2,400
Fecal coliform bacteria (No./100 mL)	430	200	520	50	≤800
Nitrite nitrogen (mg/L)	0.01	0.01	0.02	< 0.01	
Nitrate nitrogen (mg/L)	0.05	0.04	0.40	< 0.01	
Ammonia nitrogen (mg/L)	< 0.01	< 0.01	0.10	0.06	
Total Kjeldahl nitrogen (mg/L)	1.25	1.32	2.79	1.13	
Organic Nitrogen (mg/L)	1.25	1.32	2.69	1.07	
Гotal nitrogen (mg/L)	1.31	1.37	3.20	1.14	
Orthophosphate (mg/L)	0.15	0.14	0.03	0.04	
Total phosphorus (mg/L)	0.18	0.17	0.87	0.10	
Total suspended solids (mg/L)	6.4	3.6	49.4	10.6	
Turbidity (NTU)	2.8	2.3	28.0	12.1	≤29 NTU Increase
Oil and grease (mg/L)	<1.4	<1.4	<1.4	<1.4	≤5
Biochemical oxygen demand (mg/L)	<2.0	<2.0	<2.0	2.7	

<sup>\*</sup>Non-compliance with water quality standards specified by FAC 62-302 and Sarasota County Ordinance 98-066, as amended, for Class III fresh waters.

Table D-5. Summary of Water Quality Data Collected in the Catfish and North Creek Basin of Palmer Ranch on September 12, 2003, Sarasota County, Florida

Parameters		Water Quality			
	CC-1	CC-2	CC-3	CC-4	Standards
Time	1240	1310	1337	1348	
Stream flow (cfs)	4.16	0.12	0.00	0.00	
Water depth (feet)	1.1	0.5	2.2	2.8	
Temperature (°C)	26.5	30.8	29.8	27.7	
pH (-log[H <sup>+</sup> ])	6.3	8.0	7.6	7.0	6.0 - 8.5
Dissolved oxygen (mg/L)	5.6	14.9	8.5	3.4*	≥5.0
Specific conductivity (umhos/cm)	510	802	528	661	≤1275
Total coliform bacteria (No./100 mL)	15,800*	5,300*	1,600	>20,000*	≤2,400
Fecal coliform bacteria (No./100 mL)	8,300*	900*	1,380*	>20,000*	≤800
Nitrite nitrogen (mg/L)	0.04	< 0.01	< 0.01	0.02	All No. 100 400 400
Nitrate nitrogen (mg/L)	0.38	0.09	0.02	0.30	
Ammonia nitrogen (mg/L)	0.02	0.01	0.01	0.01	
Total Kjeldahl nitrogen (mg/L)	0.96	0.90	0.93	0.76	
Organic nitrogen (mg/L)	0.94	0.89	0.92	0.75	
Total nitrogen (mg/L)	1.38	0.99	0.95	1.08	
Orthophosphate (mg/L)	0.14	0.21	0.06	0.11	
Total phosphorus (mg/L)	0.27	0.22	0.13	0.17	
Total suspended solids (mg/L)	19.6	2.4	5.0	2.4	
Turbidity (NTU)	12.7	1.4	3.1	3.4	≤29 NTU Increase
Oil and grease (mg/L)	2.13	3.30	<1.4	1.7	≤5
Biochemical oxygen demand (mg/L)	2.6	< 2.0	3.8	<2.0	
Arsenic as As (µg/L)	1.9	3.7	2.6	3.6	<50 <sup>a</sup>
Copper as Cu (µg/L)	1.5	<1.0	129*	2.6	<12.8 <sup>a</sup>
Lead as Pb (μg/L)	1.7	<1.0	<1.0	<1.0	<3.6 <sup>a</sup>
Zinc as Zn (mg/L)	10.6	<8	<8	<8	<115 <sup>a</sup>

<sup>&</sup>lt;sup>a</sup> Based on a hardness of 110 mg/L.

<sup>\*</sup>Non-compliance with water quality standards specified by FAC 62-302 and Sarasota County Ordinance 98-066, as amended, for Class III fresh waters.

Table D-5. Summary of Water Quality Data Collected in the Catfish and North Creek Basin of Palmer Ranch on September 12, 2003, Sarasota County, Florida (Continued)

Parameters	Stations		Water Quality
	CC-5	NC-6	Standards
Time	1405	1453	
Stream flow (cfs)	16.30	1.22	<b></b>
Water depth (feet)	1.7	0.4	
Temperature (°C)	28.8	30.0	
pH (-log[H <sup>+</sup> ])	7.0	7.0	6.0 - 8.5
Dissolved oxygen (mg/L)	3.8*	3.7*	≥5.0
Specific conductivity (µmhos/cm)	644	937	≤1275
Total coliform bacteria (No./100 mL)	>20,000*	>20,000*	≤2,400
Fecal coliform bacteria (No./100 mL)	>20,000*	19,100*	≤800
Nitrite nitrogen (mg/L)	0.01	0.02	
Nitrate nitrogen (mg/L)	0.23	0.02	
Ammonia nitrogen (mg/L)	0.01	0.04	<b>-</b>
Total Kjeldahl nitrogen (mg/L)	0.82	1.64	
Organic nitrogen (mg/L)	0.81	1.60	
Total nitrogen (mg/L)	1.06	1.68	
Orthophosphate (mg/L)	0.11	0.22	
Total phosphorus (mg/L)	0.16	0.44	
Total suspended solids (mg/L)	3.0	13.6	
Turbidity (NTU)	3.4	22	≤29 NTU Increase
Oil and grease (mg/L)	3.1	2.6	≤5
Biochemical oxygen demand (mg/L)	2.8	3.5	
Arsenic as As (µg/L)	4.6	3.6	<50 <sup>a</sup>
Copper as Cu (µg/L)	37.1*	1.6	<12.8 <sup>a</sup>
Lead as Pb (μg/L)	1.4	1.0	<3.6 <sup>a</sup>
Zinc as Zn (µg/L)	<8	<8	<115 <sup>a</sup>

<sup>&</sup>lt;sup>a</sup> Based on a hardness of 110 mg/L.

<sup>\*</sup>Non-compliance with water quality standards specified by FAC 62-302 and Sarasota County Ordinance 98-066, as amended, for Class III fresh waters.

Table D-6. Summary of Water Quality Data Collected in the South Creek Basin of Palmer Ranch on October 2, 2003, Sarasota County, Florida

Parameters		Water Quality			
	SC-1	SC-2	SC-3	SC-4	Standards
Time	1258	1223	1356	1333	<u> </u>
Stream flow (cfs)	11.3	13.0	0.0	0.0	10 de
Water depth (feet)	1.3	1.0	0.2	1.4	
Temperature (°C)	25.3	25.3	24.3	25.8	
pH (-log[H <sup>+</sup> ])	6.3	6.4	6.9	7.1	6.0 - 8.5
Dissolved oxygen (mg/L)	1.5*	2.6*	1.7*	7.3	≥5.0
Specific conductivity (µmhos/cm)	519	509	511	483	≤1275
Total coliform bacteria (No./100 mL)	2,100	1,900	2,700*	1,300	≤2,400
Fecal coliform bacteria (No./100 mL)	300	100	1,100*	400	≤800
Nitrite nitrogen (mg/L)	0.01	< 0.01	< 0.01	< 0.01	
Nitrate nitrogen (mg/L)	0.16	0.13	< 0.01	< 0.01	
Ammonia nitrogen (mg/L)	0.01	0.01	0.24	0.02	
Total Kjeldahl nitrogen (mg/L)	0.82	0.95	2.41	0.71	
Organic nitrogen (mg/L)	0.81	0.94	2.17	0.69	
Total nitrogen (mg/L)	0.99	1.09	2.41	0.71	
Orthophosphate (mg/L)	0.15	0.14	0.42	0.03	
Total phosphorus (mg/L)	0.21	0.18	1.00	0.21	
Total suspended solids (mg/L)	4.8	3.8	292	14.8	
Turbidity (NTU) <sup>a</sup>	3.5	4.8	820*	36*	≤29 NTU Increase
Oil and grease (mg/L)	3.9	1.6	2.8	<1.0	≤5
Biochemical oxygen demand (mg/L)	<3.3	<3.3	11.0	5.2	
Arsenic as As ((µg/L)	1.7	<1.0	6.4	<1.0	<50°a
Copper as Cu ((µg/L)	1.6	1.9	<1.0	<1.0	<12.8 a
Lead as Pb (µg/L)	<1.0	<1.0	<1.0	<1.0	<3.6 a
Zinc as Zn (µg/L)	946*	<8	<8	8	<115 <sup>a</sup>

<sup>&</sup>lt;sup>a</sup>Based on a hardness of 110 mg/L.

<sup>\*</sup>Non-compliance with water quality standards specified by FAC 62-302 and/or Sarasota County Ordinance 98-066 for Class III fresh waters.

### Appendix E

Project Team

Senior Environmental Scientist

Mr. Gary Serviss has over twenty years of technical and project management experience in environmental assessments and permitting. He has extensive experience in wetlands evaluation/classification, mitigation design, wildlife evaluations, and habitat mapping. He has designed and coordinated numerous environmental investigations to serve as a basis for environmental permit applications and Development of Regional Impact Applications. He has served as an expert witness on environmental constraints, bald eagles and wetland impacts related to dredge and fill activities. Mr. Serviss has been certified by the U. S. Army Corps of Engineers as a Wetland Delineator.

His recent project experience includes

### University Lakes at Lakewood Ranch (2300 $\pm$ ac.), Sarasota Co., FL

Task Manager to conduct an ecological site assessment for the Development of Regional Impact Application. Assessment involved individual wetland inventory for jurisdiction and mitigation potential and an Endangered and Threatened species survey. Assisted in the development and refinement of the Master Development Plan to minimize adverse ecological consequences. Coordinated detailed habitat mapping, gopher tortoise and other wildlife surveys. Prepared responses to DRI questions and sufficiency questions relative to vegetation communities, wildlife and wetlands.

#### Pelican Point (968 ac.), Sarasota Co., FL

Designed and supervised habitat mapping, wetland and SHW/NP delineation, and protected species surveys for bald eagle, red-cockaded woodpeckers, gopher tortoise and scrub jays. Assisted in the preparation of environmental permit applications to Sarasota County, ACOE and SWFWMD for approval of the golf course and initial phases of development. Designed mitigation areas and supervised the construction and mulch transfer process. Prepared a Gopher tortoise and Scrub jay management plan and obtained FGFWFC and USFWS approval.

#### Tampa Bay Water, South Central Hillsborough Regional Wellfield, Hillsborough Co., FL

Project Manager for a three-year project to monitor the ecological condition of the wellfield and surrounding areas to detect possible ecological effects attributable to wellfield pumpage. Water level and wildlife information were collected monthly at 27 sites. Qualitative vegetative information was collected bi-annually from the 27 sites. Quantitative data on species composition and percent cover was collected bi-annually for herbaceous and shrub vegetation and annually for trees at six sites. Infrared aerial photography was analyzed twice a year for land use and hydrologic changes. Prepared progress reports bi-annually and a comprehensive annual report.

### Palmer Ranch "Eastside" Development (2746± ac.), Sarasota Co., FL

Project Scientist for Environmental Analysis. Supervised site assessments of vegetation communities and threatened/endangered species occurrence. Assisted with preparation of impact assessment report and development of master drainage plan for purposes of maintaining wetland hydroperiod. Assisted with preparation and processing of wetland resource permit and conceptual MSSW permit application for entire tract.

#### Cypress Lakes Development, Polk Co., FL

Task Manager to conduct field surveys to flag wetland limits and to mark the seasonal

Mr. Gary Serviss is a senior member of the VHB Environmental Services Division staff. He is responsible for the management and direction of projects and staff for qualitative and quantitative vegetation and wildlife assessments, wildlife management plan formulation and natural system restoration and mitigation plans. He also serves as a task manager client and liaison for environmental resource permitting.

Continued, p. 2

high water and normal pool elevations within the wetlands. Obtained agency verifications of wetland jurisdiction and assisted in the permit application preparation and processing. Approval was obtained from the Florida Game and Fresh Water Fish Commission of a recipient site to relocate gopher tortoises and eleven tortoises were relocated.

### Wellington Commons (466± ac.), Palm Beach Co., FL

Project Scientist for the preparation and processing of a Development of Regional Impact application. Also assisted in the preparation and processing of an ERP application for the project through the ACOE and a Conceptual Environmental Resource Permit through SFWMD. Permitting involved impacts to 9.87 acres of wetland, mitigation plan preparation, restoration plans for the hydroperiod of preserved wetlands and a preservation plan for a protected plant (Hand Adder's tongue fern) .

#### Little Sarasota Bay Study, Sarasota Co., FL

Project Scientist to coordinate the Biological, Hydrological and Water Quality assessment of Little Sarasota Bay. Analyzed the biological data (including seagrass, macroalgae, benthic infauna, fish fauna and phytoplankton) and co-authored the "Ecological Status of Little Sarasota Bay with reference to Midnight Pass" report. Also coordinated the biological assessment of the permit to dredge Midnight Pass. Involved the delineation of marine habitats, benthic infauna monitoring, fish fauna monitoring and sediment analysis.

#### University Place Development of Regional Impact (1,500 ac.), Sarasota Co., FL

Project Scientist for implementation of a site assessment of 1,500 acres. Assessment included mapping of habitats by APOXSEE nomenclature; individual inventory of each wetland for size, function, habitat value, mitigation potential and agency jurisdiction; and an Endangered and Threatened species survey. Developed environmental methodology for wetlands and protected species and obtained County approval. Coordinated the field surveys of wetlands and wildlife and prepared DRI responses and sufficiency responses. Prepared wildlife management plan for submission to FGFWFC.

#### Matthews, Hutton and Eastmore, Sarasota Co., FL

Project manager to attend a deposition of a bald eagle expert relative to a condemnation hearing for a county park acquisition. Conducted a field survey of the site in question, reviewed the project history, bald eagle articles and assisted in establishing hearing strategies. Expert testimony was presented relative to bald eagle constraints, native habitats and potential impacts to Lemon Bay.

#### Estero River Bay (1,269 ac.), Lee Co., FL

Project Scientist involved in the habitat mapping, wetland delineation and protected species survey. Coordinated the quantitative survey for Lee County Listed Species on the 691 acre portion of the site proposed for development. Prepared responses for the Environmental Impact Assessment portion of the rezone application including the Protected Species Survey report.

**PUBLICATIONS** 

Continued, p. 3

Sauers, S. and G. Serviss. 1985. Ecological Status of Little Sarasota Bay with reference to Midnight Pass. County of Sarasota, Florida. 92 pp.

Alevizon, W., R. Richardson, P. Pitts, and G. Serviss. 1985. Coral Zonations and Patterns of Community Structure in Bahamian Reef Fishes. Bull. Mar. Sci. 36(2): 304-318.

Melton, R. B., and G. Serviss. 2000. Florida Power Corporation – Anclote Power Plant Entrainment Survival of Zooplankton. Environmental Science & Policy 3:S233-S248.

Education

M.S., Florida Institute of Technology, Melbourne, FL, 1982

(Biological Sciences)

B.S., Florida Institute of Technology, Melbourne, FL, 1979

(Marine Biology)

**Affiliations** 

Sarasota Bay National Estuary Program's Artificial Habitat

Enhancement Task Force

Sea Grant Marine Advisory Committee Sarasota County Artificial Reef Committee

Certification

Certified Wetland Delineator

### Thomas D. Dostal

**Environmental Scientist** 

Mr. Thomas Dostal has conducted qualitative and quantitative vegetation monitoring, threatened and endangered species surveys, and water quality monitoring and sampling programs. He has assisted with habitat mapping and classification. Additionally, he has assisted with wetland jurisdictional delineation's and wetland hydroperiod determinations.

His recent project experience includes:

#### FPC Transmission Line, Osceola and Orange Counties, FL

Field Scientist to assist with wetland delineation along 22 miles of proposed powerline corridor. Utilized specific criteria (hydrology, soil type, and vegetation present) to determine natural wetland boundaries.

#### Duette Park (21,000 ± ac.), Manatee Co., FL

Field Scientist on habitat mapping survey at Duette Park. Also served as a field team member for threatened and endangered flora surveys on site.

#### Pinellas County Public Works Department, Pinellas Co., FL

Conducted monthly status monitoring events of planted lake littoral zones and mitigation areas for multiple roadway projects. Qualitative and quantitative monitoring of mitigation areas was also conducted. Results were summarized in technical reports.

#### South Central Hillsborough Regional Wellfield, Hillsborough Co., FL

Performed monthly surface water and groundwater level monitoring at 14 sites adjacent to the wellfield. Assisted in wetland assessment procedure (WAP) and quantitative vegetation surveys. Managed and manipulated water level and WAP data and drafted reports. Reviewed and interpreted satellite imagery and color aerial photography for land use and hydrologic changes.

#### Palmer Ranch, Sarasota Co., FL

Conducted semi-annual water quality monitoring and sampling at 6 stations within Catfish Creek and North Creek and quarterly monitoring of 4 stations in South Creek Prepared semi-annual data reports discussing water quality analyses and an annual interpretive report.

#### Lennar Homes, Sarasota Co., FL

Project Scientist to ensure environmental compliance at the Hamptons, a large residential construction site. Services included observations of wetland mulch transfer, daily erosion control measures inspections, success monitoring of two enhanced wetland mitigation areas and lake littoral zones and monitoring of bald eagle behavior relative to construction activities.

#### Brandon Urban Dispersed Wells Project, Hillsborough County, FL

Project scientist conducting bimonthly water level observations at staff gages and piezometers at 23 stations. Assisted in the collection of wetland assessment procedure (WAP) and quantitative data. Responsible for site mobilization and data QA/QC.

Mr. Dostal is a field scientist with the VHB Environmental Services Division and has four years experience with ecological data collection, wetland mitigation monitoring and water quality compliance monitoring.

Continued, p. 2

#### The Williams Company, Polk Co., FL

Assisted with Threatened and Endangered flora and fauna surveys which included small mammal and herpetofaunal trapping and pedestrian transects. Also conducted American kestrel survey and collected water quality samples in response to DRI questions for Saddle Creek site.

#### Seagrass Bed Study, Tarpon Springs, Pinellas County, FL

Project Scientist for a 10-month study to determine the effect of temperature on seagrass growth. Survey methods included the use of temperature and salinity data logging equipment including Ryan and YSI instrumentation which were located in the field through DGPS. Seagrass density surveys were also conducted utilizing SCUBA. Summarized temperature and salinity data for the monitoring period.

#### Cargill Fertilizer, Hillsborough Co., FL

Assisted with jurisdictional wetland delineations, habitat mapping and tree survey. Information was used to prepare Consolidated Development Application for gypsum disposal area. Mobilized for and monitored habitat enhancement and restoration areas.

#### Florida Power Corp., Marion Co., FL

Conducted jurisdictional wetland delineation and preparation for submittal to ACOE for the Ross Prairie Substation.

#### Manatee County, Manatee Co., FL

Assisted with habitat mapping using the Florida Natural Areas Inventory's Guide to the Natural Communities of Florida, community type characterization, and threatened and endangered flora surveys at the Manatee River Headwaters property (2100 acres) and Duette Park (21,300 acres).

Formation DA Haironsitr of Courth Florida Tanna Florida

Education

BA, University of South Florida, Tampa Florida Interdisciplinary Natural Sciences; Biology concentration

### **James Warren McGavic**

**Environmental Scientist** 

Mr. McGavic has experience in a variety of ecological and hydrological monitoring projects, which include sampling shallow monitor wells, collecting water quality samples and conducting qualitative vegetation and

wildlife surveys.

Mr. McGavic is an environmental scientist in VHB's Palmetto office. He has one year of field experience in a variety of ecological and hydrological monitoring projects, which include sampling shallow monitor wells, collecting water quality samples, and conducting qualitative vegetation and wildlife surveys. A representative summary of Mr. McGavic's experience is as follows:

#### Pinellas County Public Works Department, Pinellas County, FL

Mr. McGavic conducts monitoring events of planted lake littoral zones and wetland mitigation areas for multiple roadway projects. Qualitative monitoring of mitigation areas is conducted as well as annual quantitative monitoring to identify species and success of planted species. Results are summarized in reports.

#### South Central Hillsborough Regional Wellfield, Hillsborough County, FL

Performs monthly surface water and groundwater level monitoring at 14 sites located within the wellfields. Assists in qualitative and quantitative vegetation surveys. Enters water level data in a computerized database.

#### Brandon Urban Dispersed Wells Project, Hillsborough County, FL

Project scientist conducting bimonthly water level observations at staff gages and piezometers at 23 stations. Assisted in the collection of wetland assessment procedure (WAP) and quantitative data. Responsible for site mobilization and data QA/QC.

#### T. Mabry Carlton, Jr., Memorial Reserve Wellfield, Sarasota County, FL

Task manager for the collection of monthly water level data from 46 wetlands and 27 wells as well as 6 manual rain gages. Also conducts water quality monitoring on a quarterly basis at 17 wells and annually uses a Trimble GPS unit to delineate wetland boundaries.

#### Field Research Experience:

#### **Honors Thesis- Pocket Gopher Study**

Research study of the effects of the pocket gopher (*Geomys pinetis*) as an engineer in fire adapted longleaf pine-turkey oak sandhill communities.

#### Education

B.S. (with honors), Wildlife Ecology and Conservation, University of Florida, Gainesville, FL, December 2000

University of Florida, Gamesville, FL, December 2000

A.A., Biology, Manatee Community College, Bradenton, FL, May 1997

Professional Culinary Arts Study, Culinary Institute of America,

Hyde Park, NY, 1984-1985

#### **Affiliations**

Golden Key National Honor Society

Ducks Unlimited The Wildlife Society

The Rocky Mountain Elk Foundation

### Florentyna N. Baggett

Environmental Scientist

Ms. Baggett is an environmental scientist in VHB's Palmetto office. She has field experience in a variety of ecological and hydrological monitoring projects, which include sampling shallow monitor wells, collecting water quality samples, and conducting qualitative vegetation and wildlife surveys. A representative summary of Ms. Baggett's experience is as follows:

#### South Central Hillsborough Regional Wellfield, Hillsborough County, FL

Performs monthly surface water and groundwater level monitoring at 14 sites located within the wellfields. Assists in qualitative and quantitative vegetation surveys. Enters water level data in a computerized database.

#### Brandon Urban Dispersed Wells Project, Hillsborough County, FL

Project scientist conducting bimonthly water level observations at staff gages and piezometers at 23 stations. Assisted in the collection of wetland assessment procedure (WAP) and quantitative data. Responsible for site mobilization and data QA/QC.

#### T. Mabry Carlton, Jr., Memorial Reserve Wellfield, Sarasota County, FL

Project scientist for the collection of monthly water level data from 46 wetlands and 27 wells as well as 6 manual rain gages. Also conducts water quality monitoring on a quarterly basis at 17 wells and annually uses a Trimble GPS unit to delineate wetland boundaries.

#### Palmer Ranch Development, Ltd.

Conducted semi-annual water quality monitoring and sampling at 6 stations within Catfish Creek and North Creek. Prepared semi-annual data reports discussing water quality analyses and an annual interpretive report. Sarasota County, Florida.

Conducted quarterly water quality monitoring and sampling at 4 stations within South Creek (Eastside). Prepared quarterly reports discussing water quality analyses and an annual interpretive report. Sarasota County, Florida.

#### Creekwood Development, Ltd.

Conducted semi-annual water quality monitoring program. Performed *in-situ* measurements and collected samples for laboratory analysis from five surface water and four groundwater sites. Prepared quarterly data reports and an annual summary report. Manatee County, Florida.

### Field Research Experience:

**Education** B.S., Biology, University of South Florida, Tampa, FL, July 1999

A.A., Manatee Community College, Bradenton, FL, May 1996

**Affiliations** 

Ms. Baggett has experience in a variety of ecological and hydrological monitoring projects, which include sampling shallow monitor wells, collecting water quality samples and conducting qualitative vegetation and wildlife surveys.